

LIEBHERR A922146822-1509 - Rear Differential

Sample No: LH0285067

Oil Type: GEAR OIL SAE 80W90

A

- 1.

INFORMATION SUR L'ÉCHANTILLON

Numéro d'échant.	LH0285067	 	
Date d'échant.	29 Jan 2024	 	
Heures de la Machine	1252	 	
Heures de l'huile	0	 	
Huile changée	Changed	 	
Statut de l'echant.	NORMAL	 	

🌒 ÉTATI	D'HUILE				
isc 40°C	cSt	0 138		 	

Eau	%	NEG				
Silicium	ppm	08				
Sodium	ppm	07				
Potassium	maa	02				

 \odot **MéTAUX D'USURE** PQ 0 117 Fer 180 ppm Cuivre 0 16 ppm Plomb ○ <1 ppm Étain ppm 0 Aluminium ppm 03 Chrome 02 ppm Molybdène ppm 0 Nickel ppm ○ <1 Titane 0 ppm Argent <1 ppm Manganèse 05 ppm Vanadium ppm 0

0 **ADDITIFS** Calcium 0 16 ppm Magnésium 02 ppm Zinc ppm 28 Phosphore 0 1660 ppm Baryum ppm 0 19 Bore ppm 0 97





PNR RAILWORKS INC. 65 MASSEY ROAD GUELPH NW, ON CA N1H 7M6

Contact: Service Manager

T: F:

Diagnostic

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W90. Please confirm.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: Unique No: Signed: Report Date:


PNRGUE 5721341 Bill Quesnel 31 Jan 2024





GRAPHS

 \odot

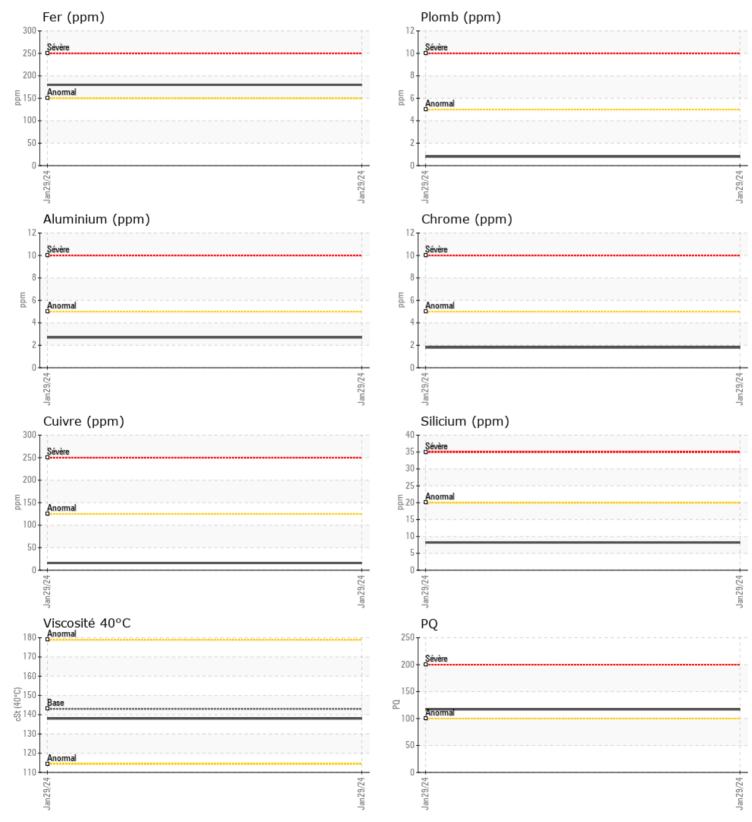

ID du rapport: PNRGUE [WCAMIS] 02612246 (Generated: 02/02/2024 11:16:29) Rev: 1