

LIEBHERR LH40M 155749-1215 - Rear Differential

Sample No: LH0286915

Oil Type:

GEAR OIL SAE 80W90

INFORMATION SUR L'ÉCHANTILLON

0 142

LH0286915		
10 Mar 2024		
497		
0		
Changed		
NORMAL		
	10 Mar 2024 497 0 Changed	10 Mar 2024 497 0 Changed

ÉTAT D'HUILE

Visc 40°C -

cSt

Eau	%	NEG					
Silicium	ppm	04					
Sodium	ppm	0 2					
Potassium	ppm	01					

Ä				
🥮 MéT	AUX D'U	ISURE		
Fer	ppm	0 19	 	
Cuivre	ppm	08	 	
Plomb	ppm	○ <1	 	
Étain	ppm	0 0	 	
Aluminium	ppm	○ <1	 	
Chrome	ppm	○ <1	 	
Molybdène	ppm	○ <1	 	
Nickel	ppm	<mark></mark> <1	 	
Titane	ppm	0	 	
Argent	ppm	0	 	
Manganèse	ppm	<mark></mark> <1	 	
Vanadium	ppm	0	 	

٥ **ADDITIFS** Calcium 0 129 ppm 01 Magnésium ppm Zinc 0 20 ppm Phosphore ppm 0 1436 Baryum ◯ <1 ppm Bore ppm 09





MOFFATT SCRAP IRON & METAL INC. 9620 GUELPH LINE

CAMPBELLVILLE, ON CA LOP 1B0 Contact: Paul Brochu maintenance@moffatscrapiron.ca T: (905)854-2792 F: (905)854-1225

Diagnostic

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W90. Please confirm.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: Unique No: Signed: **Report Date:**


MOFMOF 5746326 Kevin Marson 11 Mar 2024





GRAPHS

 $\overline{\mathbf{O}}$

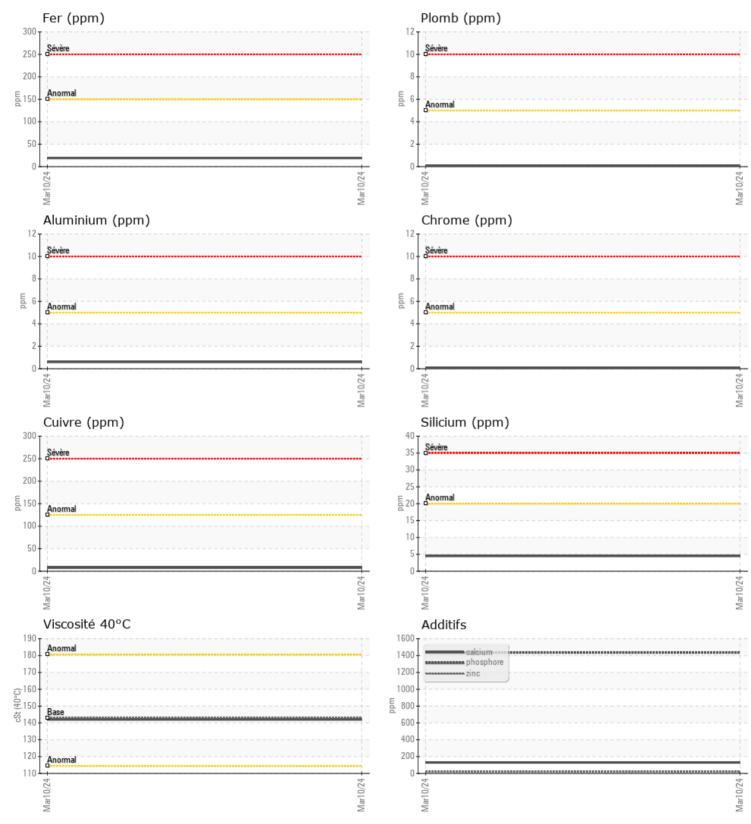

ID du rapport: MOFMOF [WCAMIS] 02621207 (Generated: 03/12/2024 15:48:30) Rev: 2