




OIL ANALYSIS REPORT

Sample Rating Trend

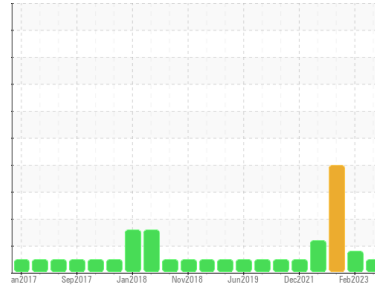

NORMAL



Machine Id

9951

Component

Diesel Engine

Fluid

PETRO CANADA DURON XL SYN BLEND 15W40 (37 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history 1	history 2
Sample Number	Client Info		GFL0077589	GFL0063747	GFL0060213
Sample Date	Client Info		03 Jul 2023	01 Feb 2023	10 Nov 2022
Machine Age	kms	Client Info	486366	24847	24456
Oil Age	kms	Client Info	0	1205	1064
Oil Changed	Client Info		Changed	Changed	Changed
Sample Status			NORMAL	MARGINAL	SEVERE

CONTAMINATION

	method	limit/base	current	history 1	history 2
Fuel	WC Method	>3.0	<1.0	▲ 2.1	■ 5.3
Glycol	WC Method		NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history 1	history 2	
Iron	ppm	ASTM D5185(m)	>120	21	13	37
Chromium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>5	<1	<1	<1
Titanium	ppm	ASTM D5185(m)	>2	0	<1	<1
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	4	2	3
Lead	ppm	ASTM D5185(m)	>40	<1	<1	4
Copper	ppm	ASTM D5185(m)	>330	3	1	2
Tin	ppm	ASTM D5185(m)	>15	<1	<1	<1
Antimony	ppm	ASTM D5185(m)		0	<1	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history 1	history 2	
Boron	ppm	ASTM D5185(m)	1	3	14	2
Barium	ppm	ASTM D5185(m)	1	0	0	0
Molybdenum	ppm	ASTM D5185(m)	60	56	46	53
Manganese	ppm	ASTM D5185(m)	1	<1	<1	<1
Magnesium	ppm	ASTM D5185(m)	1010	909	754	839
Calcium	ppm	ASTM D5185(m)	1070	1044	1313	967
Phosphorus	ppm	ASTM D5185(m)	1150	1024	1065	906
Zinc	ppm	ASTM D5185(m)	1270	1146	1150	1063
Sulfur	ppm	ASTM D5185(m)	2060	2467	2734	2220
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS



	method	limit/base	current	history 1	history 2	
Silicon	ppm	ASTM D5185(m)	>25	11	16	▲ 42
Sodium	ppm	ASTM D5185(m)		6	4	8
Potassium	ppm	ASTM D5185(m)	>20	<1	2	1

INFRA-RED

	method	limit/base	current	history 1	history 2	
Soot %	%	ASTM D7844*	>4	1.1	0.1	2
Nitration	Abs/cm	ASTM D7624*	>20	9.6	7.4	12.9
Sulfation	Abs/1mm	ASTM D7415*	>30	21.4	20.6	27.4



OIL ANALYSIS REPORT







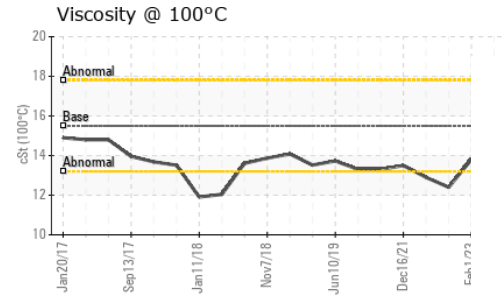
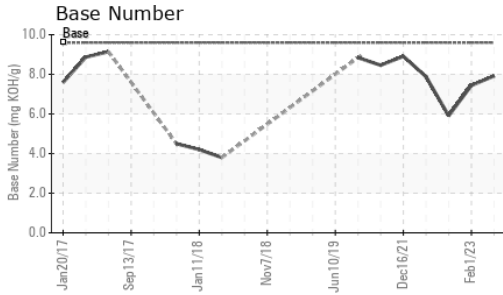


FLUID DEGRADATION		method	limit/base	current	history 1	history 2
Oxidation	Abs./1mm	ASTM D7414*	>25	16.7	15.3	21.6
Base Number (BN)	mg KOH/g	ASTM D2896*	9.6	7.92	7.44	5.91

VISUAL		method	limit/base	current	history 1	history 2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history 1	history 2
Visc @ 100°C	cSt	ASTM D7279(m)	15.5	13.3	13.8	▲ 12.4

GRAPHS

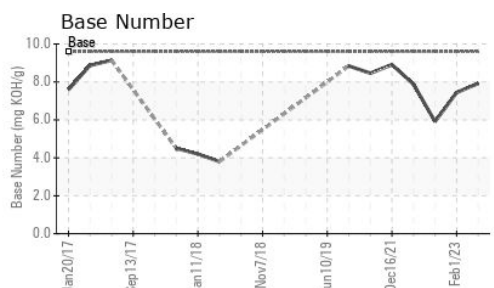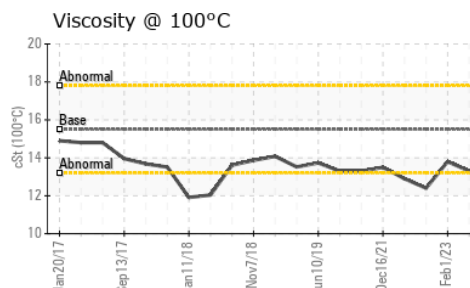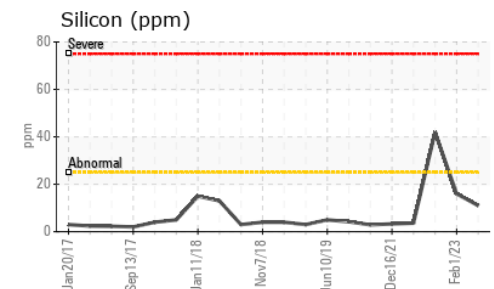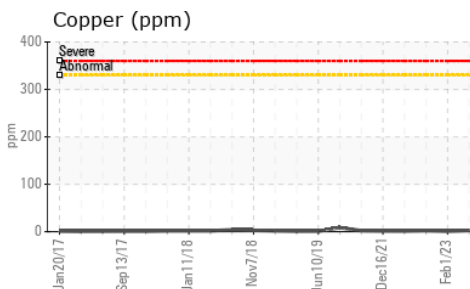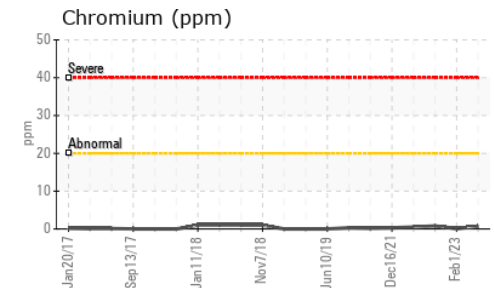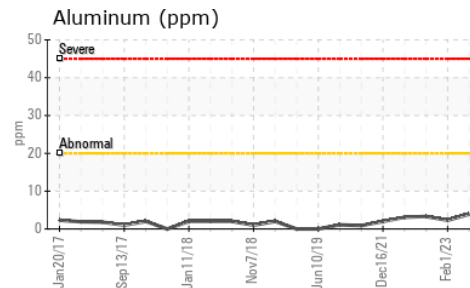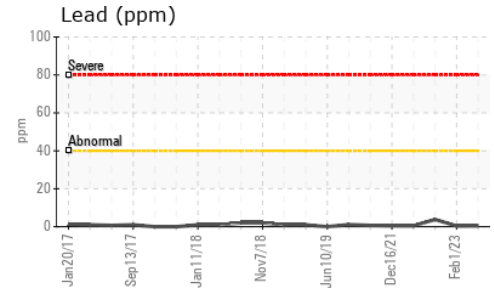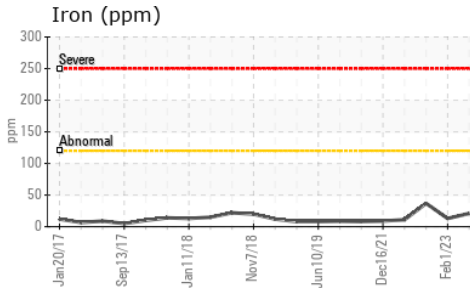

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 550 - Rocky View County
Sample No. : GFL0077589 **Received** : 11 Jul 2023
Lab Number : 02568978 **Diagnosed** : 11 Jul 2023
Unique Number : 5606024 **Diagnostician** : Wes Davis
Test Package : MOB 2

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

220 Carmek Blvd
 Rocky View County, AB
 CA T1X 1X1
 Contact: GFL Calgary
 calgarymaintenance@gflenv.com
 T:
 F: (403)369-6163