


# OIL ANALYSIS REPORT

Sample Rating Trend



**NORMAL**

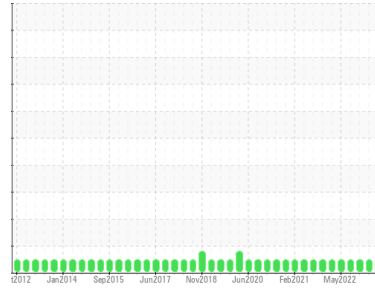

Area  
**TEAM 3**  
Machine Id  
**165172**  
Component  
**Inboard Bearing**  
Fluid  
**PETRO CANADA TURBOFLO R&O 220 (1 QTS)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>PC0070418</b>	PC0070273	PC0062575
Sample Date	Client Info		<b>08 Aug 2023</b>	06 Feb 2023	15 Nov 2022
Machine Age	mths	Client Info	<b>0</b>	0	0
Oil Age	mths	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		<b>0</b>	0	0
Iron	ppm	ASTM D5185(m) >20	<b>3</b>	2	2
Chromium	ppm	ASTM D5185(m) >20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m) >20	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	<1	0
Lead	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	0	2
Copper	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	0	0
Tin	ppm	ASTM D5185(m) >20	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	1
Barium	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	<b>0</b>	<1	0
Calcium	ppm	ASTM D5185(m) 0	<b>&lt;1</b>	0	<1
Phosphorus	ppm	ASTM D5185(m) 4	<b>9</b>	9	23
Zinc	ppm	ASTM D5185(m) 0	<b>5</b>	2	3
Sulfur	ppm	ASTM D5185(m)	<b>995</b>	1216	1189
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1





## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	<b>&lt;1</b>	1	1
Sodium	ppm	ASTM D5185(m)	<b>0</b>	0	<1
Potassium	ppm	ASTM D5185(m) >20	<b>0</b>	0	0

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974* 0.17	<b>0.10</b>	0.14	0.15

# OIL ANALYSIS REPORT


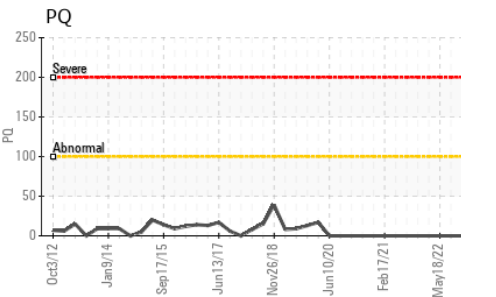
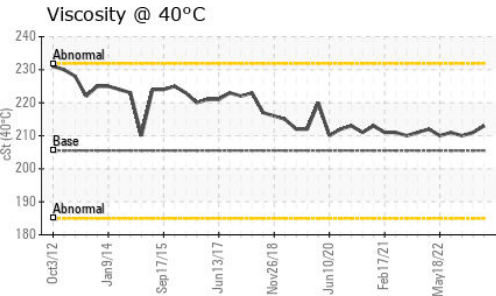
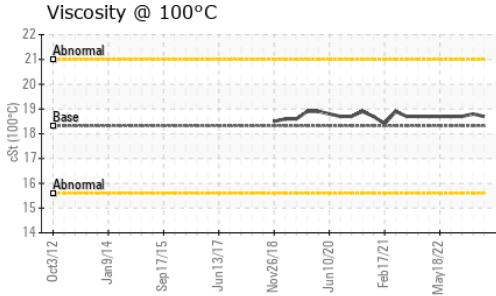
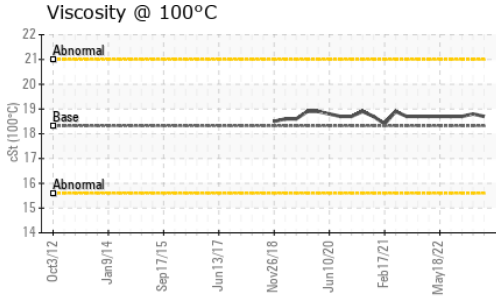


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	205.5	213	211
Visc @ 100°C	cSt	ASTM D7279(m)	18.32	18.7	18.8
Viscosity Index (VI)	Scale	ASTM D2270*	98	97	99

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

## GRAPHS

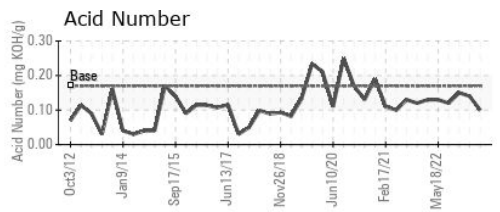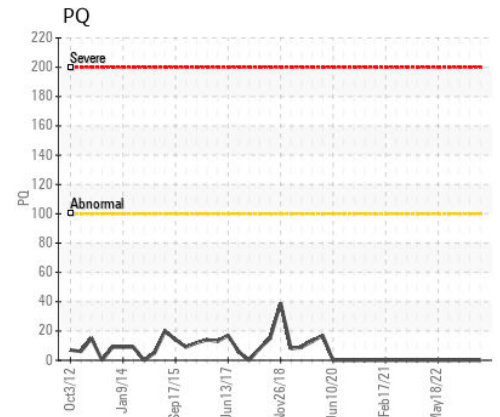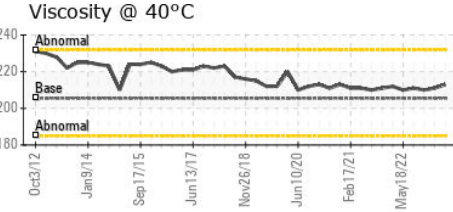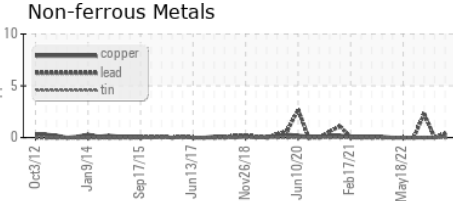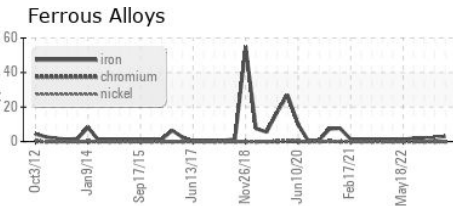

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PC0070418 **Received** : 17 Aug 2023  
**Lab Number** : 02576561 **Diagnosed** : 21 Aug 2023  
**Unique Number** : 5629621 **Diagnostician** : Kevin Marson  
**Test Package** : IND 2 ( Additional Tests: KV100, VI )

**Dryden Fibre**  
 Box 3001, 1 Duke Street  
 Dryden, ON  
 CA P8N 2Z7  
 Contact: Yvon St. Laurent  
 yvon.stlaurent@domtar.com  
 T: (807)223-9838  
 F: (807)223-9176

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.