



OIL ANALYSIS REPORT

Sample Rating Trend


ISO



Machine Id
512018

Component
Hydraulic System

Fluid
AW HYDRAULIC OIL ISO 32 (--- GAL)

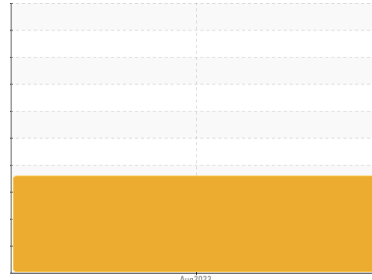

DIAGNOSIS

Recommendation

Vérifier les scelles et/ou les filtres pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous recommandons le remplacement des filtres de ce composant. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation. Le fluide n'était pas spécifié, toutefois, une comparaison avec d'autres fluides indiqua que ce fluide est du (GENERIC) AW HYDRAULIC OIL ISO 32. Veuillez confirmer.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

Fluid Condition

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0089221	---	---
Sample Date	Client Info		25 Aug 2023	---	---
Machine Age	kms	Client Info	160995	---	---
Oil Age	kms	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			SEVERE	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >50	11	---	---
Chromium	ppm	ASTM D5185(m) >10	3	---	---
Nickel	ppm	ASTM D5185(m) >4	0	---	---
Titanium	ppm	ASTM D5185(m)	0	---	---
Silver	ppm	ASTM D5185(m)	0	---	---
Aluminum	ppm	ASTM D5185(m) >5	3	---	---
Lead	ppm	ASTM D5185(m) >4	<1	---	---
Copper	ppm	ASTM D5185(m) >15	3	---	---
Tin	ppm	ASTM D5185(m) >4	0	---	---
Antimony	ppm	ASTM D5185(m)	0	---	---
Vanadium	ppm	ASTM D5185(m)	0	---	---
Beryllium	ppm	ASTM D5185(m)	0	---	---
Cadmium	ppm	ASTM D5185(m)	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 5	7	---	---
Barium	ppm	ASTM D5185(m) 5	0	---	---
Molybdenum	ppm	ASTM D5185(m) 5	2	---	---
Manganese	ppm	ASTM D5185(m)	<1	---	---
Magnesium	ppm	ASTM D5185(m) 25	37	---	---
Calcium	ppm	ASTM D5185(m) 200	189	---	---
Phosphorus	ppm	ASTM D5185(m) 300	388	---	---
Zinc	ppm	ASTM D5185(m) 370	439	---	---
Sulfur	ppm	ASTM D5185(m) 2500	1225	---	---
Lithium	ppm	ASTM D5185(m)	<1	---	---

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	3	---	---
Sodium	ppm	ASTM D5185(m)	4	---	---
Potassium	ppm	ASTM D5185(m) >20	1	---	---

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	117918	---	---
Particles >6µm	ASTM D7647	>1300	23985	---	---
Particles >14µm	ASTM D7647	>160	154	---	---
Particles >21µm	ASTM D7647	>40	20	---	---
Particles >38µm	ASTM D7647	>10	1	---	---
Particles >71µm	ASTM D7647	>3	0	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	24/22/14	---	---



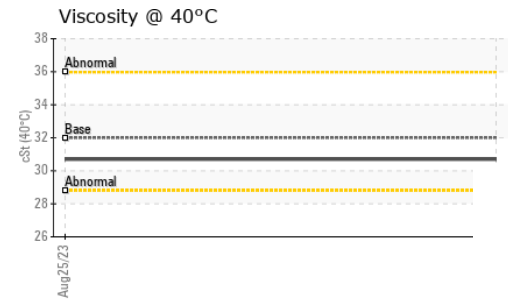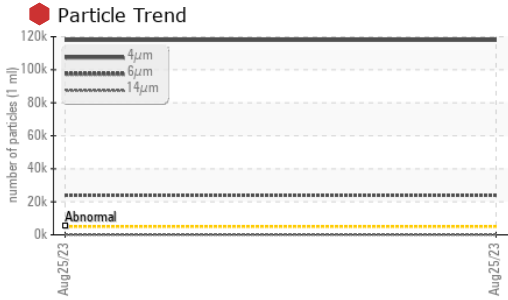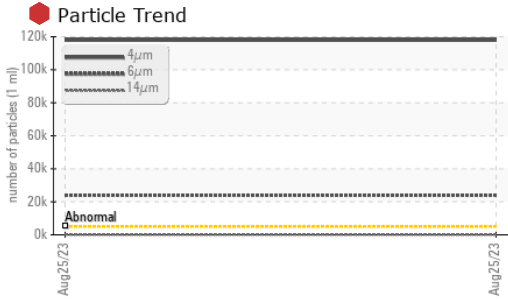

OIL ANALYSIS REPORT







VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	VLITE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	32	30.7	---	---

SAMPLE IMAGES

	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS

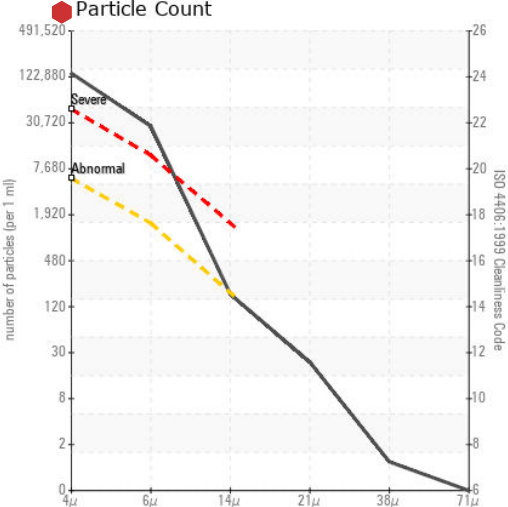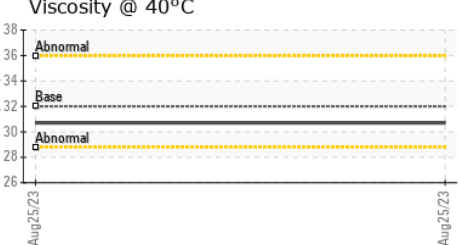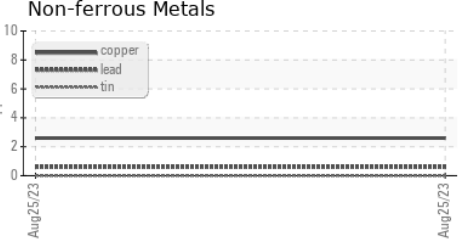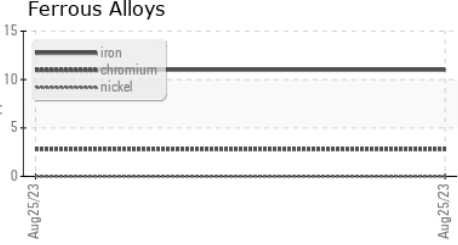

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 784 - Saint-Hyacinthe
Sample No. : GFL0089221 **Received** : 28 Aug 2023
Lab Number : 02578805 **Diagnosed** : 29 Aug 2023
Unique Number : 5631865 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

3525 Boul. Laurier Est.,
 Saint-Hyacinthe, QC
 CA J2R 2B2
 Contact: Nadine Authier
 nauthier@matrec.ca
 T: (450)773-9689
 F: