



OIL ANALYSIS REPORT

Sample Rating Trend


ISO



Machine Id
426132

Component
Hydraulic System

Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

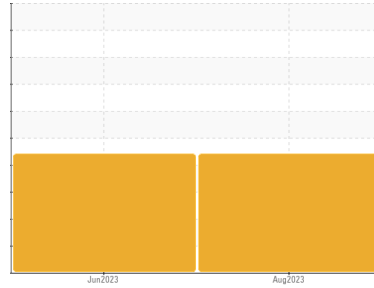

DIAGNOSIS

Recommendation

Nous vous recommandons de vérifier tous les endroits par lesquels des contaminants peuvent pénétrer dans le système. Nous vous recommandons de remplacer le filtre et d'utiliser un système de filtrage hors-ligne afin d'améliorer la propreté du fluide. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessiccant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Confirm the source of the lubricant being utilized for top-up/fill. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une quantité élevée de matières particulaires (2 à 100 µm de taille) présente dans l'huile.

Fluid Condition

La viscosité de l'huile est plus élevée que la normale. Les niveaux d'additifs indiquent l'ajout d'une autre marque ou d'un autre type d'huile. l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0088799	GFL0084413	---
Sample Date	Client Info		23 Aug 2023	29 Jun 2023	---
Machine Age	hrs	Client Info	13104	310528	---
Oil Age	hrs	Client Info	12000	0	---
Oil Changed	Client Info		Not Changed	Not Changed	---
Sample Status			SEVERE	SEVERE	---

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		0	0	---
Iron	ppm	ASTM D5185(m) >20	21	20	---
Chromium	ppm	ASTM D5185(m) >10	2	2	---
Nickel	ppm	ASTM D5185(m) >10	<1	<1	---
Titanium	ppm	ASTM D5185(m)	<1	<1	---
Silver	ppm	ASTM D5185(m)	0	1	---
Aluminum	ppm	ASTM D5185(m) >10	2	2	---
Lead	ppm	ASTM D5185(m) >10	<1	<1	---
Copper	ppm	ASTM D5185(m) >75	<1	<1	---
Tin	ppm	ASTM D5185(m) >10	0	0	---
Antimony	ppm	ASTM D5185(m)	0	0	---
Vanadium	ppm	ASTM D5185(m)	0	0	---
Beryllium	ppm	ASTM D5185(m)	0	0	---
Cadmium	ppm	ASTM D5185(m)	0	0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	24	22	---
Barium	ppm	ASTM D5185(m) 0	0	0	---
Molybdenum	ppm	ASTM D5185(m) 0	3	3	---
Manganese	ppm	ASTM D5185(m) 1	<1	<1	---
Magnesium	ppm	ASTM D5185(m) 0	18	18	---
Calcium	ppm	ASTM D5185(m) 50	2262	2283	---
Phosphorus	ppm	ASTM D5185(m) 330	826	842	---
Zinc	ppm	ASTM D5185(m) 430	851	848	---
Sulfur	ppm	ASTM D5185(m) 760	4433	4327	---
Lithium	ppm	ASTM D5185(m)	<1	<1	---

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >20	9	8	---
Sodium	ppm	ASTM D5185(m)	5	5	---
Potassium	ppm	ASTM D5185(m) >20	3	2	---

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	102070	120239	---
Particles >6µm	ASTM D7647	>1300	18804	41116	---
Particles >14µm	ASTM D7647	>160	571	768	---
Particles >21µm	ASTM D7647	>40	166	110	---
Particles >38µm	ASTM D7647	>10	3	4	---
Particles >71µm	ASTM D7647	>3	1	0	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	24/21/16	24/23/17	---




OIL ANALYSIS REPORT

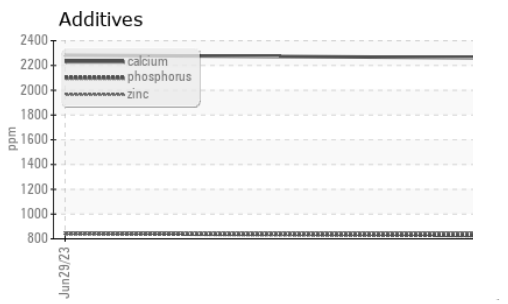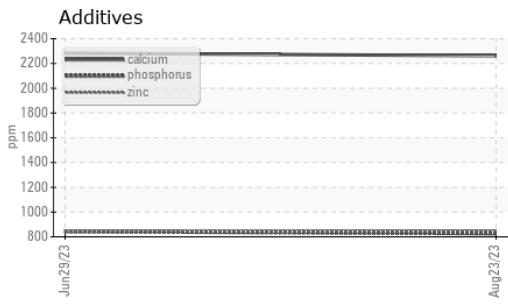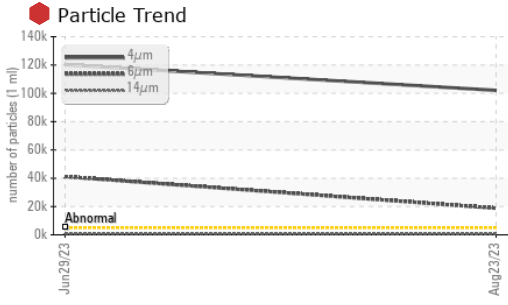





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---
Free Water	scalar	Visual*		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	37.7	---

SAMPLE IMAGES

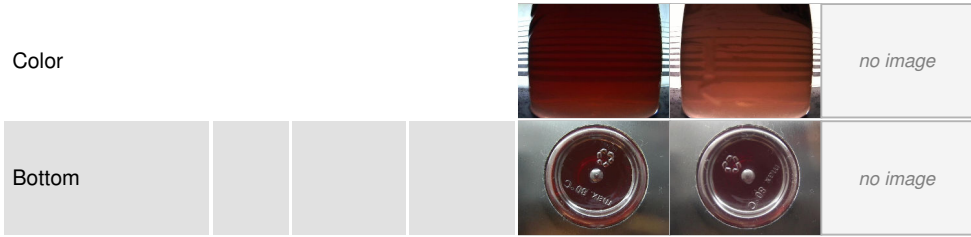

GRAPHS

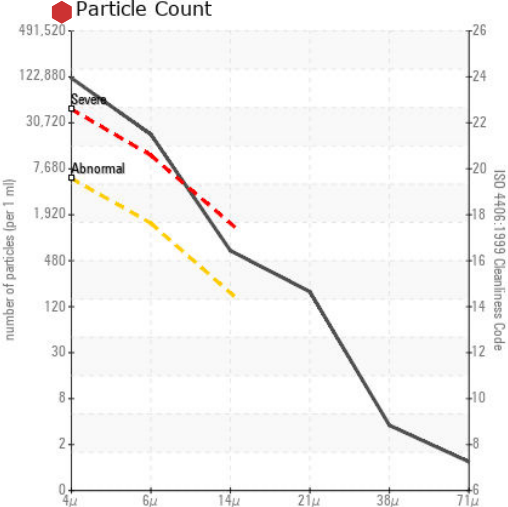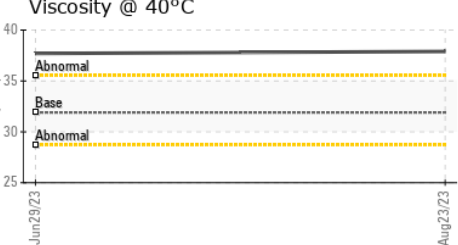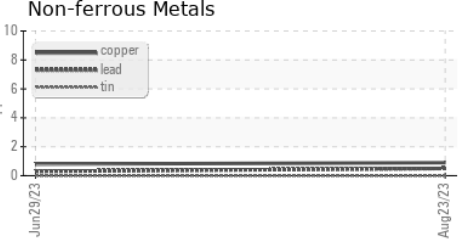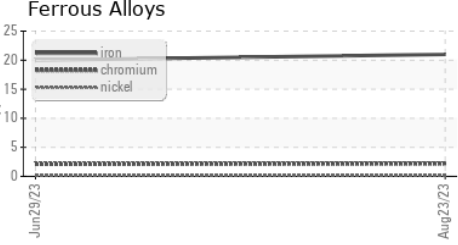

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 780 - GMA - ICI - Solid Waste
Sample No. : GFL0088799 **Received** : 05 Sep 2023 4365 boul. St-Elzear Ouest,
Lab Number : 02580405 **Diagnosed** : 06 Sep 2023 Laval, QC
Unique Number : 5633465 **Diagnostician** : Kevin Marson CA H7P 4J3
Test Package : MOB 1 (Additional Tests: PQ, PrtCount) Contact: Pieces Laval
 To discuss this sample report, contact Customer Service at 1-800-268-2131. pieces.laval@gflenv.com
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T: (450)687-3838
 Validity of results and interpretation are based on the sample and information as supplied. F: