




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**



Machine Id  
**411007**  
 Component  
**Diesel Engine**  
 Fluid  
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

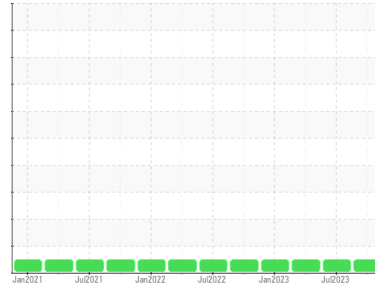

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	<b>GFL0090874</b>	GFL0078493	GFL0078520
Sample Date	Client Info	<b>21 Sep 2023</b>	18 Jul 2023	09 Apr 2023
Machine Age	hrs	Client Info	<b>0</b>	0
Oil Age	hrs	Client Info	<b>6223</b>	17595
Oil Changed	Client Info	<b>N/A</b>	N/A	Changed
Sample Status		<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

method	limit/base	current	history1	history2
Fuel	WC Method >3.0	<b>&lt;1.0</b>	<1.0	<1.0
Glycol	WC Method	<b>NEG</b>	NEG	NEG

## WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185(m) >120	<b>6</b>	2	6
Chromium	ppm ASTM D5185(m) >20	<b>0</b>	0	0
Nickel	ppm ASTM D5185(m) >5	<b>&lt;1</b>	0	1
Titanium	ppm ASTM D5185(m) >2	<b>0</b>	0	<1
Silver	ppm ASTM D5185(m) >2	<b>&lt;1</b>	0	0
Aluminum	ppm ASTM D5185(m) >20	<b>&lt;1</b>	<1	1
Lead	ppm ASTM D5185(m) >40	<b>&lt;1</b>	0	<1
Copper	ppm ASTM D5185(m) >330	<b>1</b>	<1	2
Tin	ppm ASTM D5185(m) >15	<b>&lt;1</b>	0	<1
Antimony	ppm ASTM D5185(m)	<b>0</b>	0	<1
Vanadium	ppm ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185(m) 0	<b>6</b>	5	3
Barium	ppm ASTM D5185(m) 0	<b>0</b>	0	0
Molybdenum	ppm ASTM D5185(m) 60	<b>57</b>	57	59
Manganese	ppm ASTM D5185(m) 0	<b>0</b>	<1	<1
Magnesium	ppm ASTM D5185(m) 1010	<b>899</b>	933	957
Calcium	ppm ASTM D5185(m) 1070	<b>1116</b>	1019	1122
Phosphorus	ppm ASTM D5185(m) 1150	<b>941</b>	1036	1076
Zinc	ppm ASTM D5185(m) 1270	<b>1146</b>	1143	1187
Sulfur	ppm ASTM D5185(m) 2060	<b>2377</b>	2580	2634
Lithium	ppm ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185(m) >25	<b>2</b>	3	2
Sodium	ppm ASTM D5185(m)	<b>2</b>	2	1
Potassium	ppm ASTM D5185(m) >20	<b>2</b>	<1	<1

## INFRA-RED


method	limit/base	current	history1	history2
Soot %	% ASTM D7844* >4	<b>0.1</b>	0	0
Nitration	Abs/cm ASTM D7624* >20	<b>7.5</b>	4.8	7.9
Sulfation	Abs/.1mm ASTM D7415* >30	<b>19.6</b>	18.1	22.0

## FLUID DEGRADATION

method	limit/base	current	history1	history2
Oxidation	Abs/.1mm ASTM D7414* >25	<b>15.3</b>	13.4	15.2











# OIL ANALYSIS REPORT

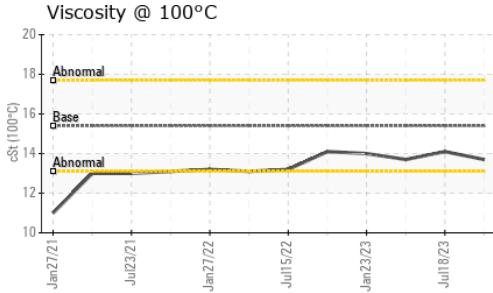

VISUAL	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	13.7	14.1

## GRAPHS

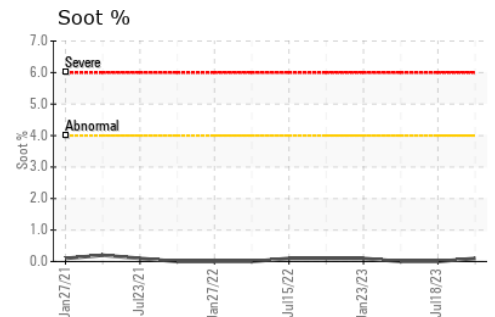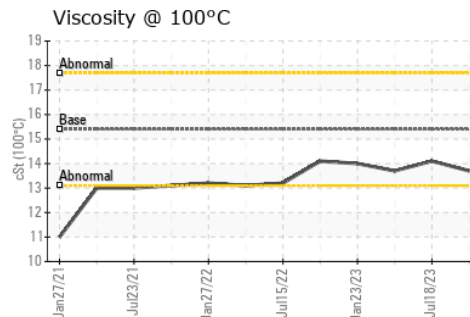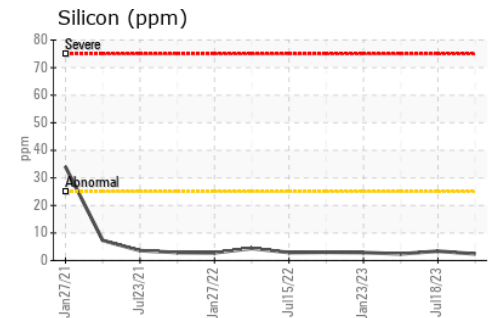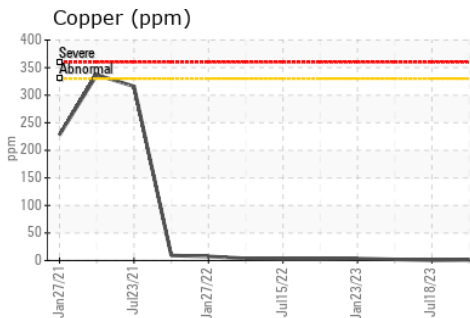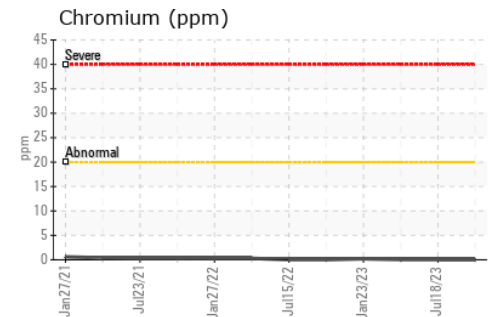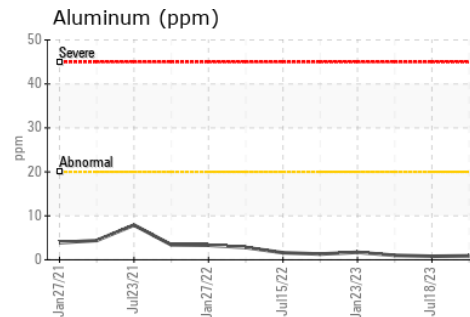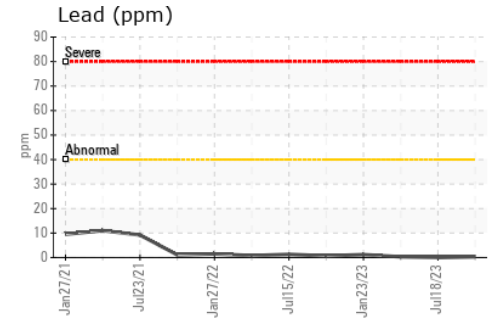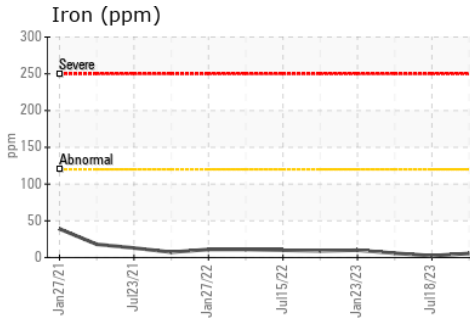

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 246 - Windsor**  
**Sample No.** : GFL0090874 **Received** : 25 Sep 2023 2700 Deziel Dr  
**Lab Number** : 02584811 **Diagnosed** : 25 Sep 2023 Windsor, ON  
**Unique Number** : 5645876 **Diagnostician** : Wes Davis CA N8W 5H8  
**Test Package** : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Dave Varga  
 dvarga@gflenv.com  
 T: (519)944-8009  
 F: