


OIL ANALYSIS REPORT

SHARP BUS LINES Machine Id INTERNATIONAL 1041

Component

Diesel Engine

PETRO CANADA DURON HP 15W40 (--- GAL)

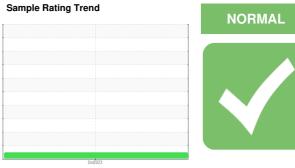

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is acceptable for the time in service.

| ·-/ | | <u>k</u> | | Oct2023 | | |
|---------------|----------|---------------|------------|-------------|----------|----------|
| SAMPLE INFORI | MATION | method | limit/base | current | history1 | history2 |
| Sample Number | | Client Info | | PC0081306 | | |
| Sample Date | | Client Info | | 02 Oct 2023 | | |
| Machine Age | kms | Client Info | | 246324 | | |
| Oil Age | kms | Client Info | | 884 | | |
| Oil Changed | | Client Info | | Changed | | |
| Sample Status | | | | NORMAL | | |
| CONTAMINAT | ION | method | limit/base | current | history1 | history2 |
| Fuel | | WC Method | >2.0 | <1.0 | | |
| Glycol | | WC Method | | NEG | | |
| WEAR METAL | S | method | limit/base | current | history1 | history2 |
| ron | ppm | ASTM D5185(m) | >100 | 12 | | |
| Chromium | ppm | ASTM D5185(m) | >20 | <1 | | |
| Nickel | ppm | ASTM D5185(m) | >4 | 0 | | |
| Titanium | ppm | ASTM D5185(m) | | 0 | | |
| Silver | ppm | ASTM D5185(m) | >3 | 1 | | |
| Aluminum | ppm | ASTM D5185(m) | >20 | 1 | | |
| _ead | ppm | ASTM D5185(m) | >40 | 2 | | |
| Copper | ppm | ASTM D5185(m) | >330 | <1 | | |
| Tin | ppm | ASTM D5185(m) | >15 | <1 | | |
| Antimony | ppm | ASTM D5185(m) | | 0 | | |
| /anadium | ppm | ASTM D5185(m) | | 0 | | |
| Beryllium | ppm | ASTM D5185(m) | | 0 | | |
| Cadmium | ppm | ASTM D5185(m) | | 0 | | |
| ADDITIVES | | method | limit/base | current | history1 | history2 |
| Boron | ppm | ASTM D5185(m) | 0 | 2 | | |
| Barium | ppm | ASTM D5185(m) | 0 | <1 | | |
| Molybdenum | ppm | ASTM D5185(m) | 60 | 58 | | |
| Manganese | ppm | ASTM D5185(m) | 0 | 0 | | |
| Magnesium | ppm | ASTM D5185(m) | 1010 | 934 | | |
| Calcium | ppm | ASTM D5185(m) | 1070 | 1022 | | |
| Phosphorus | ppm | ASTM D5185(m) | 1150 | 996 | | |
| Zinc | ppm | ASTM D5185(m) | 1270 | 1159 | | |
| Sulfur | ppm | ASTM D5185(m) | 2060 | 2525 | | |
| Lithium | ppm | ASTM D5185(m) | 2000 | <1 | | |
| CONTAMINAN | TS | method | limit/base | current | history1 | history2 |
| Silicon | ppm | ASTM D5185(m) | >25 | 3 | | |
| Sodium | ppm | ASTM D5185(m) | | 2 | | |
| Potassium | ppm | ASTM D5185(m) | >20 | 0 | | |
| INFRA-RED | | method | limit/base | current | history1 | history2 |
| Soot % | % | ASTM D7844* | >3 | 0.1 | | |
| Nitration | Abs/cm | ASTM D7624* | >20 | 6.5 | | |
| Sulfation | Abs/.1mm | ASTM D7415* | >30 | 18.8 | | |
| FLUID DEGRA | OATION | method | limit/base | current | history1 | history2 |
| Oxidation | Abs/.1mm | ASTM D7414* | >25 | 14.3 | | |
| | | | | | | |



OIL ANALYSIS REPORT

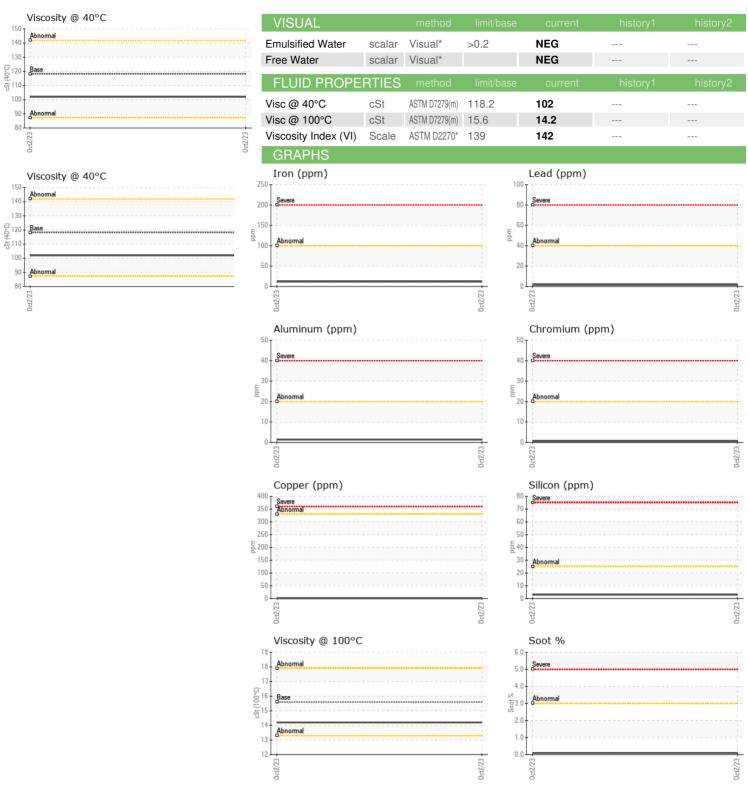



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: PC0081306 : 02587128 : 5656194

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received Diagnosed

: 05 Oct 2023 : 05 Oct 2023 Diagnostician : Wes Davis

Test Package : MOB 1 (Additional Tests: KV40, VI) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

ICSB - Brantford 567 Oak Park Rd. Brantford, ON CA N3T 5L8 Contact: Doug Hall Djhall@sharpbus.com T: (519)751-3434