




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**

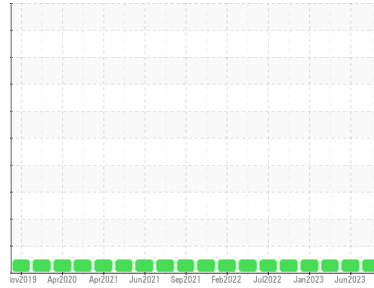

Machine Id  
**401215**  
 Component  
**Diesel Engine**  
 Fluid  
**PETRO CANADA DURON SHP 15W40 (--- LTR)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>GFL0090410</b>	GFL0071498	GFL0071493
Sample Date	Client Info		<b>02 Nov 2023</b>	23 Jun 2023	25 Apr 2023
Machine Age	hrs	Client Info	<b>423725</b>	401215	370511
Oil Age	hrs	Client Info	<b>0</b>	401215	0
Oil Changed	Client Info		<b>N/A</b>	N/A	Changed
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Glycol	WC Method		<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >120	<b>8</b>	6	10
Chromium	ppm	ASTM D5185(m) >20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m) >15	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m) >2	<b>0</b>	0	<1
Silver	ppm	ASTM D5185(m) >3	<b>&lt;1</b>	<1	0
Aluminum	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	<1	2
Lead	ppm	ASTM D5185(m) >40	<b>&lt;1</b>	<1	1
Copper	ppm	ASTM D5185(m) >330	<b>1</b>	<1	4
Tin	ppm	ASTM D5185(m) >15	<b>0</b>	0	<1
Antimony	ppm	ASTM D5185(m)	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	<b>2</b>	2	3
Barium	ppm	ASTM D5185(m) 0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m) 60	<b>60</b>	58	60
Manganese	ppm	ASTM D5185(m) 0	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m) 1010	<b>965</b>	971	950
Calcium	ppm	ASTM D5185(m) 1070	<b>1044</b>	1044	1066
Phosphorus	ppm	ASTM D5185(m) 1150	<b>950</b>	1035	1042
Zinc	ppm	ASTM D5185(m) 1270	<b>1175</b>	1174	1143
Sulfur	ppm	ASTM D5185(m) 2060	<b>2391</b>	2474	2512
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >25	<b>3</b>	3	3
Sodium	ppm	ASTM D5185(m)	<b>3</b>	3	5
Potassium	ppm	ASTM D5185(m) >20	<b>0</b>	<1	1

## INFRA-RED


	method	limit/base	current	history1	history2
Soot %	%	ASTM D7844* >4	<b>0.3</b>	0	0.1
Nitration	Abs/cm	ASTM D7624* >20	<b>7.0</b>	6.7	7.4
Sulfation	Abs/.1mm	ASTM D7415* >30	<b>19.2</b>	18.8	18.8

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414* >25	<b>14.8</b>	15.1	15.0











# OIL ANALYSIS REPORT

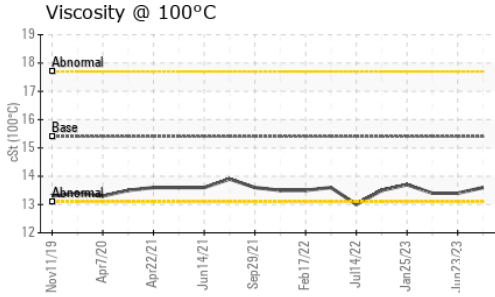

VISUAL	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	13.6	13.4

## GRAPHS

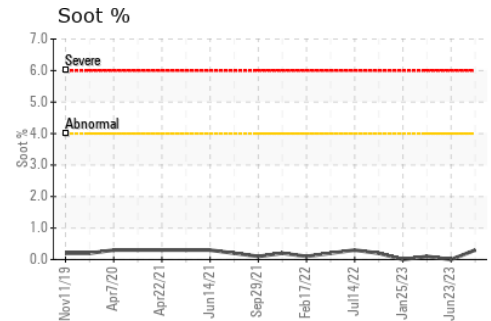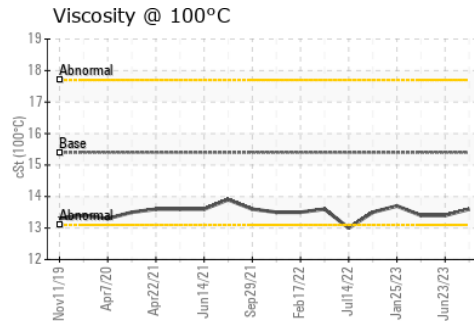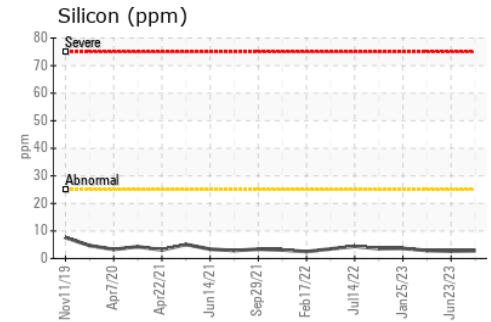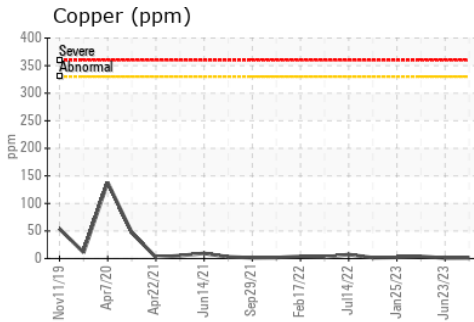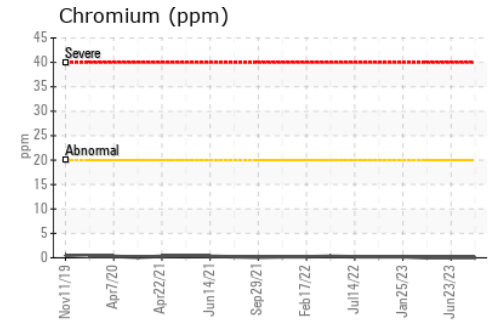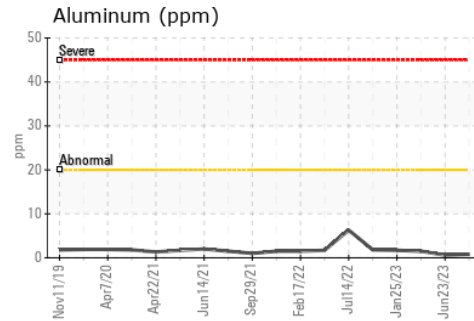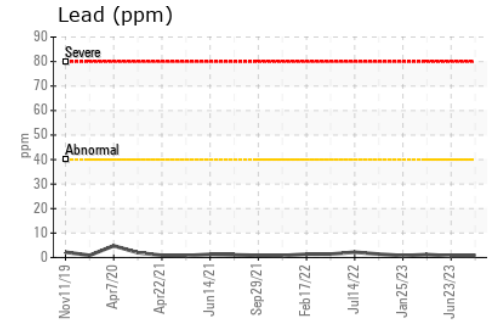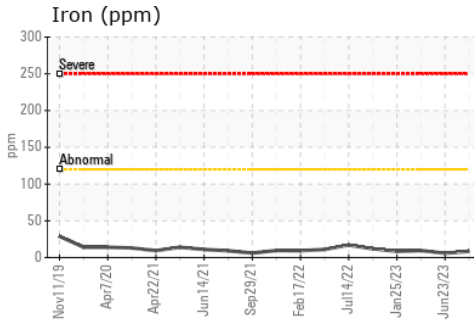

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0090410 **Received** : 08 Nov 2023  
**Lab Number** : 02594812 **Diagnosed** : 08 Nov 2023  
**Unique Number** : 5671891 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

**GFL Environmental - 216M**  
 2475 Beryl Drive  
 Oakville, ON  
 CA L6J 7X4  
 Contact: Matthew Gunness  
 mgunness@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T:  
F: