




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**

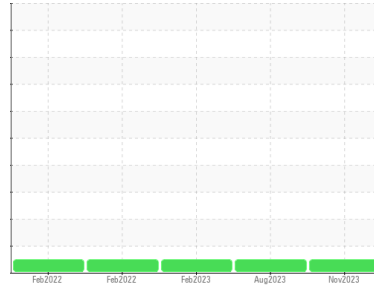

Machine Id  
**4732**

Component  
**Diesel Engine**

Fluid  
**PETRO CANADA DURON SHP 10W30 (--- GAL)**

## DIAGNOSIS

### Recommendation

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

### Wear

Les taux d'usure de tous les composants sont normaux.

### Contamination

Il n'y a aucun indice de contamination dans l'huile.

### Fluid Condition

L'état de l'huile est acceptable pour la durée de service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>GFL0097109</b>	GFL0088843	GFL0073442
Sample Date	Client Info		<b>02 Nov 2023</b>	15 Aug 2023	09 Feb 2023
Machine Age	kms	Client Info	<b>0</b>	719831	707596
Oil Age	kms	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>Changed</b>	Changed	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Glycol	WC Method		<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>80	<b>18</b>	12	17
Chromium	ppm	ASTM D5185(m)	>5	<b>3</b>	2	<1
Nickel	ppm	ASTM D5185(m)	>2	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Silver	ppm	ASTM D5185(m)	>3	<b>&lt;1</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>30	<b>6</b>	4	3
Lead	ppm	ASTM D5185(m)	>30	<b>&lt;1</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>150	<b>2</b>	1	<1
Tin	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	2	<b>2</b>	2	5
Barium	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	50	<b>57</b>	59	57
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	950	<b>954</b>	982	932
Calcium	ppm	ASTM D5185(m)	1050	<b>1113</b>	1057	1126
Phosphorus	ppm	ASTM D5185(m)	995	<b>1007</b>	1071	1062
Zinc	ppm	ASTM D5185(m)	1180	<b>1191</b>	1192	1158
Sulfur	ppm	ASTM D5185(m)	2600	<b>2541</b>	2611	2576
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>20	<b>12</b>	6	3
Sodium	ppm	ASTM D5185(m)		<b>2</b>	2	2
Potassium	ppm	ASTM D5185(m)	>20	<b>2</b>	<1	<1

## INFRA-RED


	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>3	<b>0.2</b>	0.2	0.1
Nitration	Abs/cm	ASTM D7624*	>20	<b>6.1</b>	6.2	6.7
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>19.4</b>	19.5	20.6

## FLUID DEGRADATION

	method	limit/base	current	history1	history2	
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>14.2</b>	13.8	14.7











# OIL ANALYSIS REPORT

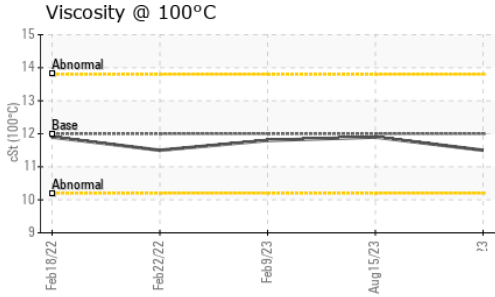

VISUAL	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	11.9	11.8

## GRAPHS

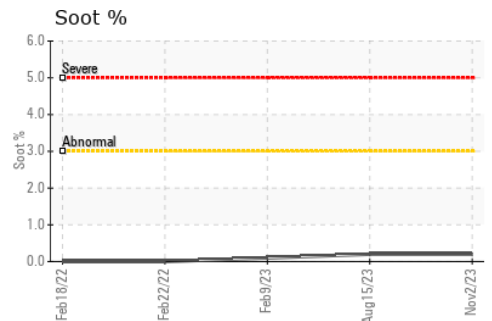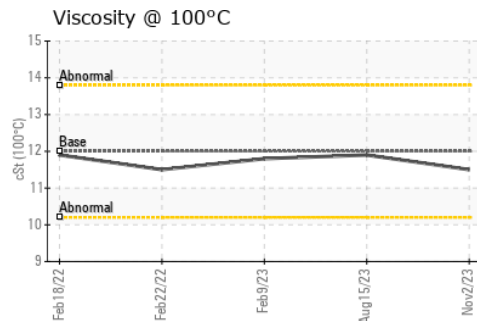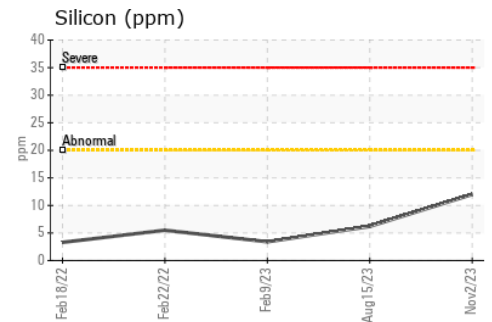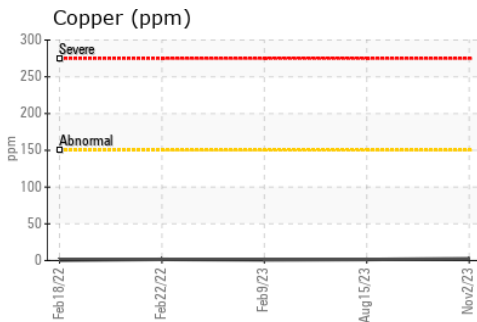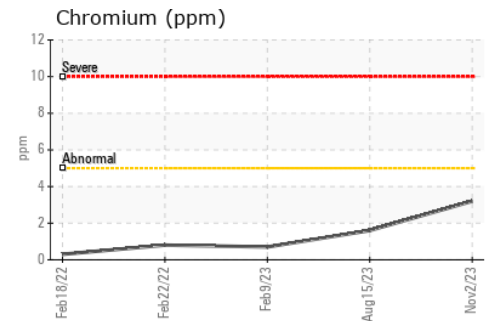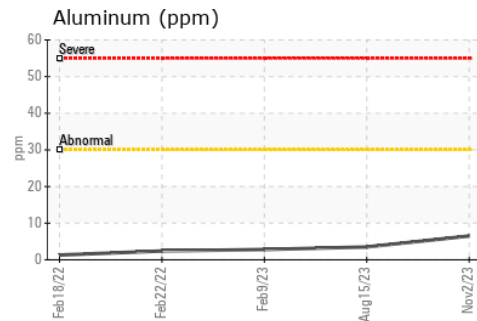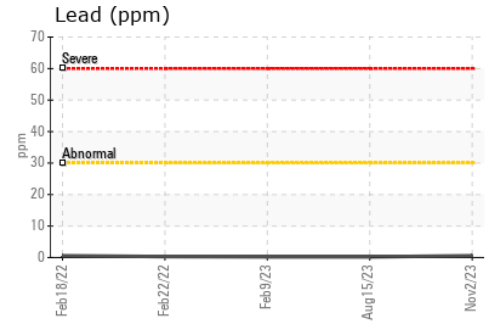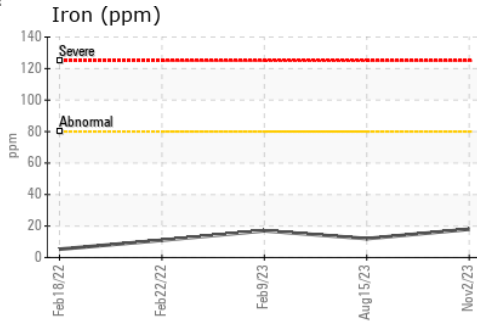

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 780 - GMA - ICI - Solid Waste  
**Sample No.** : GFL0097109 **Received** : 14 Nov 2023  
**Lab Number** : 02596067 **Diagnosed** : 14 Nov 2023  
**Unique Number** : 5681147 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

4365 boul. St-Elzear Ouest,  
 Laval, QC  
 CA H7P 4J3  
 Contact: Pieces Laval  
 pieces.laval@gflenv.com  
 T: (450)687-3838  
 F: