




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**



Machine Id  
**426012**  
 Component  
**Diesel Engine**  
 Fluid  
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

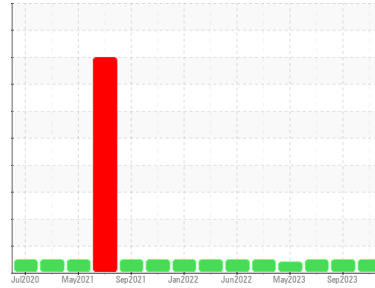

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>GFL0102881</b>	GFL0090857	GFL0082572
Sample Date	Client Info		<b>21 Nov 2023</b>	18 Sep 2023	06 Jun 2023
Machine Age	kms	Client Info	<b>0</b>	0	404735
Oil Age	kms	Client Info	<b>19984</b>	19633	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Water	WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol	WC Method		<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >120	<b>7</b>	16	2
Chromium	ppm	ASTM D5185(m) >20	<b>0</b>	<1	0
Nickel	ppm	ASTM D5185(m) >5	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m) >2	<b>0</b>	<1	<1
Silver	ppm	ASTM D5185(m) >2	<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185(m) >20	<b>1</b>	2	1
Lead	ppm	ASTM D5185(m) >40	<b>&lt;1</b>	1	0
Copper	ppm	ASTM D5185(m) >330	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m) >15	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	<b>10</b>	51	8
Barium	ppm	ASTM D5185(m) 0	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m) 60	<b>52</b>	11	54
Manganese	ppm	ASTM D5185(m) 0	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m) 1010	<b>814</b>	157	826
Calcium	ppm	ASTM D5185(m) 1070	<b>1171</b>	1999	1083
Phosphorus	ppm	ASTM D5185(m) 1150	<b>966</b>	1007	981
Zinc	ppm	ASTM D5185(m) 1270	<b>1156</b>	1169	1059
Sulfur	ppm	ASTM D5185(m) 2060	<b>2493</b>	2745	2457
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS


	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >25	<b>2</b>	3	2
Sodium	ppm	ASTM D5185(m)	<b>4</b>	6	2
Potassium	ppm	ASTM D5185(m) >20	<b>1</b>	5	0

## INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	ASTM D7844* >4	<b>0.3</b>	0.7	0
Nitration	Abs/cm	ASTM D7624* >20	<b>7.8</b>	9.0	5.0
Sulfation	Abs./1mm	ASTM D7415* >30	<b>20.4</b>	23.9	18.5



# OIL ANALYSIS REPORT

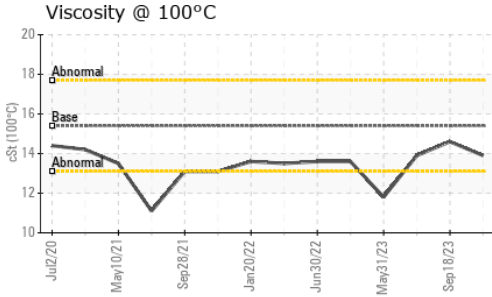

### FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs./1mm	ASTM D7414*	>25	15.7	18.4









### VISUAL

	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

### FLUID PROPERTIES

	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	13.9	14.6

### GRAPHS

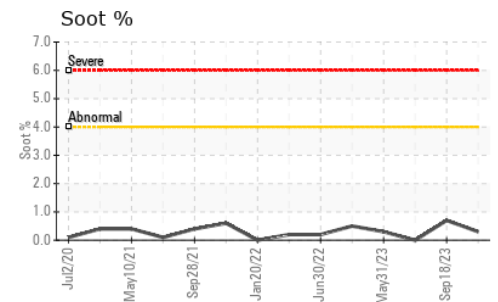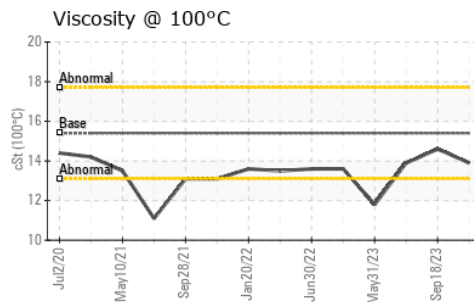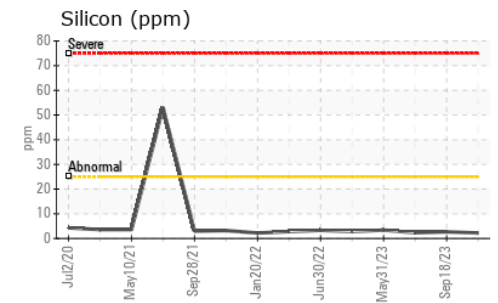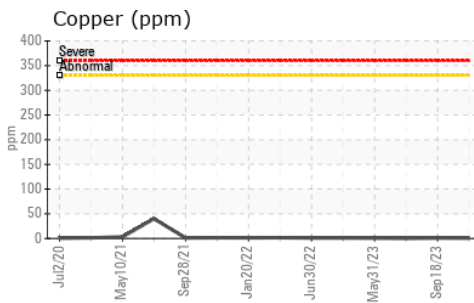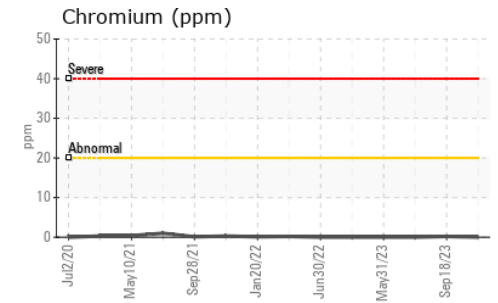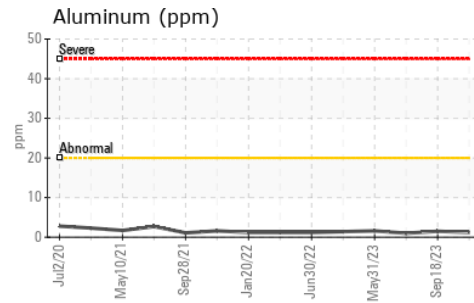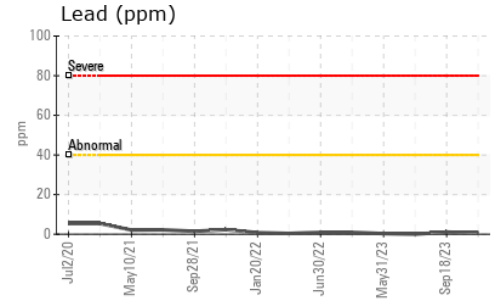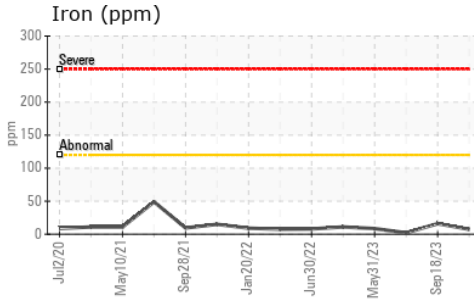

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 246 - Windsor**  
**Sample No.** : GFL0102881 **Received** : 22 Nov 2023  
**Lab Number** : 02598090 **Diagnosed** : 22 Nov 2023  
**Unique Number** : 5683170 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

2700 Deziel Dr  
 Windsor, ON  
 CA N8W 5H8  
 Contact: Dave Varga  
 dvarga@gflenv.com  
 T: (519)944-8009  
 F: