




OIL ANALYSIS REPORT

Sample Rating Trend

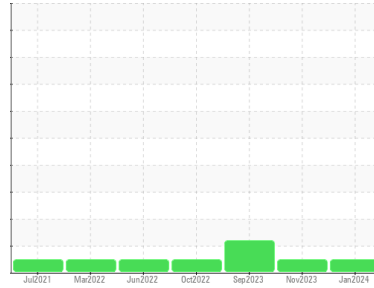

NORMAL



Machine Id

0556

Component

Diesel Engine

Fluid

PETRO CANADA DURON XL SYN BLEND 15W40 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0099608	GFL0091582	GFL0091650
Sample Date	Client Info		24 Jan 2024	06 Nov 2023	29 Sep 2023
Machine Age	kms	Client Info	209463	204407	199639
Oil Age	kms	Client Info	0	0	8803
Oil Changed	Client Info		N/A	Changed	Changed
Sample Status			NORMAL	NORMAL	ATTENTION

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>5	<1.0	<1.0	<1.0
Water	WC Method	>0.2	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>100	19	18	52
Chromium	ppm	ASTM D5185(m)	>20	<1	<1	3
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>20	4	2	6
Lead	ppm	ASTM D5185(m)	>40	2	4	19
Copper	ppm	ASTM D5185(m)	>330	1	3	14
Tin	ppm	ASTM D5185(m)	>15	<1	1	3
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	1	2	3	3
Barium	ppm	ASTM D5185(m)	1	0	<1	<1
Molybdenum	ppm	ASTM D5185(m)	60	56	57	71
Manganese	ppm	ASTM D5185(m)	1	0	0	<1
Magnesium	ppm	ASTM D5185(m)	1010	891	909	914
Calcium	ppm	ASTM D5185(m)	1070	1025	1007	1022
Phosphorus	ppm	ASTM D5185(m)	1150	980	976	994
Zinc	ppm	ASTM D5185(m)	1270	1157	1137	1170
Sulfur	ppm	ASTM D5185(m)	2060	2709	2497	2561
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS


	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>25	9	8	8
Sodium	ppm	ASTM D5185(m)		16	48	▲ 321
Potassium	ppm	ASTM D5185(m)	>20	8	4	29
Glycol	%	ASTM D7922*		0.0	NEG	0.0

INFRA-RED

	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>3	0.1	0.1	0.1
Nitration	Abs/cm	ASTM D7624*	>20	7.3	6.1	7.5
Sulfation	Abs./1mm	ASTM D7415*	>30	18.8	18.7	18.5



OIL ANALYSIS REPORT










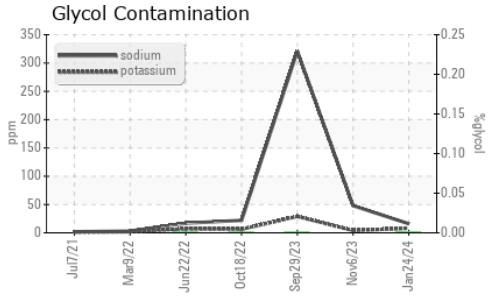


FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	15.1	14.1	14.2
Base Number (BN)	mg KOH/g	ASTM D2896*	9.6	10.05	9.53	10.5

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.5	14.0	14.1	14.6

GRAPHS

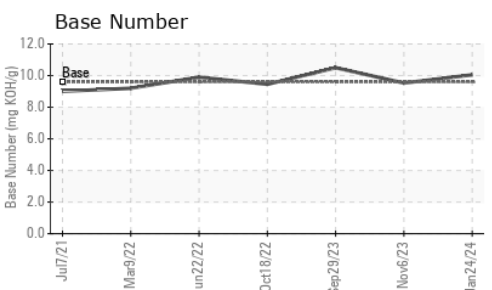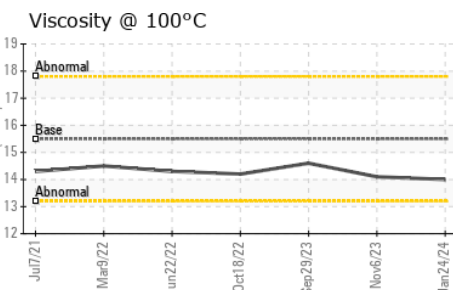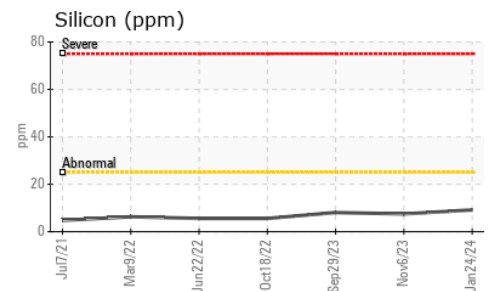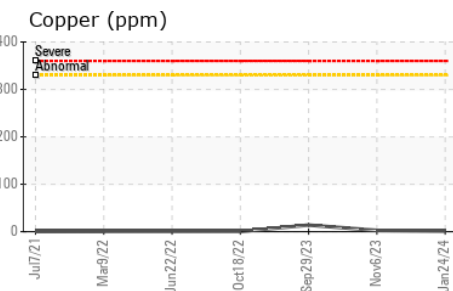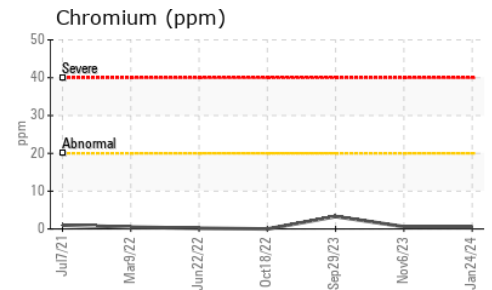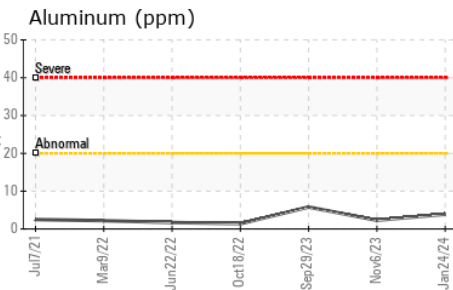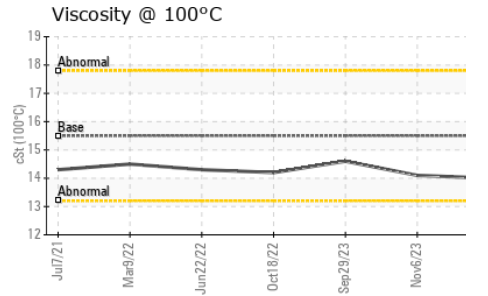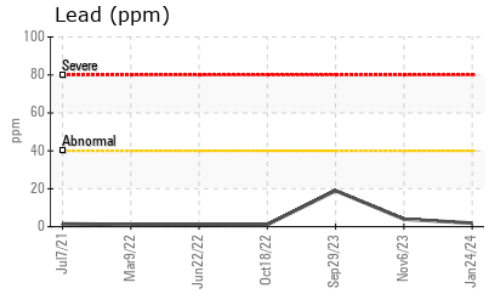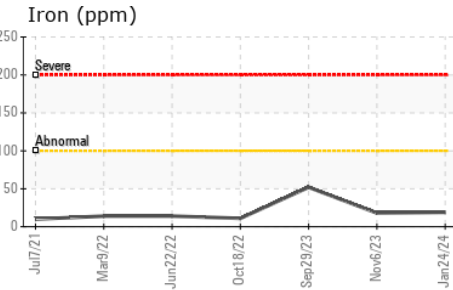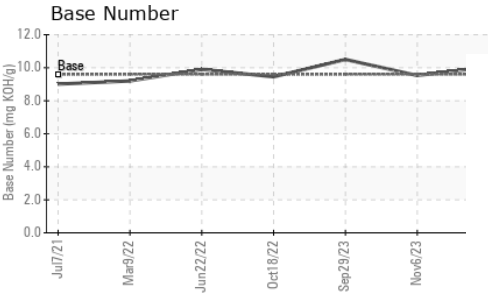

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 550 - Rocky View County
Sample No. : GFL0099608 **Received** : 31 Jan 2024
Lab Number : 02612330 **Diagnosed** : 01 Feb 2024
Unique Number : 5721425 **Diagnostician** : Wes Davis
Test Package : MOB 2 (Additional Tests: Glycol)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

220 Carmek Blvd
 Rocky View County, AB
 CA T1X 1X1
 Contact: GFL Calgary
 calgarymaintenance@gflenv.com
 T:
 F: (403)369-6163