




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**

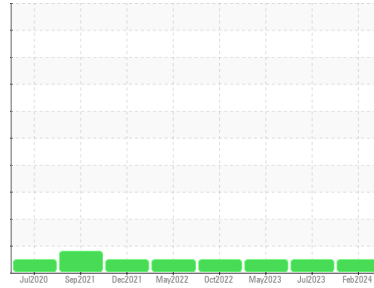

Machine Id  
**OR348**  
 Component  
**Rear Differential**  
 Fluid  
**PETRO CANADA DURATRAN (--- GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>GFL0092323</b>	GFL0087390	GFL0056462
Sample Date	Client Info		<b>09 Feb 2024</b>	18 Jul 2023	29 May 2023
Machine Age	hrs	Client Info	<b>22868</b>	22210	21984
Oil Age	hrs	Client Info	<b>20513</b>	2224	2098
Oil Changed	Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>.2	<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>500	<b>31</b>	19	20
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	<1	0
Nickel	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Silver	ppm	ASTM D5185(m)		<b>0</b>	3	0
Aluminum	ppm	ASTM D5185(m)	>25	<b>1</b>	1	<1
Lead	ppm	ASTM D5185(m)	>25	<b>11</b>	8	7
Copper	ppm	ASTM D5185(m)	>100	<b>5</b>	4	3
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0

## ADDITIVES


	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	110	<b>68</b>	76	84
Barium	ppm	ASTM D5185(m)	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	0.0	<b>3</b>	3	3
Manganese	ppm	ASTM D5185(m)	1	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	13	<b>48</b>	46	48
Calcium	ppm	ASTM D5185(m)	3610	<b>2648</b>	2814	3222
Phosphorus	ppm	ASTM D5185(m)	1192	<b>1019</b>	1071	1131
Zinc	ppm	ASTM D5185(m)	1455	<b>1167</b>	1194	1258
Sulfur	ppm	ASTM D5185(m)	2641	<b>2771</b>	2854	2997
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>75	<b>6</b>	8	8
Sodium	ppm	ASTM D5185(m)		<b>2</b>	3	3
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1




# OIL ANALYSIS REPORT

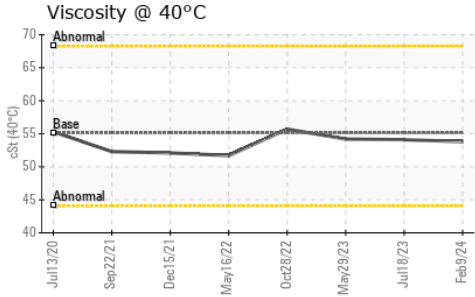


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	55.14	<b>53.8</b>	54.1	54.2

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

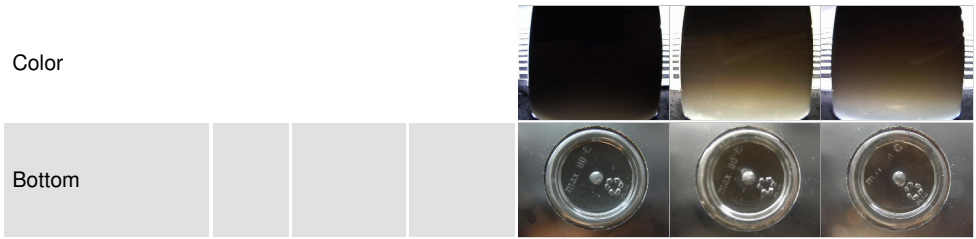

## GRAPHS

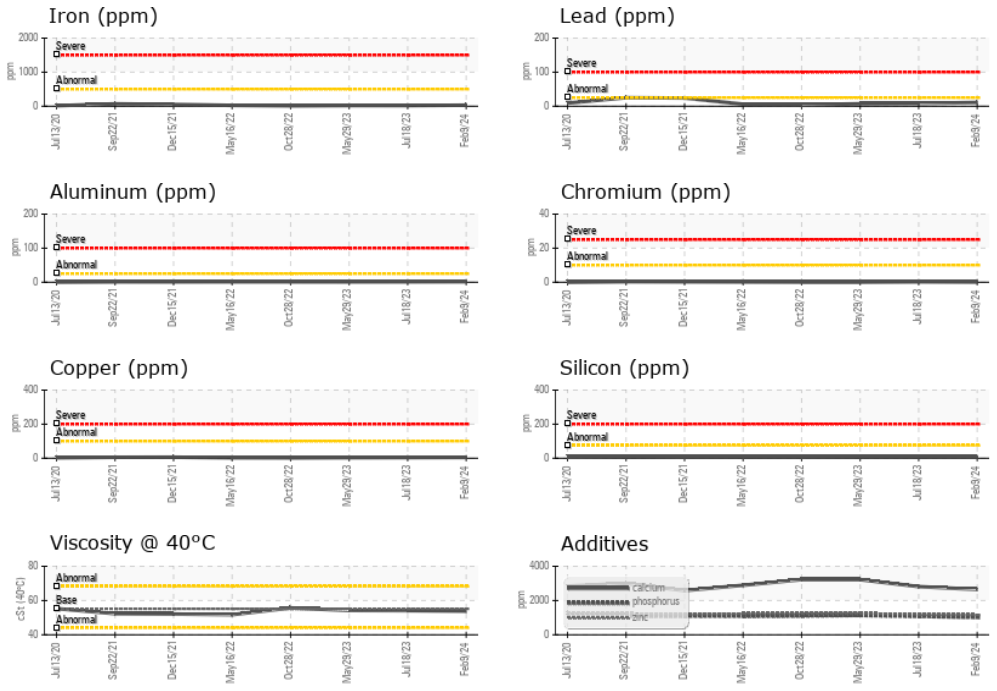

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0092323  
**Lab Number** : 02615427  
**Unique Number** : 5724522  
**Test Package** : MOB 1  
**Received** : 13 Feb 2024  
**Tested** : 14 Feb 2024  
**Diagnosed** : 14 Feb 2024 - Wes Davis

**GFL Environmental - 720 - Lafleche - Landfill**  
 17125 Lafleche Road,  
 Moose Creek, ON  
 CA K0C 1W0  
 Contact: Charles Bergeron  
 cbergeron@gflenv.com  
 T: (613)538-4853  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.