




OIL ANALYSIS REPORT



Machine Id
801247
 Component
Hydraulic System
 Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

Sample Rating Trend

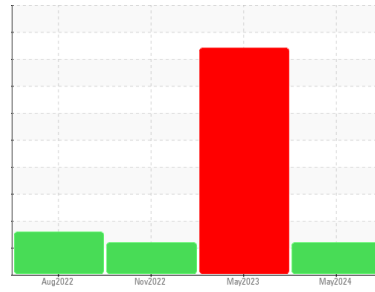

DIAGNOSIS

Recommendation

Nous recommandons le remplacement des filtres de ce composant. Nous vous recommandons d'échantillonner de nouveau dès que possible afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une quantité modérée de particules (de 4 à 14 microns) dans l'huile.

Fluid Condition

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	GFL0111796	GFL0070511	GFL0070526
Sample Date	Client Info	03 May 2024	14 May 2023	21 Nov 2022
Machine Age	hrs	9098	7750	7081
Oil Age	hrs	0	0	0
Oil Changed	Client Info	N/A	Not Changd	Not Changd
Sample Status		ABNORMAL	SEVERE	ABNORMAL

CONTAMINATION

method	limit/base	current	history1	history2
Water	WC Method >0.1	NEG	NEG	NEG

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185(m) >40	7	9	7
Chromium	ppm ASTM D5185(m) >5	1	<1	<1
Nickel	ppm ASTM D5185(m) >2	0	0	0
Titanium	ppm ASTM D5185(m) >2	0	0	0
Silver	ppm ASTM D5185(m)	0	0	0
Aluminum	ppm ASTM D5185(m) >8	<1	1	<1
Lead	ppm ASTM D5185(m) >5	0	0	0
Copper	ppm ASTM D5185(m) >20	<1	1	1
Tin	ppm ASTM D5185(m) >2	0	0	0
Antimony	ppm ASTM D5185(m) >2	0	0	<1
Vanadium	ppm ASTM D5185(m)	0	0	0
Beryllium	ppm ASTM D5185(m)	0	0	0
Cadmium	ppm ASTM D5185(m)	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185(m) 0	<1	2	2
Barium	ppm ASTM D5185(m) 0	0	0	0
Molybdenum	ppm ASTM D5185(m) 0	0	<1	<1
Manganese	ppm ASTM D5185(m) 1	0	<1	<1
Magnesium	ppm ASTM D5185(m) 0	6	13	13
Calcium	ppm ASTM D5185(m) 50	69	81	167
Phosphorus	ppm ASTM D5185(m) 330	354	357	347
Zinc	ppm ASTM D5185(m) 430	451	407	373
Sulfur	ppm ASTM D5185(m) 760	832	848	905
Lithium	ppm ASTM D5185(m)	<1	<1	<1

CONTAMINANTS




method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185(m) >20	2	3	2
Sodium	ppm ASTM D5185(m)	4	5	3
Potassium	ppm ASTM D5185(m) >20	5	4	2

FLUID CLEANLINESS

method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >5000	▲ 17319	▲ 96548	▲ 10540
Particles >6µm	ASTM D7647 >1300	● 1382	▲ 46266	● 2045
Particles >14µm	ASTM D7647 >160	79	▲ 6290	151
Particles >21µm	ASTM D7647 >40	18	▲ 1840	33
Particles >38µm	ASTM D7647 >10	2	▲ 76	1
Particles >71µm	ASTM D7647 >3	1	▲ 6	0
Oil Cleanliness	ISO 4406 (c) >19/17/14	▲ 21/18/13	▲ 24/23/20	▲ 21/18/14




OIL ANALYSIS REPORT

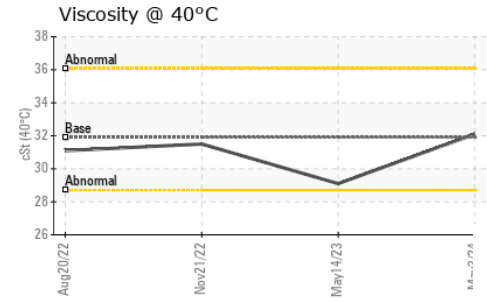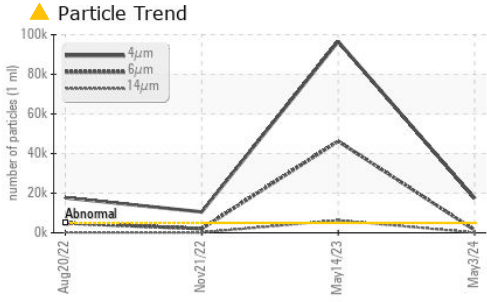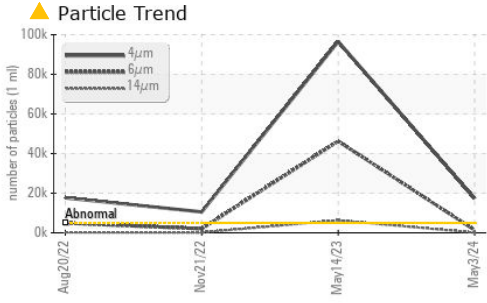





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	32.1	29.1	31.5

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

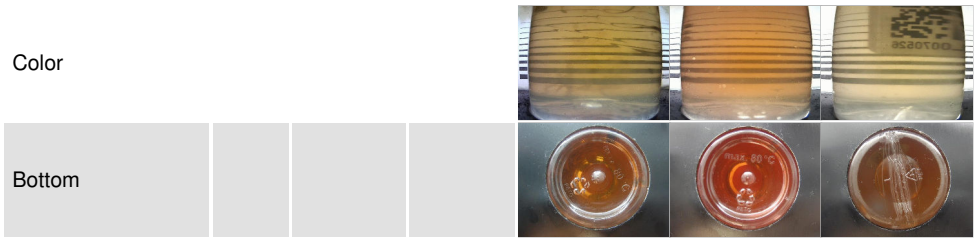

GRAPHS

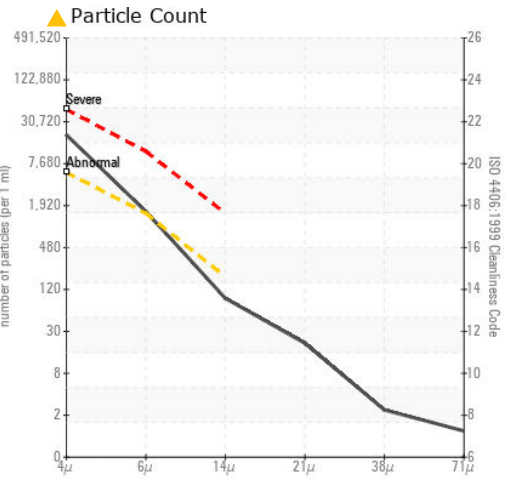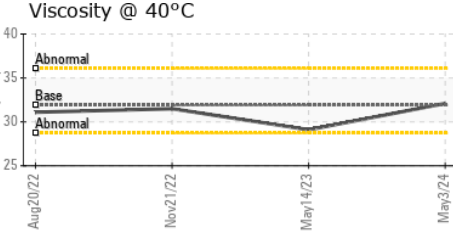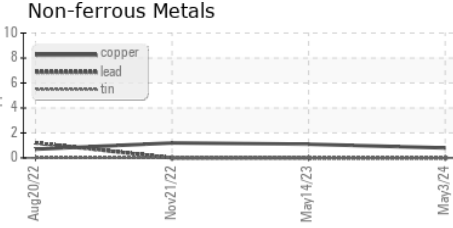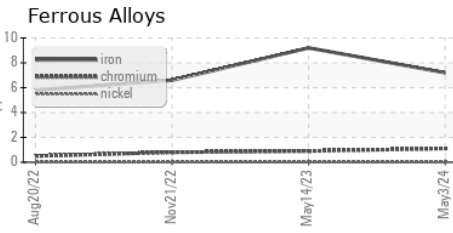

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 769 - Drummondville QC**
Sample No. : GFL0111796 **Received** : 08 May 2024 1005 rue Rhea
Lab Number : 02634139 **Tested** : 09 May 2024 Drummondville, QC
Unique Number : 5775292 **Diagnosed** : 09 May 2024 - Wes Davis CA J2B 8A9
Test Package : MOB 1 (Additional Tests: PrtCount) Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.