




OIL ANALYSIS REPORT

Sample Rating Trend

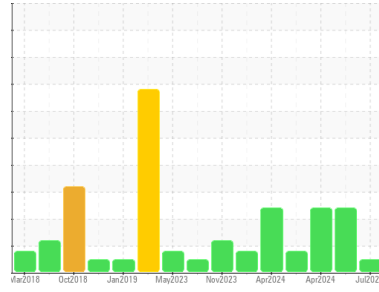

NORMAL



Machine Id

4784

Component

Diesel Engine

Fluid

PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Fuel content negligible. There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0118991	GFL0119012	GFL0112554
Sample Date	Client Info		01 Jul 2024	27 May 2024	25 Apr 2024
Machine Age	kms	Client Info	566556	2932	0
Oil Age	kms	Client Info	0	275	0
Oil Changed	Client Info		N/A	Changed	N/A
Sample Status			NORMAL	SEVERE	SEVERE

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	NEG	NEG
Glycol	WC Method		NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>110	15	5	13
Chromium	ppm	ASTM D5185(m)	>4	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>2	<1	0	0
Aluminum	ppm	ASTM D5185(m)	>25	1	<1	1
Lead	ppm	ASTM D5185(m)	>45	<1	0	<1
Copper	ppm	ASTM D5185(m)	>85	1	<1	<1
Tin	ppm	ASTM D5185(m)	>4	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	2	4	2	2
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	50	54	48	51
Manganese	ppm	ASTM D5185(m)	0	<1	0	0
Magnesium	ppm	ASTM D5185(m)	950	868	790	846
Calcium	ppm	ASTM D5185(m)	1050	1006	880	926
Phosphorus	ppm	ASTM D5185(m)	995	953	859	884
Zinc	ppm	ASTM D5185(m)	1180	1095	973	1035
Sulfur	ppm	ASTM D5185(m)	2600	2407	2151	2256
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS




	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>30	3	2	2
Sodium	ppm	ASTM D5185(m)		4	2	3
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Fuel	%	ASTM D7593*	>5	0.4	▲ 10.5	▲ 9.3

INFRA-RED

	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>3	0.5	0.1	0.3
Nitration	Abs/cm	ASTM D7624*	>20	7.1	6.0	6.9
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.9	19.7	19.0



OIL ANALYSIS REPORT






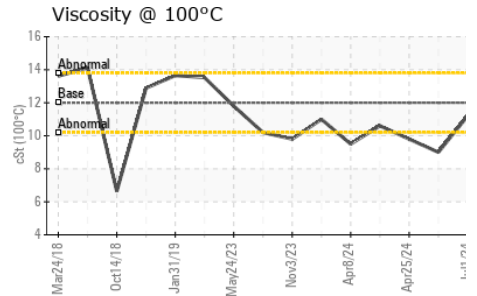
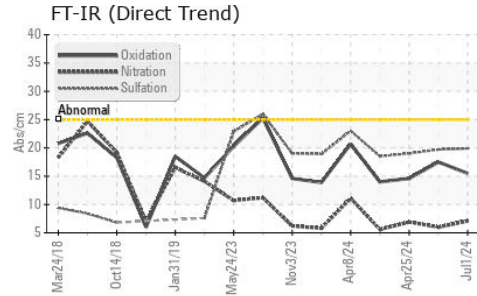
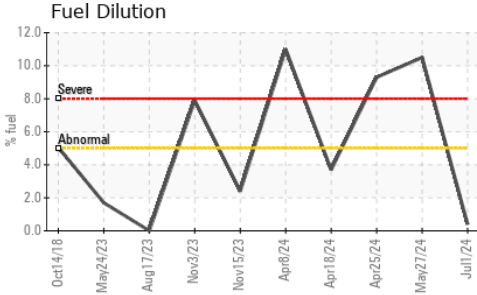


FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs./1mm	ASTM D7414*	>25	15.5	17.5	14.6

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	12.00	11.2	▲ 9.0	▲ 9.8

GRAPHS

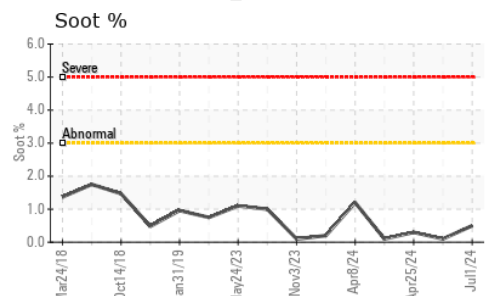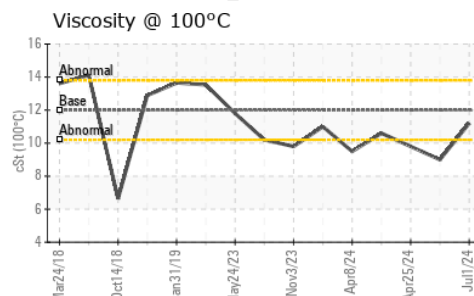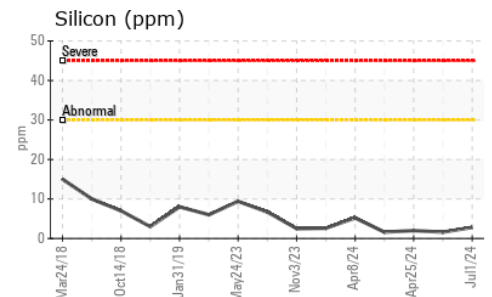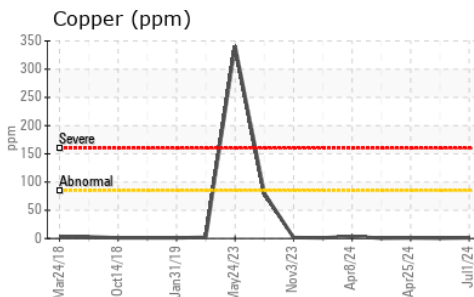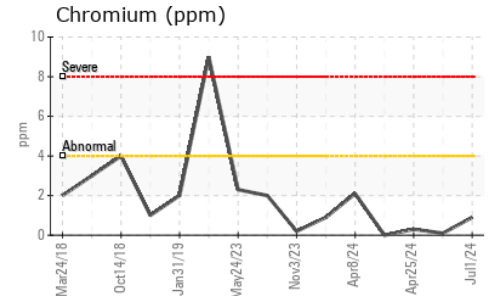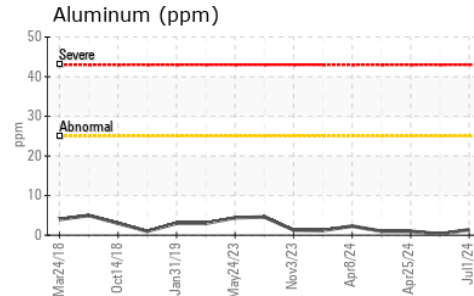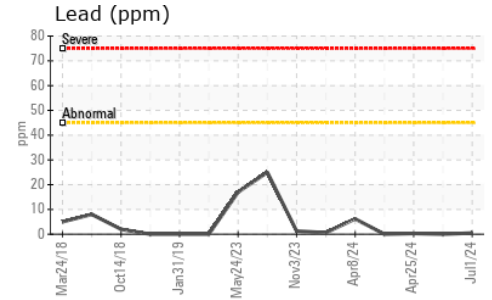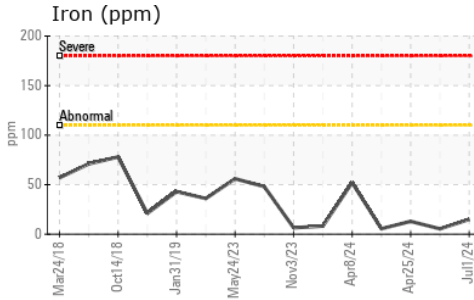

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0118991
Lab Number : 02648608
Unique Number : 5814160
Test Package : MOB 1 (Additional Tests: PercentFuel)
Received : 18 Jul 2024
Tested : 19 Jul 2024
Diagnosed : 19 Jul 2024 - Wes Davis

GFL Environmental - 554 - Edmonton SW
 8409 -15th Street NW
 Edmonton, AB
 CA T6P 0B8
 Contact: Tim Greig
 tgreig@gflenv.com
 T: (780)231-0521
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.