

PROBLEM SUMMARY

Sample Rating Trend
SOOT


FREIGHTLINER 97


Component

Diesel Engine

PETRO CANADA DURON SHP 15W40 (13 LTR)



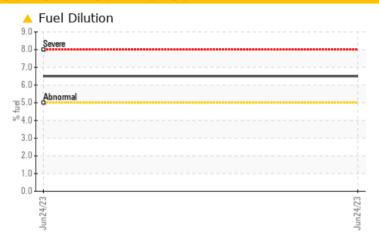

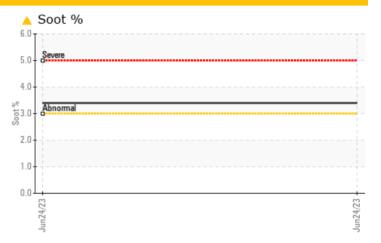

RECOMMENDATION

The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS Sample Status ABNORMAL -- -- Fuel % ASTM D3524 >5 \$\text{\t

Customer Id: ATRPIN Sample No.: PCA0100695 Lab Number: 05885399 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED	RECOMMENDED ACTIONS								
Action	Status	Date	Done By	Description					
Resample			?	We recommend an early resample to monitor this condition.					

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

SOOT

A

FREIGHTLINER 97

Component

Diesel Engine

PETRO CANADA DURON SHP 15W40 (13 LTR)

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of fuel present in the oil. Light concentration of carbon/soot present in the oil. Tests confirm the presence of fuel in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

_TR)						
-111,			,	Jun 2023		
SAMPLE INFOR	MATION	method	limit/base	current	history 1	history 2
Sample Number		Client Info		PCA0100695		
Sample Date		Client Info		24 Jun 2023		
Machine Age	mls	Client Info		368639		
Oil Age	mls	Client Info		30755		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history 1	history 2
Glycol		WC Method		NEG		
WEAR METAL	.S	method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>80	34		
Chromium	ppm	ASTM D5185m	>5	2		
Nickel	ppm	ASTM D5185m	>2	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>30	0		
Lead	ppm	ASTM D5185m	>30	16		
Copper	ppm	ASTM D5185m	>150	4		
Tin	ppm	ASTM D5185m	>5	2		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	2		
Barium	ppm	ASTM D5185m	0	<1		
Molybdenum	nnm		60	40		
	ppm	ASTM D5185m		42		
Manganese	ppm	ASTM D5185m ASTM D5185m	0	42 <1		
Manganese Magnesium			0 1010			
•	ppm	ASTM D5185m		<1		
Magnesium	ppm ppm	ASTM D5185m ASTM D5185m	1010	<1 661		
Magnesium Calcium	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m	1010 1070	<1 661 815		
Magnesium Calcium Phosphorus	ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	1010 1070 1150	<1 661 815 678		
Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	1010 1070 1150 1270	<1 661 815 678 848		
Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	1010 1070 1150 1270 2060	<1 661 815 678 848 2467	 	
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	1010 1070 1150 1270 2060	<1 661 815 678 848 2467 current	 	 history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m Method ASTM D5185m	1010 1070 1150 1270 2060	<1 661 815 678 848 2467 current	 history 1	 history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	1010 1070 1150 1270 2060 limit/base	<1 661 815 678 848 2467 current 4	 history 1	history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm	ASTM D5185m	1010 1070 1150 1270 2060 limit/base >20	<1 661 815 678 848 2467 current 4 2 4	 history 1	 history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel	ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m Method ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	1010 1070 1150 1270 2060 limit/base >20 >20	<1 661 815 678 848 2467 current 4 2 4 ▲ 6.5	history 1	history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED	ppm	ASTM D5185m ASTM D3524	1010 1070 1150 1270 2060 limit/base >20 >5 limit/base	<1 661 815 678 848 2467	history 1 history 1	history 2 history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED Soot %	ppm	ASTM D5185m ASTM D3524	1010 1070 1150 1270 2060 limit/base >20 >5 limit/base >3	<1 661 815 678 848 2467 current 4 2 4 6.5 current	history 1 history 1	history 2 history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED Soot % Nitration	ppm	ASTM D5185m ASTM D7844 *ASTM D7844	1010 1070 1150 1270 2060 limit/base >20 >5 limit/base >3 >20	<1 661 815 678 848 2467	history 1 history 1	history 2 history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED Soot % Nitration Sulfation FLUID DEGRA	ppm	ASTM D5185m ASTM D7844 *ASTM D7624 *ASTM D7624 *ASTM D7415 method	1010 1070 1150 1270 2060 limit/base >20 >5 limit/base >3 >20 >30 limit/base	<1 661 815 678 848 2467 current 4 2 4 ▲ 6.5 current ▲ 11.5 27.7 current	history 1 history 1	history 2 history 2
Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED Soot % Nitration Sulfation	ppm	ASTM D5185m ASTM D3524 method *ASTM D7844 *ASTM D7624 *ASTM D7415	1010 1070 1150 1270 2060 limit/base >20 >5 limit/base >3 >20 >3	<1 661 815 678 848 2467	history 1 history 1 history 1 history 1	history 2 history 2 history 2 history 2



OIL ANALYSIS REPORT

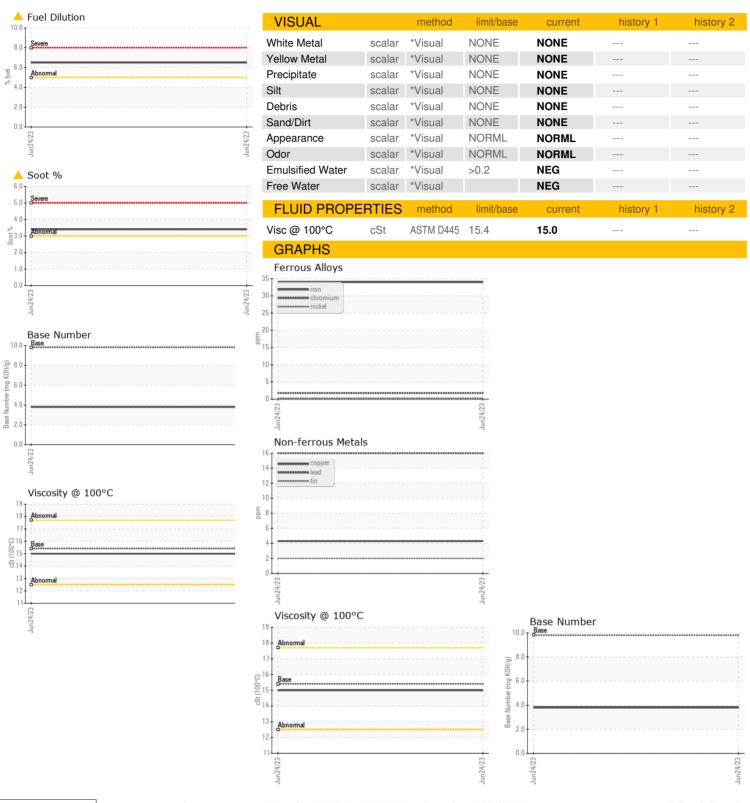



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: PCA0100695 : 05885399

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 28 Jun 2023 : 30 Jun 2023 Diagnosed : 10535882 Diagnostician : Wes Davis

Test Package: FLEET (Additional Tests: FuelDilution, PercentFuel) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

A Truck Repair

9349 China Grove Church Road Pineville, NC US 28134

Contact: Vlad Melnichuk shop@migway.com T: (980)255-3200