


OIL ANALYSIS REPORT



NORMAL

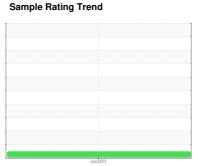

738614

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- G

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

GAL)				Jun 2023		
SAMPLE INFOR	MATION	method	limit/base	current	history 1	history 2
Sample Number		Client Info		PCA0100769		
Sample Date		Client Info		21 Jun 2023		
Machine Age	mls	Client Info		71565		
Oil Age	mls	Client Info		71565		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history 1	history 2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>100	179		
Chromium	ppm	ASTM D5185m	>20	6		
Nickel	ppm	ASTM D5185m	>4	1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	44		
Lead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	190		
Tin	ppm	ASTM D5185m	>15	3		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	2	25		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	47		
Manganese	ppm	ASTM D5185m	0	4		
Magnesium	ppm	ASTM D5185m	950	559		
Calcium	ppm	ASTM D5185m	1050	1853		
Phosphorus	ppm	ASTM D5185m	995	808		
Zinc	ppm	ASTM D5185m	1180	1045		
Sulfur	ppm	ASTM D5185m	2600	2380		
CONTAMINAN	TS	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	11		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	118		
INFRA-RED		method	limit/base	current	history 1	history 2
Soot %	%	*ASTM D7844	>3	1.8		
Nitration	Abs/cm	*ASTM D7624	>20	19.6		
Sulfation	Abs/.1mm	*ASTM D7415	>30	31.4		
FLUID DEGRA	DATION	method	limit/base	current	history 1	history 2
Oxidation	Abs/.1mm	*ASTM D7414	>25	41.2		



OIL ANALYSIS REPORT

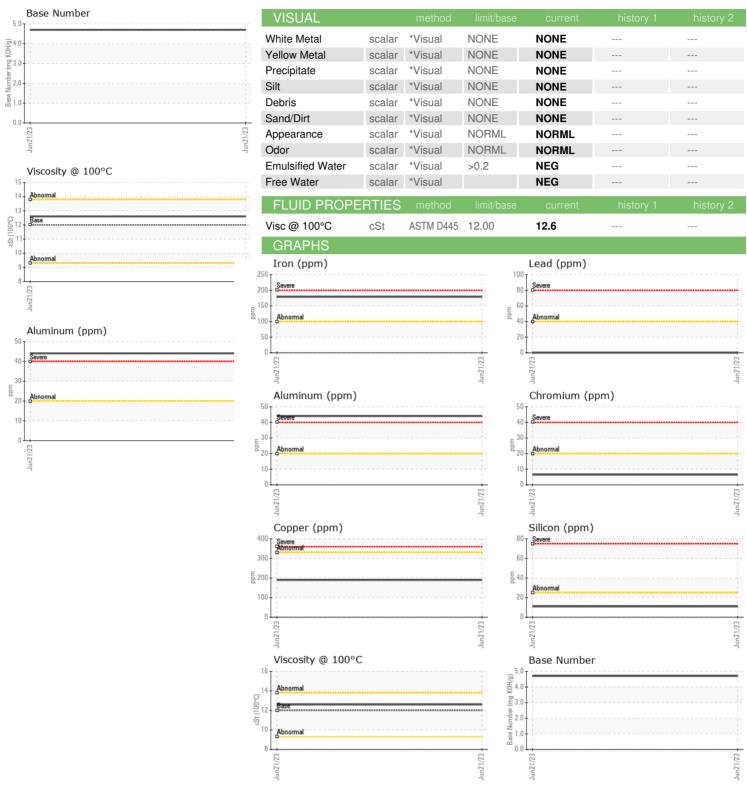





Laboratory Sample No. Lab Number **Unique Number**

: 05891971 : 10547781

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0100769

Received : 07 Jul 2023 Diagnosed

: 09 Jul 2023 Diagnostician : Doug Bogart

Test Package : MOB 1 (Additional Tests: TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #118

2196 BENNETT ROAD PHILADELPHIA, PA US 19116

Contact: JOHN KEEN jkeen@millertransgroup.com

T: (215)552-9832 F: (215)552-9892