

OIL ANALYSIS REPORT



Machine Id 340

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- 0

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

iAL)				Jun2023		
SAMPLE INFORI	MATION	method	limit/base	current	history 1	history 2
Sample Number		Client Info		PCA0098989		
Sample Date		Client Info		30 Jun 2023		
Machine Age	mls	Client Info		66301		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history 1	history 2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>100	16		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>4	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	2		
Lead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	2		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	2	12		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	67		
Manganese	ppm	ASTM D5185m	0	<1		
Magnesium	ppm	ASTM D5185m	950	854		
Calcium	ppm	ASTM D5185m	1050	1155		
Phosphorus	ppm	ASTM D5185m	995	1010		
Zinc	ppm	ASTM D5185m	1180	1191		
Sulfur	ppm	ASTM D5185m	2600	2943		
CONTAMINAN	TS	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	4		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	4		
INFRA-RED		method	limit/base	current	history 1	history 2
Soot %	%	*ASTM D7844	>3	0.5		
Nitration	Abs/cm	*ASTM D7624	>20	10.6		
Sulfation	Abs/.1mm	*ASTM D7415	>30	21.2		
FLUID DEGRA	OATION	method	limit/base	current	history 1	history 2
Oxidation	Abs/.1mm	*ASTM D7414	>25	18.7		
Base Number (BN)	mg KOH/g	ASTM D2896		8.4		

Contact/Location: MIKE BOYER - MILPEN



OIL ANALYSIS REPORT

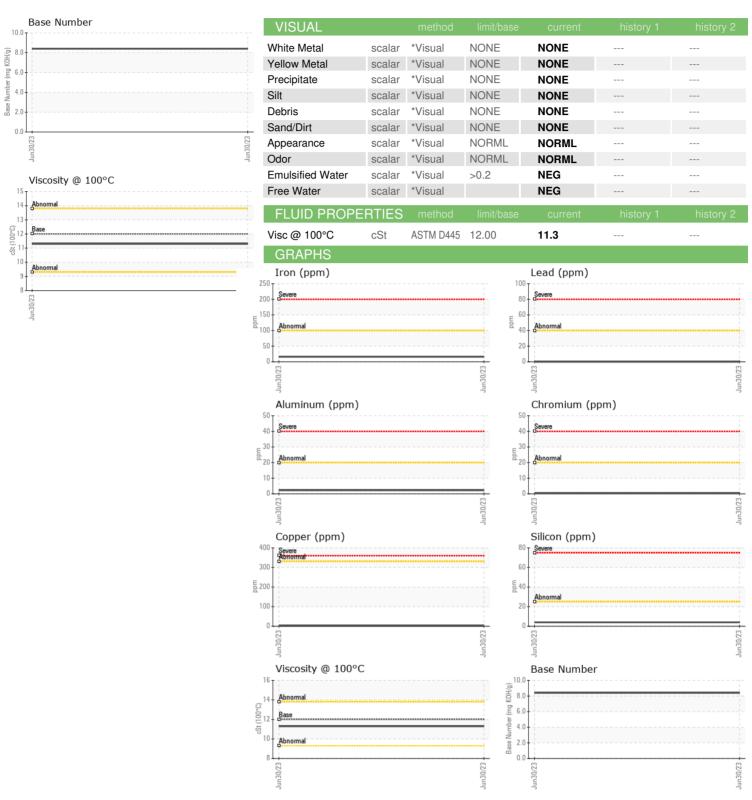





Laboratory Sample No. Lab Number

Unique Number

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 05893508 : 10549318

: PCA0098989

Received : 10 Jul 2023 Diagnosed

: 11 Jul 2023 Diagnostician : Wes Davis

Test Package : MOB 1 (Additional Tests: TBN) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. 1504 MAINLINE DR CINNAMINSON, NJ US 08077

MILLER TRUCK LEASING #112

Contact: MIKE BOYER mboyer@millertransgroup.com T: (856)662-4264

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (856)663-4898

Report Id: MILPEN [WUSCAR] 05893508 (Generated: 07/11/2023 04:38:42) Rev: 1

Contact/Location: MIKE BOYER - MILPEN