


OIL ANALYSIS REPORT

(92082X) Walgreens [Walgreens] 136A62022

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

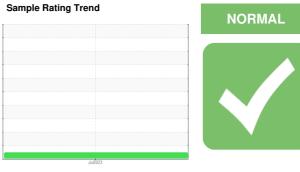

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

GAL)		L		Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0088335		
Sample Date		Client Info		07 Jul 2023		
Machine Age	mls	Client Info		377128		
Oil Age	mls	Client Info		25000		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	TION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	18		
Chromium	ppm	ASTM D5185m	>5	2		
Nickel	ppm	ASTM D5185m	>2	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>30	13		
Lead	ppm	ASTM D5185m	>30	0		
Copper	ppm	ASTM D5185m	>150	<1		
Tin	ppm	ASTM D5185m	>5	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
ADDITIVES Boron	ppm	method ASTM D5185m	limit/base	current 5	history1	history2
	ppm				history1	history2
Boron		ASTM D5185m	2	5		
Boron Barium	ppm	ASTM D5185m ASTM D5185m	2	5 0		
Boron Barium Molybdenum	ppm	ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50	5 0 61		
Boron Barium Molybdenum Manganese	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50	5 0 61 0		
Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950	5 0 61 0 992		
Boron Barium Molybdenum Manganese Magnesium Calcium	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050	5 0 61 0 992 1056		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995	5 0 61 0 992 1056 1025		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180	5 0 61 0 992 1056 1025		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	5 0 61 0 992 1056 1025 1281 3437		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	5 0 61 0 992 1056 1025 1281 3437 current		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	5 0 61 0 992 1056 1025 1281 3437 current	 history1	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	5 0 61 0 992 1056 1025 1281 3437 current 2	 history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >20	5 0 61 0 992 1056 1025 1281 3437 current 2 2	history1	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >20	5 0 61 0 992 1056 1025 1281 3437 current 2 2 0	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot %	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >20 	5 0 61 0 992 1056 1025 1281 3437 current 2 2 0	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration	ppm	ASTM D5185m method *ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D76145	2 0 50 0 950 1050 995 1180 2600 limit/base >20 >20 limit/base	5 0 61 0 992 1056 1025 1281 3437 current 2 2 0 current 0.6 12.0	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration Sulfation	ppm	ASTM D5185m method *ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D76145	2 0 50 0 950 1050 995 1180 2600 limit/base >20 >20 limit/base >3 >20 >3	5 0 61 0 992 1056 1025 1281 3437 current 2 2 0 current 0.6 12.0 24.5	history1 history1	history2 history2



OIL ANALYSIS REPORT

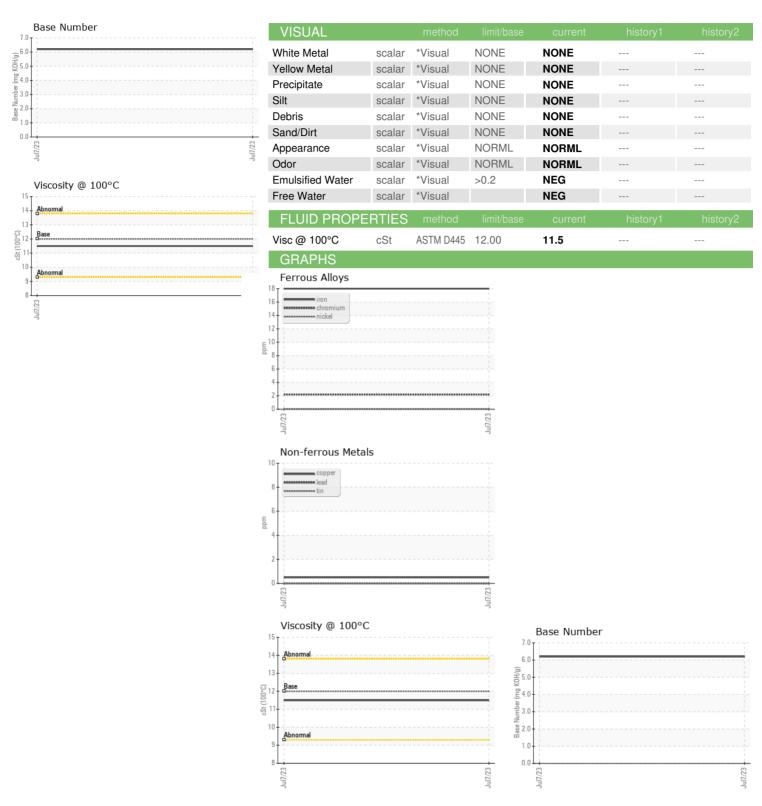





Laboratory Sample No. Lab Number Unique Number

: 05896007

: PCA0088335 : 10551817 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 12 Jul 2023

Diagnosed : 17 Jul 2023 : Wes Davis Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Transervice - Shop 1377 - Berkeley-Dayville

68 Shepherd Hill Rd Danielson, CT

US 06239 Contact: Shop 1377 Oil Analysis

shop1377@transervice.com

T: F: