

PROBLEM SUMMARY

FREIGHTLINER 7


Diesel Engine



FUEL


PETRO CANADA DURON SHP 15W40 (13 LTR)

COMPONENT CONDITION SUMMARY

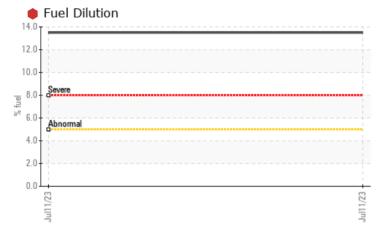

🛑 Viscosity @ 100°C

Sample Rating Trend

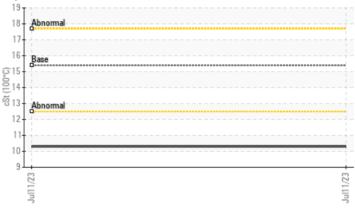

RECOMMENDATION

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS									
Sample Status				SEVERE					
Fuel	%	ASTM D3524	>5	🛑 13.5					
Visc @ 100°C	cSt	ASTM D445	15.4	10.3					

Customer Id: ATRPIN Sample No.: PCA0100640 Lab Number: 05902082 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED	ACTIONS			
Action	Status	Date	Done By	Description
Resample			?	We recommend an early resample to monitor this condition.
Check Fuel/injector System			?	We advise that you check the fuel injection system.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

FUEL

 \mathbf{X}

FREIGHTLINER 7

Diesel Engine

Fluid PETRO CANADA DURON SHP 15W40 (13 LTR)

DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.


.1R)				Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0100640		
Sample Date		Client Info		11 Jul 2023		
Machine Age	mls	Client Info		650168		
Oil Age	mls	Client Info		23000		
Oil Changed		Client Info		Changed		
Sample Status				SEVERE		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	30		
Chromium	ppm	ASTM D5185m	>5	1		
Nickel	ppm	ASTM D5185m	>2	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>30	0		
Lead	ppm	ASTM D5185m	>30	3		
Copper	ppm	ASTM D5185m	>150	<1		
Tin	ppm	ASTM D5185m	>5	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	8		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	60	53		
Manganese	ppm	ASTM D5185m	0	<1		
Magnesium	ppm	ASTM D5185m	1010	763		
Calcium	ppm	ASTM D5185m	1070	1186		
Phosphorus	ppm	ASTM D5185m	1150	882		
Zinc	ppm	ASTM D5185m	1270	1051		
Sulfur	ppm	ASTM D5185m	2060	3021		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	11		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	0		
Fuel	%	ASTM D3524	>5	• 13.5		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	2.1		
Nitration	Abs/cm	*ASTM D7624	>20	10.7		
Sulfation	Abs/.1mm	*ASTM D7415	>30	26.3		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
FLUID DEGRA Oxidation	DATION Abs/.1mm	method *ASTM D7414	limit/base	current 23.1	history1	history2




/23

OIL ANALYSIS REPORT

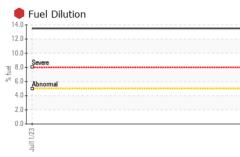

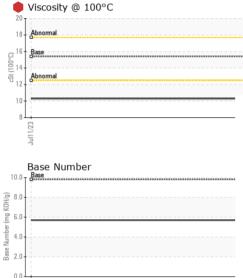

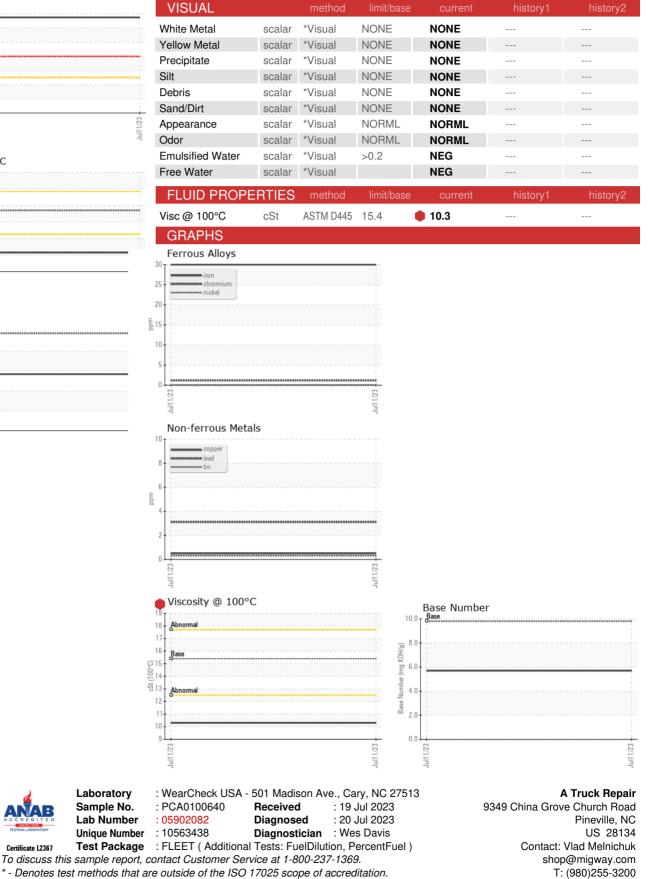

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Certificate L2367

Page 4 of 4

F: