

OIL ANALYSIS REPORT

Sample Rating Trend



WEAR



Machine Id
530755
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 10W30 (--- QTS)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

The copper level is abnormal. In the absence of other significant wear metals, suspect copper due to sources other than wear (i.e. cooling core). All other metal levels are typical for a new component breaking in.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PCA0095744	---	---
Sample Date	Client Info		12 Jul 2023	---	---
Machine Age	mls	Client Info	26623	---	---
Oil Age	mls	Client Info	26623	---	---
Oil Changed	Client Info		Changed	---	---
Sample Status			ABNORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>5	<1.0	---	---
Glycol	WC Method		NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >100	36	---	---
Chromium	ppm	ASTM D5185m >20	2	---	---
Nickel	ppm	ASTM D5185m >4	<1	---	---
Titanium	ppm	ASTM D5185m	<1	---	---
Silver	ppm	ASTM D5185m >3	0	---	---
Aluminum	ppm	ASTM D5185m >20	20	---	---
Lead	ppm	ASTM D5185m >40	3	---	---
Copper	ppm	ASTM D5185m >330	▲ 377	---	---
Tin	ppm	ASTM D5185m >15	4	---	---
Vanadium	ppm	ASTM D5185m	<1	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 2	37	---	---
Barium	ppm	ASTM D5185m 0	0	---	---
Molybdenum	ppm	ASTM D5185m 50	44	---	---
Manganese	ppm	ASTM D5185m 0	4	---	---
Magnesium	ppm	ASTM D5185m 950	579	---	---
Calcium	ppm	ASTM D5185m 1050	1704	---	---
Phosphorus	ppm	ASTM D5185m 995	771	---	---
Zinc	ppm	ASTM D5185m 1180	939	---	---
Sulfur	ppm	ASTM D5185m 2600	2602	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	6	---	---
Sodium	ppm	ASTM D5185m	6	---	---
Potassium	ppm	ASTM D5185m >20	63	---	---

INFRA-RED


	method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844 >3	0.5	---	---
Nitration	Abs/cm	*ASTM D7624 >20	8.7	---	---
Sulfation	Abs/.1mm	*ASTM D7415 >30	21.8	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414 >25	21.0	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	8.7	---	---


OIL ANALYSIS REPORT

▲ Non-ferrous Metals

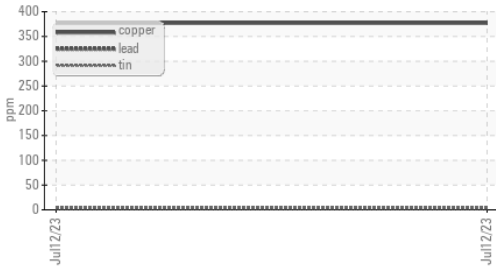

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---
Free Water	scalar	*Visual		NEG	---


Base Number

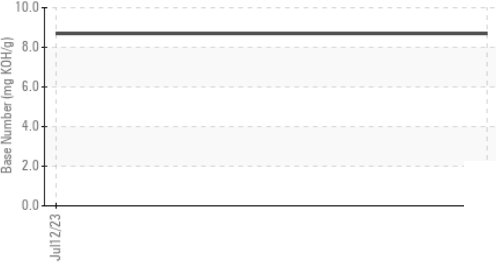


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	12.00	10.2	---

GRAPHS


Viscosity @ 100°C

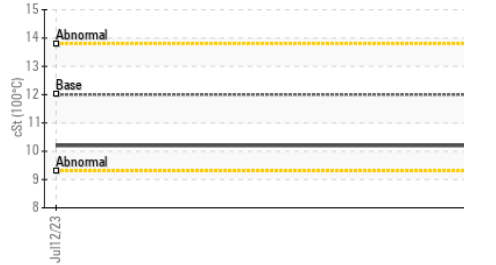


Iron (ppm)

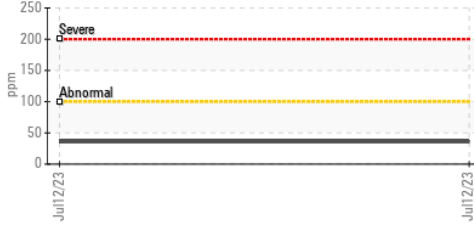

Lead (ppm)

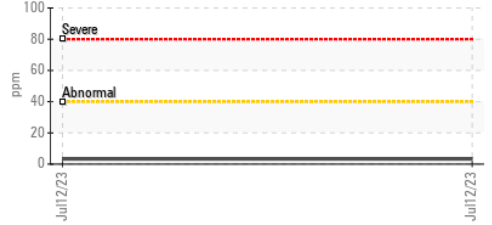

Aluminum (ppm)

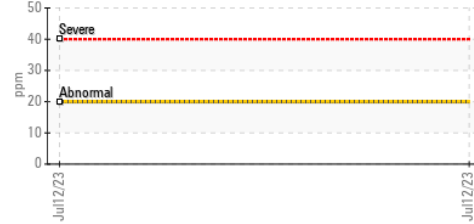


Chromium (ppm)




▲ Copper (ppm)




Silicon (ppm)

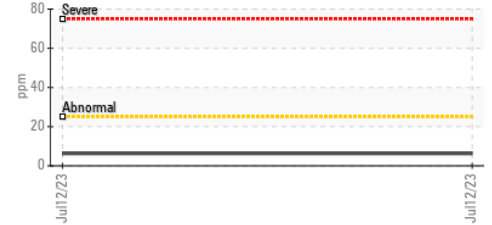

Viscosity @ 100°C

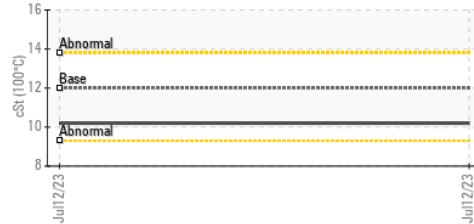

Base Number

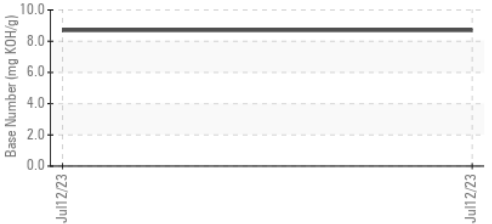

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0095744 **Received** : 20 Jul 2023
Lab Number : 05903022 **Diagnosed** : 21 Jul 2023
Unique Number : 10564378 **Diagnostician** : Don Baldrige
Test Package : MOB 1 (Additional Tests: TBN)

MILLER TRUCK LEASING #118
 2196 BENNETT ROAD
 PHILADELPHIA, PA
 US 19116
 Contact: ROSTY VITER
 rviter@millertransgroup.com
 T: (215)552-9832
 F: (215)552-9892

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)