

OIL ANALYSIS REPORT

Sample Rating Trend







Machine Id **2126893**

Component

Main Diesel Engine

PETRO CANADA DURON SHP 10W30 (15 QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the


Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

QTS)	## (175) ##						
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2	
Sample Number		Client Info		PCA0102754	PCA0100092	PCA0094872	
Sample Date		Client Info		02 Aug 2023	05 Jun 2023	09 Mar 2023	
Machine Age	days	Client Info		30	30	30	
Oil Age	days	Client Info		30	30	30	
Oil Changed		Client Info		N/A	N/A	N/A	
Sample Status				NORMAL	NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2	
Fuel		WC Method	>3.0	<1.0	<1.0	<1.0	
Glycol		WC Method		NEG	NEG	NEG	
WEAR METAL	.S	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m	>90	6	9	13	
Chromium	ppm	ASTM D5185m	>20	0	<1	0	
Nickel	ppm	ASTM D5185m	>2	0	0	0	
Titanium	ppm	ASTM D5185m	>2	0	0	0	
Silver	ppm	ASTM D5185m	>2	<1	0	0	
Aluminum	ppm	ASTM D5185m	>20	<1	<1	1	
Lead	ppm	ASTM D5185m	>40	<1	0	0	
Copper	ppm	ASTM D5185m	>330	<1	<1	0	
Tin	ppm	ASTM D5185m	>15	0	0	0	
Vanadium	ppm	ASTM D5185m		0	0	0	
Cadmium	ppm	ASTM D5185m		0	0	0	
ADDITIVES		method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m	2	2	1	3	
Barium	ppm	ASTM D5185m	0	2	2	0	
Molybdenum	ppm	ASTM D5185m	50	65	61	64	
Manganese	ppm	ASTM D5185m	0	0	<1	<1	
Magnesium	ppm	ASTM D5185m	950	921	898	916	
Calcium	ppm	ASTM D5185m	1050	1187	1062	1011	
Phosphorus	ppm	ASTM D5185m	995	1082	1055	946	
Zinc	ppm	ASTM D5185m	1180	1273	1230	1233	
Sulfur	ppm	ASTM D5185m	2600	3515	3350	3342	
CONTAMINAN	ITS	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m	>25	2	3	3	
Sodium	ppm	ASTM D5185m		0	0	<1	
Potassium	ppm	ASTM D5185m	>20	<1	<1	<1	
INFRA-RED		method	limit/base	current	history1	history2	
Soot %	%	*ASTM D7844	>6	0.1	0.1	0.1	
Nitration	Abs/cm	*ASTM D7624	>20	6.7	7.0	7.1	
Sulfation	Abs/.1mm	*ASTM D7415	>30	17.8	18.0	17.8	
FLUID DEGRAI	DATION	method	limit/base	current	history1	history2	
Oxidation	Abs/.1mm	*ASTM D7414	>25	14.4	14.5	14.1	
Base Number (BN)	mg KOH/g	ASTM D2896		8.7	8.8	8.6	



OIL ANALYSIS REPORT

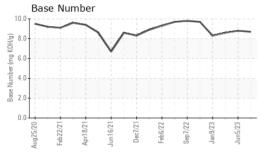


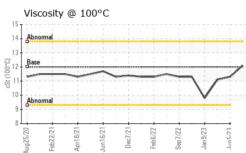



VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID PROPE	ERTIES	method				history2
Visc @ 100°C	cSt	ASTM D445	12.00	12.1	11.3	11.1

GRAPHS

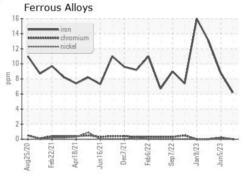

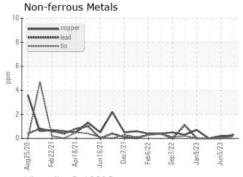

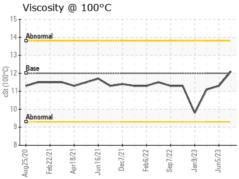

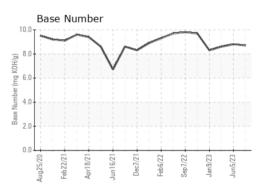





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : FLEET

: PCA0102754 : 05923163 : 10603110

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 14 Aug 2023 : 14 Aug 2023 Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

PERDUE FARMS - DILLON

2047 HWY 9 WEST DILLON, SC US 29536

Contact: KEVIN HOOKS kevin.hooks@perdue.com

Submitted By: KEVIN HOOKS

T: (843)841-8069 F: (843)841-8070