


OIL ANALYSIS REPORT

(21927Z) Walgreens [Walgreens] 136A61456

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

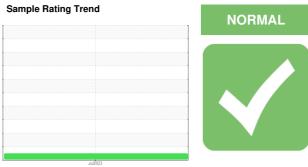

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

GAL)				Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0093986		
Sample Date		Client Info		31 Jul 2023		
Machine Age	mls	Client Info		418774		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINAT	TION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	17		
Chromium	ppm	ASTM D5185m	>5	2		
Nickel	ppm	ASTM D5185m	>2	<1		
Titanium	ppm	ASTM D5185m		1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>30	8		
Lead	ppm	ASTM D5185m	>30	<1		
Copper	ppm	ASTM D5185m	>150	4		
Tin	ppm	ASTM D5185m	>5	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
Cadmium ADDITIVES	ppm	ASTM D5185m method	limit/base	-	history1	history2
	ppm		limit/base	0	history1	history2
ADDITIVES		method		o current		history2
ADDITIVES Boron	ppm	method ASTM D5185m	2	o current		
ADDITIVES Boron Barium	ppm ppm	method ASTM D5185m ASTM D5185m	2	current 6 0		
ADDITIVES Boron Barium Molybdenum	ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50	0 current 6 0 59		
ADDITIVES Boron Barium Molybdenum Manganese	ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0	0 current 6 0 59 <1		
ADDITIVES Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950	0 current 6 0 59 <1 977		
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium	ppm ppm ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050	0 current 6 0 59 <1 977 1078		
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995	0 current 6 0 59 <1 977 1078 1037		
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180	0 current 6 0 59 <1 977 1078 1037 1309		
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 current 6 0 59 <1 977 1078 1037 1309 3612		
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 current 6 0 59 <1 977 1078 1037 1309 3612 current		
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 current 6 0 59 <1 977 1078 1037 1309 3612 current 6	 history1	
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	0 current 6 0 59 <1 977 1078 1037 1309 3612 current 6 2	 history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >20	0 current 6 0 59 <1 977 1078 1037 1309 3612 current 6 2 10	history1	
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >20	0 current 6 0 59 <1 977 1078 1037 1309 3612 current 6 2 10 current	history1 history1	history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot %	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m method *ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m method	2 0 50 0 950 1050 995 1180 2600 limit/base >20 	0 current 6 0 59 <1 977 1078 1037 1309 3612 current 6 2 10 current 0.5	history1 history1	history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration	ppm	method ASTM D5185m method ASTM D5185m ASTM D5185m *ASTM D5185m ASTM D76185m ASTM D76185m ASTM D76185m ASTM D76185m ASTM D76185m	2 0 50 0 950 1050 995 1180 2600 limit/base >20 >20 limit/base	0 current 6 0 59 <1 977 1078 1037 1309 3612 current 6 2 10 current 0.5 8.1	history1 history1	history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration Sulfation	ppm	method ASTM D5185m method ASTM D5185m ASTM D5185m *ASTM D5185m ASTM D76185m ASTM D76185m ASTM D76185m ASTM D76185m ASTM D76185m	2 0 50 0 950 1050 995 1180 2600 limit/base >20 >20 limit/base >3 >20 >3	0 current 6 0 59 <1 977 1078 1037 1309 3612 current 6 2 10 current 0.5 8.1 19.6	history1 history1	history2 history2



OIL ANALYSIS REPORT

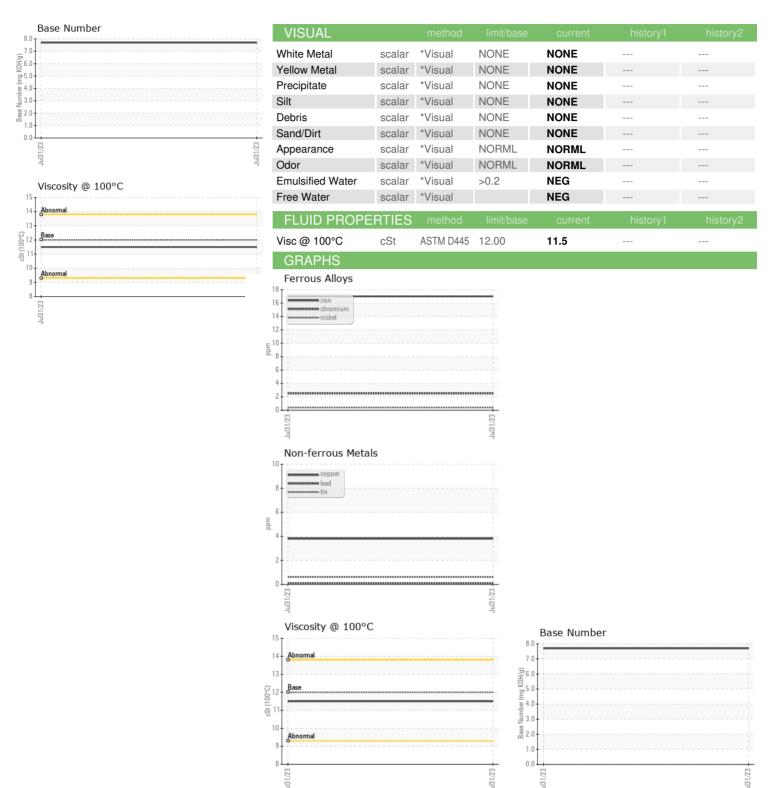





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: PCA0093986 : 05925811 : 10605758 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 16 Aug 2023

: 17 Aug 2023 Diagnosed : Wes Davis Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Transervice - Shop 1372 - Berkeley-Moreno Valley

17500 Perris Blvd. Moreno Valley, CA US 92551

Contact: Ryan Cruz rcruz@transervice.com T: (951)924-7131

F: (951)924-7151