


OIL ANALYSIS REPORT

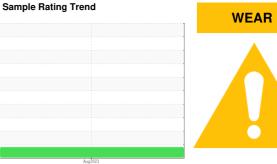

Machine Id **233139**

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- 0

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

Cylinder, crank, or cam shaft wear is indicated. All other component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

iAL)				Aug2023		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0099098		
Sample Date		Client Info		05 Aug 2023		
Machine Age	mls	Client Info		40000		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
-uel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>100	<u> </u>		
Chromium	ppm	ASTM D5185m	>20	3		
Nickel	ppm	ASTM D5185m	>4	2		
Fitanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	33		
_ead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	49		
Γin	ppm	ASTM D5185m	>15	6		
/anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	19		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	50		
Manganese	ppm	ASTM D5185m	0	6		
Magnesium	ppm	ASTM D5185m	950	480		
Calcium	ppm	ASTM D5185m	1050	1857		
Phosphorus	ppm	ASTM D5185m	995	859		
Zinc	ppm	ASTM D5185m	1180	1077		
Sulfur	ppm	ASTM D5185m	2600	2403		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	12		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	68		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	1		
Nitration	Abs/cm	*ASTM D7624	>20	13.6		
Sulfation	Abs/.1mm	*ASTM D7415	>30	26.2		
FLUID DEGRAD	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	26.0		
Base Number (BN)	mg KOH/g	ASTM D2896		6.9		



OIL ANALYSIS REPORT

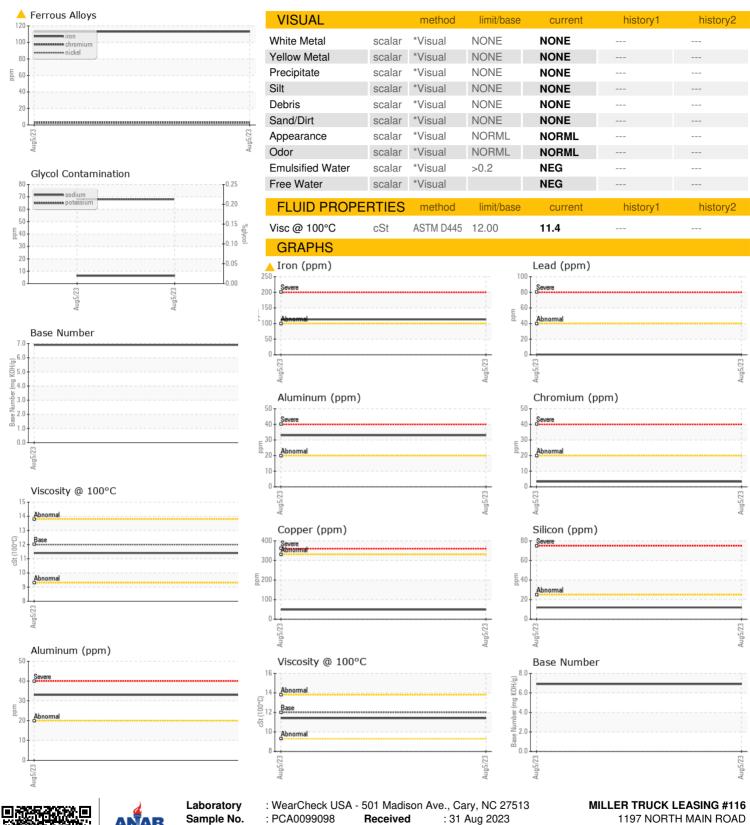





Certificate L2367

Sample No. Lab Number **Unique Number**

: PCA0099098 : 05939522 : 10630134

Received Diagnosed : 01 Sep 2023

Diagnostician : Don Baldridge Test Package : MOB 1 (Additional Tests: TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) 1197 NORTH MAIN ROAD VINELAND, NJ US 08360

Contact: GARY PRICE gprice@millertransgroup.com T: (856)696-4848

Contact/Location: GARY PRICE - MILVIN

F: (856)696-5629