


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

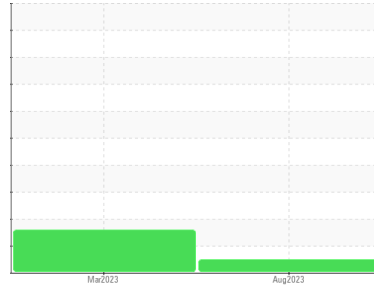

Machine Id
738199
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PCA0102941	PCA0093263	---
Sample Date	Client Info		24 Aug 2023	10 Mar 2023	---
Machine Age	mls	Client Info	55406	47119	---
Oil Age	mls	Client Info	55406	47119	---
Oil Changed	Client Info		Changed	Changed	---
Sample Status			NORMAL	ABNORMAL	---

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>5	<1.0	<1.0	---
Glycol	WC Method		NEG	0.0	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >100	51	18	---
Chromium	ppm	ASTM D5185m >20	2	<1	---
Nickel	ppm	ASTM D5185m >4	<1	0	---
Titanium	ppm	ASTM D5185m	2	2	---
Silver	ppm	ASTM D5185m >3	0	<1	---
Aluminum	ppm	ASTM D5185m >20	14	5	---
Lead	ppm	ASTM D5185m >40	<1	0	---
Copper	ppm	ASTM D5185m >330	75	22	---
Tin	ppm	ASTM D5185m >15	2	<1	---
Vanadium	ppm	ASTM D5185m	0	0	---
Cadmium	ppm	ASTM D5185m	0	0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 2	3	84	---
Barium	ppm	ASTM D5185m 0	0	0	---
Molybdenum	ppm	ASTM D5185m 50	56	57	---
Manganese	ppm	ASTM D5185m 0	1	<1	---
Magnesium	ppm	ASTM D5185m 950	839	483	---
Calcium	ppm	ASTM D5185m 1050	1342	1508	---
Phosphorus	ppm	ASTM D5185m 995	990	892	---
Zinc	ppm	ASTM D5185m 1180	1297	1043	---
Sulfur	ppm	ASTM D5185m 2600	2691	3427	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	5	5	---
Sodium	ppm	ASTM D5185m	2	11	---
Potassium	ppm	ASTM D5185m >20	28	21	---



INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844 >3	1.5	0.3	---
Nitration	Abs/cm	*ASTM D7624 >20	13.4	6.7	---
Sulfation	Abs/.1mm	*ASTM D7415 >30	25.9	19.5	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414 >25	24.1	16.5	---
Base Number (BN)	mg KOH/g	ASTM D2896	5.2	9.7	---









OIL ANALYSIS REPORT

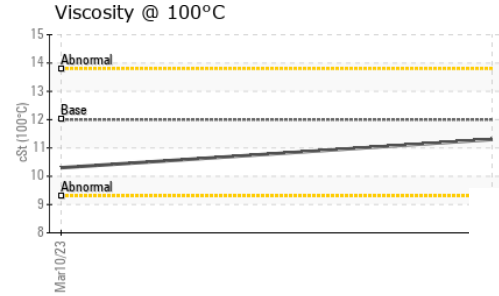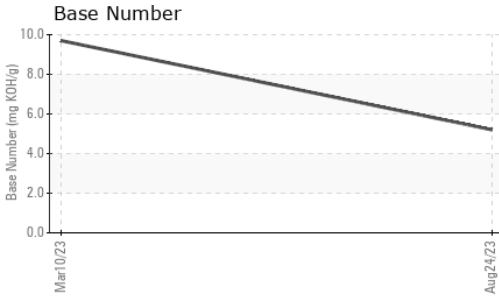

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.2	NEG	▲ 0.2%
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	12.00	11.3	10.3

GRAPHS

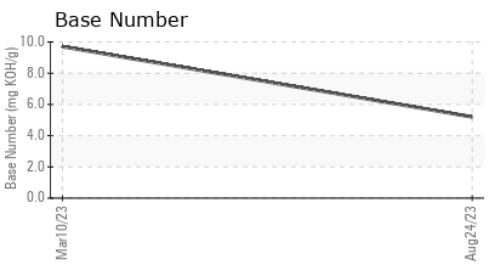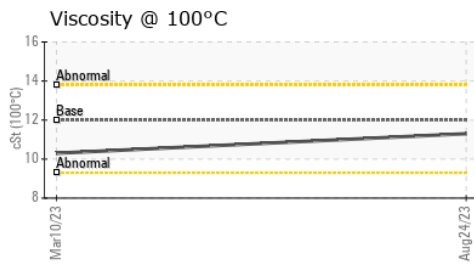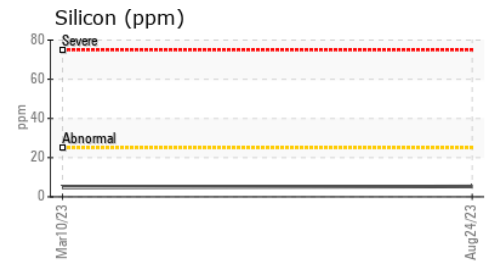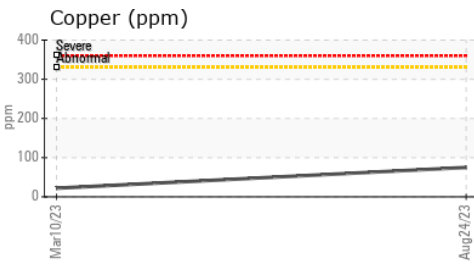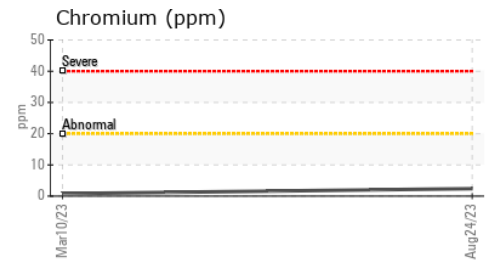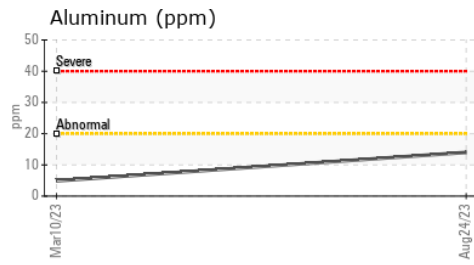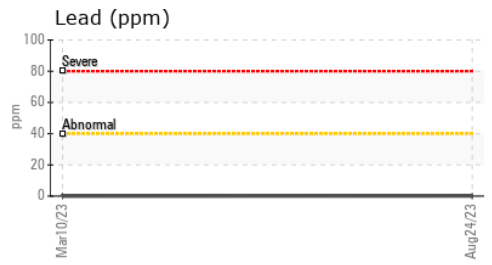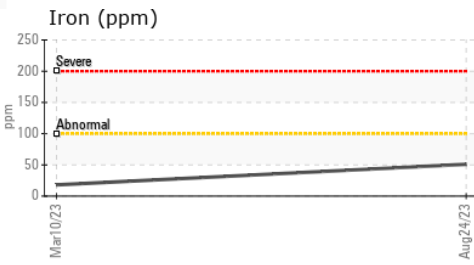

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0102941 **Received** : 06 Sep 2023
Lab Number : **05943327** **Diagnosed** : 07 Sep 2023
Unique Number : 10633939 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: TBN)

MILLER TRUCK LEASING #118
 2196 BENNETT ROAD
 PHILADELPHIA, PA
 US 19116
 Contact: ROSTY VITER
 rviter@millertransgroup.com
 T: (215)552-9832
 F: (215)552-9892

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)