


OIL ANALYSIS REPORT



NORMAL

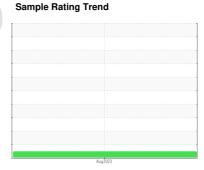

Machine Id Component

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- 0

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

AL)			A	wg ² 023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0103178		
Sample Date		Client Info		19 Aug 2023		
Machine Age	hrs	Client Info		1471		
Oil Age	hrs	Client Info		1471		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	99		
Chromium	ppm	ASTM D5185m	>20	2		
Nickel	ppm	ASTM D5185m	>4	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	108		
Lead	ppm	ASTM D5185m	>40	1		
Copper	ppm	ASTM D5185m	>330	14		
Tin	ppm	ASTM D5185m	>15	3		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	10		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	16		
Manganese	ppm	ASTM D5185m	0	4		
Magnesium	ppm	ASTM D5185m	950	931		
Calcium	ppm	ASTM D5185m	1050	1555		
Phosphorus	ppm	ASTM D5185m	995	917		
Zinc	ppm	ASTM D5185m	1180	1082		
Sulfur	ppm	ASTM D5185m	2600	3898		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	19		
Sodium	ppm	ASTM D5185m		8		
Potassium						
rolassiuiii	ppm	ASTM D5185m	>20	256		
INFRA-RED	ppm	ASTM D5185m method	>20 limit/base	256 current	history1	history2
INFRA-RED	ppm %					
		method	limit/base	current	history1	history2
INFRA-RED Soot %	%	method *ASTM D7844	limit/base	current 0.4	history1	history2
INFRA-RED Soot % Nitration	% Abs/cm Abs/.1mm	method *ASTM D7844 *ASTM D7624 *ASTM D7415	limit/base >3 >20	current 0.4 12.6	history1	history2
INFRA-RED Soot % Nitration Sulfation	% Abs/cm Abs/.1mm	method *ASTM D7844 *ASTM D7624 *ASTM D7415	limit/base	current 0.4 12.6 26.6	history1 	history2



OIL ANALYSIS REPORT

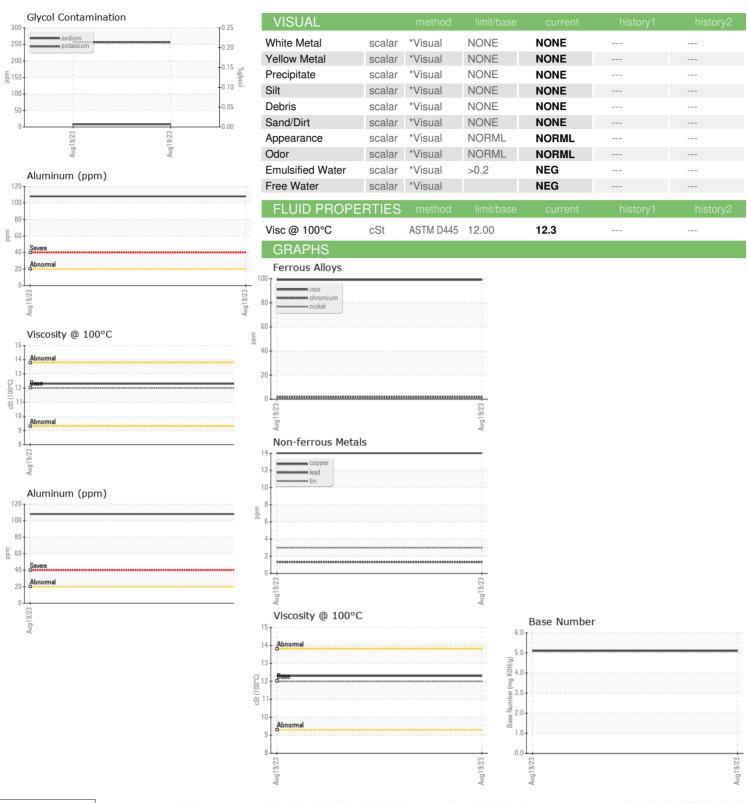





Laboratory Sample No. Lab Number Unique Number

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 05953556

: PCA0103178 : 10649515 Test Package : FLEET

Received : 18 Sep 2023 : 20 Sep 2023 Diagnosed : Sean Felton Diagnostician

BLUE MAX TRUCKING 1015 E. WESTINGHOUSE BLVD. CHARLOTTE, NC

US 28273 Contact: Jody Greer jgreer@bluemaxtrucking.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (980)225-9968 F: (704)588-2901 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)