

### **OIL ANALYSIS REPORT**

Sample Rating Trend



# Machine Id 811044

#### Component Diesel Engine

Fluid PETRO CANADA DURON SHP 15W40 (--- GAL)

#### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the oil.

#### Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

AFL0091006 5 Sep 2023 237 04 Changed IORMAL Current <1.0 NEG current 12	history1 GFL0090944 08 Sep 2023 5188 0 Changed NORMAL history1 <1.0 NEG	history2 GFL0082633 17 Aug 2023 5033 5033 Changed NORMAL history2 <1.0
5 Sep 2023 237 04 Changed IORMAL Current <1.0 NEG current	08 Sep 2023 5188 0 Changed NORMAL history1 <1.0	17 Aug 2023 5033 5033 Changed NORMAL history2
237 04 changed IORMAL current <1.0 NEG current	5188 0 Changed NORMAL history1 <1.0	5033 5033 Changed NORMAL history2
04 changed IORMAL current <1.0 NEG current	Changed NORMAL history1 <1.0	Changed NORMAL history2
Changed IORMAL current <1.0 NEG current	NORMAL history1 <1.0	NORMAL history2
Current	NORMAL history1 <1.0	NORMAL history2
<1.0 NEG current	<1.0	
NEG current		<1.0
current	NEG	
		NEG
12	history1	history2
	11	38
<1	<1	2
<1	0	0
0	0	0
0	0	0
		31
-		0
		2
		0
		<1
		0
	-	-
		history2
		4
-		0
-		81
		<1
-		991
		1098
		1020
		1246
3887	3883	3526
current	history1	history2
6	5	11
5	5	8
13	10	57
current	history1	history2
0.3	0.3	1
5.8	6.0	8.3
17.7	16.9	19.3
current	history1	history2
10.0	12.2	110
13.3	1 6 . 6	14.2
	8 0 (1) (1) 0 0 0 0 0 0 0 0 0 0 0 0 0	8         7           0         0           <1         <1           <1         0           <1         0           0         0           0         0           0         0           0         0           0         0           0         0           0         0           0         0           0         0           0         0           0         0           10         1           62         64           <1         1010           1057         1095           1087         1105           1087         1105           1288         1310           3887         3883           current         history1           6         5           5         5           13         10           0.3         0.3           5.8         6.0           10.9         16.9




Dec14/21

Dec12/22

Mav10/23

## **OIL ANALYSIS REPORT**

VISUAL

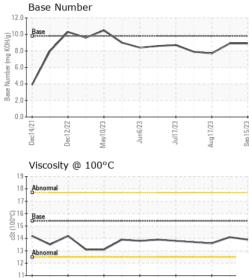

Precipitate scalar Visual NONE NONE NONE NONE NONE NONE NONE NON		White Metal Yellow Metal	scalar *Visual scalar *Visual	NONE	NONE NONE	NONE NONE	NONE NONE	
Situ scalar Visual NONE NONE NONE NONE NONE NONE NONE NON	$\sim$							
Image: Source of the section of the sectin of the section of the section of the section of the								
Sandzbrit scalar Visual NORE NORE NORE NORE NORE NORML NORMUL NOR								
<ul> <li>Base Number</li> <li>Storatory Sample No.</li> <li>Suboratory Tas Package : ELET</li> <li>Waar Check USA - 501 Madison Ave. Cary, NC 27513</li> <li>Suboratory Tas Package : ELET</li> <li>Waar Check USA - 501 Madison Ave. Cary, NC 27513</li> <li>Suboratory Sample Report. Contact Customer Service at 1-800-237-1389.</li> </ul>								
Enulsified Water iscalar Visual >0.2 NEG NEG NEG NEG NEG NEG Second Data Status (Neural Netator) (Neural Netator) (SE @ 100°C C) (SE ASTM D445 15.4 13.9 14.1 13.6 (SRAPHS) Ferrous Alloys Uscosity @ 100°C Uscosity @ 100°C Uscosity @ 100°C (Second Data Status) (Non-ferrous Metals (Non-ferrous Metals) (Second Data Status) (Second Data	23 - 23							
Enulsified Water iscalar Visual >0.2 NEG NEG NEG NEG NEG NEG Second Data Status (Neural Netator) (Neural Netator) (SE @ 100°C C) (SE ASTM D445 15.4 13.9 14.1 13.6 (SRAPHS) Ferrous Alloys Uscosity @ 100°C Uscosity @ 100°C Uscosity @ 100°C (Second Data Status) (Non-ferrous Metals (Non-ferrous Metals) (Second Data Status) (Second Data	Jun6/ /117/							
Free Water scalar Visual NEG NEG NEG Free Water scalar Visual NEG NEG NEG Freu Visual Induces current history1 history2 Visc @ 100°C cst ASTM D445 15.4 13.9 14.1 13.6 GRAPHS Ferrous Alops Ferrous Metals Viscosity @ 100°C Viscosity Dista Viscosity Wiscosity Wiscosi	. 4	000						L
FLUID PROPERTIES       method       imitbase       current       history1       history2         Visc @ 100°C       CSL       ASTM D445       15.4       13.9       14.1       13.6         GRAPHS         Fortous Alloys         Official of the second o				>0.2				
Visc @ 100°C cst ASTM D45 15.4 13.9 14.1 13.6					NEG			
GRAPHS Forous Alloys Forous Alloys Mon ferrous Metals Non ferrous Metals Viscosity @ 100°C Output to the second of the sec								'y2
From Alloys From Alloys For Units 12 For Home For Units 12 For Ent Prove For Units			CST ASTM D44	45 15.4	13.9	14.1	13.6	
hor ferrous Metals hor fe								
Image: state of the state								
Image: Non-ferrous Metals         Sample Non       Received         Sample Non-       Received         Subsci Nos       Diagnostican: Wes Davis         Subsci Nos Sample report contact Cus	6/23 - 1/23 - 1/23 -	120 - chromium						
Base Number         Viscosity @ 100°C	Jul	100 - nickel						
Aboratory       WearCheck USA - 501 Madison Ave., Cary, NC 2751 Bis Number       Sample No. Stops 100°C       Generation of the formation of the formati		80						
Monterrous Metals         Non-ferrous Metals         Monterrous Metals      <		ē 60-						
Aboratory       WearCheck USA - 501 Madison Ave., Cary, NC 27513       GE Environmental - 814 - Little Rock Haulin 1050Stressen         Sample No., Laboratory       WearCheck USA - 501 Madison Ave., Cary, NC 27513       GE Lenvironmental - 814 - Little Rock Haulin 1050Stressen         Minimum       Sample No., 1050Stressen       Received 1056St103       21 Sep 2023         Minimum       Utile Rock August       Utile Rock August         Obscuss times       21 Sep 2023       Little Rock August         Obscuss times and the count of the		40						
Image: State of the second		20		$\mathbf{\lambda}$				
Non-ferrous Metals http://www.internationality.offices.office								
Non-ferrous Metals http://www.internationality.offices.office		)ec14//	7/2 Jun6/2 2/7 flul 2/7 flul	ep15/2				
Laboratory Sample No. Laboratory Sample No. Sample No.			4	~				
Laboratory :: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Base Number :: 05956890 Diagnoset :: 21 Sep 2023 Diagnoset		16 T						
Laboratory       WearCheck USA - 501 Madison Ave., Cary, NC 27513 Diagnoset       Sep 2023 21 Sep 2023 Diagnoset       Sep 2023 21 Sep 2023 Diagnose		4+						
Laboratory Sample No. Sample No.								
Image: Number in the sample No.       Edeoratory in the sample No.       Ware Check USA - 501 Madison Ave., Cary, NC 27513       GEL Environmental - 814 - Little Rock Haulin 4005 Hwy 161 No.         Sample No.       Edeoratory in the sample Ro.       Environmental - 814 - Little Rock Haulin 4005 Hwy 161 No.       Environmental - 814 - Little Rock Haulin 4005 Hwy 161 No.         Viscourture International Construction of the sample report, contact Customer Service at 1-800-237-1365.       Generation and the sample report, contact Customer Service at 1-800-237-1365.								
Image: Number of Second Sec								
Laboratory Sample No. Laboratory Sample No. Lab Number USSOSSED USSOSSED Sample No. Lab Number State Latar No. Lab Number State Latar No. Lab Number State Latar No. Lab Number State Latar No. Lab Number State Numb								
Laboratory Sample No. Laboratory Sample No. Laboratory Sample No. Laboratory Test Package :: FLEET Contact: Brad Manage								
Viscosity @ 100°C Viscosity @ 1		0						
Viscosity @ 100°C Viscosity @ 1		14/21 12/22 10/23	n6/23 17/23	15/23				
Laboratory :: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Lab Number :: 05956890 Diagnosed :: 21 Sep 2023 Printicate 1230 Addiscuss this sample report, contact Customer Service at 1-800-237-1369.		- 2	4	Sep				
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Received : 20 Sep 2023 Lab Number : 05956890 Diagnosed : 21 Sep 2023 Unique Number : 10658103 Diagnostician : Wes Davis retificate 12307 Product Strips sample report, contact Customer Service at 1-800-237-1369.			C		Base Number			
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Received : 20 Sep 2023 Lab Number : 105956890 Diagnosed : 21 Sep 2023 unique Number : 10658103 Diagnosetician : Wes Davis US 7211 rest Package : FLEET Grant Customer Service at 1-800-237-1369.				12.0				
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Lab Number : 05956890 Unique Number : 10658103 mitiente L2367 Artificate L2367 Art		T I I I			Base			
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Lab Number : 05956890 Unique Number : 10658103 Test Package : FLEET o discuss this sample report, contact Customer Service at 1-800-237-1369.				HOX 8.0-	/	<u> </u>	$\checkmark$	
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Lab Number : 05956890 Unique Number : 10658103 Test Package : FLEET o discuss this sample report, contact Customer Service at 1-800-237-1369.		0 0 0 15		E 604	/			
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Lab Number : 05956890 Unique Number : 10658103 Test Package : FLEET o discuss this sample report, contact Customer Service at 1-800-237-1369.		<sup>4</sup> 714		Aumbe	/			
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Lab Number : 05956890 Unique Number : 10658103 Test Package : FLEET o discuss this sample report, contact Customer Service at 1-800-237-1369.		13 Abnormal		- 4.0 - ese				
IZH 1990       IZH 1990 <td< td=""><td></td><td></td><td></td><td>2.0-</td><td></td><td></td><td></td><td></td></td<>				2.0-				
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Received : 20 Sep 2023 Lab Number : 05956890 Diagnosed : 21 Sep 2023 Unique Number : 10658103 Diagnostician : Wes Davis tritificate L2367 Test Package : FLEET Contact: Brad Manage				0.0	3			~
Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : GFL0091006 Received : 20 Sep 2023 Lab Number : 05956890 Diagnosed : 21 Sep 2023 Unique Number : 10658103 Diagnostician : Wes Davis tritificate L2367 Test Package : FLEET Contact: Brad Manage		ec14/2 sc12/2	Jun6/2 ul17/2 g17/2	ap 15/2	ec14/. ec12/2 iy10/2:	Jun6/2	17/2	Can 1 E /3 2
Sample No.       : GFL0091006       Received       : 20 Sep 2023       4005 Hwy 161 No.         Lab Number       : 05956890       Diagnosed       : 21 Sep 2023       Little Rock, A         Unique Number       : 10658103       Diagnostician       : Wes Davis       US 7211         entificate L2367       Test Package       : FLEET       Contact: Brad Manage         o discuss this sample report, contact Customer Service at 1-800-237-1369.       Contact: Brad Manage		ū ū W	, L M	õ	u á ž		, Aı	ð
Lab Number       : 05956890       Diagnosed       : 21 Sep 2023       Little Rock, A         Unique Number       : 10658103       Diagnostician       : Wes Davis       US 7211         entificate L2367       Test Package       : FLEET       Contact: Brad Manage         o discuss this sample report, contact Customer Service at 1-800-237-1369.       Contact: Brad Manage					GFL Enviro			
Unique Number         : 10658103         Diagnostician         : Wes Davis         US 7211           artificate L2367         Test Package         : FLEET         Contact: Brad Manage           o discuss this sample report, contact Customer Service at 1-800-237-1369.         Contact: Brad Manage								
ertificate 12367 Test Package : FLEET Contact: Brad Manage of discuss this sample report, contact Customer Service at 1-800-237-1369.	ISO/ICC (7025							
			-			<u> </u>		
						Contact:	Brad Mana	

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)