


# **OIL ANALYSIS REPORT**

Sample Rating Trend



NORMAL

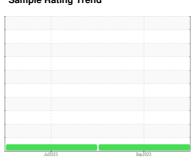

738215

Component **Diesel Engine** 

PETRO CANADA DURON SHP 10W30 (--- GAL)

## DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

#### Wear

All component wear rates are normal.

### Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

### **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

GAL)			Jul2023	Sep2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0105292	PCA0102925	
Sample Date		Client Info		15 Sep 2023	28 Jul 2023	
Machine Age	mls	Client Info		166841	147429	
Oil Age	mls	Client Info		166841	147429	
Oil Changed		Client Info		Changed	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	<1.0	
Glycol		WC Method		NEG	NEG	
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	33	23	
Chromium	ppm	ASTM D5185m	>20	2	2	
Nickel	ppm	ASTM D5185m	>4	<1	0	
Titanium	ppm	ASTM D5185m		0	2	
Silver	ppm	ASTM D5185m	>3	0	0	
Aluminum	ppm	ASTM D5185m	>20	18	14	
Lead	ppm	ASTM D5185m	>40	<1	0	
Copper	ppm	ASTM D5185m	>330	34	28	
Tin	ppm	ASTM D5185m	>15	1	1	
Vanadium	ppm	ASTM D5185m		<1	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	0	2	
Barium	ppm	ASTM D5185m	0	0	2	
Molybdenum	ppm	ASTM D5185m	50	67	62	
Manganese	ppm	ASTM D5185m	0	<1	<1	
Magnesium	ppm	ASTM D5185m	950	1078	924	
Calcium	ppm	ASTM D5185m	1050	1406	1257	
Phosphorus	ppm	ASTM D5185m	995	1095	1004	
Zinc	ppm	ASTM D5185m	1180	1421	1275	
Sulfur	ppm	ASTM D5185m	2600	2344	2572	
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	5	5	
Sodium	ppm	ASTM D5185m		4	<1	
Potassium	ppm	ASTM D5185m	>20	47	29	
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	1.3	0.9	
Nitration	Abs/cm	*ASTM D7624	>20	11.1	9.7	
Sulfation	Abs/.1mm	*ASTM D7415	>30	23.6	22.3	
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	20.9	18.4	
Base Number (BN)	mg KOH/g	ASTM D2896		5.1	6.5	



## **OIL ANALYSIS REPORT**







Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** 

: 05968755 : 10675306

: PCA0105292

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 04 Oct 2023 Diagnosed : 04 Oct 2023

Diagnostician : Wes Davis

Test Package : MOB 1 ( Additional Tests: TBN ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**MILLER TRUCK LEASING #118** 

2196 BENNETT ROAD PHILADELPHIA, PA US 19116

Contact: ROSTY VITER rviter@millertransgroup.com T: (215)552-9832

F: (215)552-9892

Contact/Location: ROSTY VITER - MILPHINE