

OIL ANALYSIS REPORT

Sample Rating Trend

RMAL



VOLVO VNL 135 (S/N 4V4NC9EH3NN304373

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


T	Samp	ie natilig Trellu		NO	OF
3)		A ₁₂ 202	3		
ION	method	limit/base	current	history1	

SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0097429		
Sample Date		Client Info		24 Aug 2023		
Machine Age	mls	Client Info		343000		
Oil Age	mls	Client Info		27000		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>6.0	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	18		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>2	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	3		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
	ppiii	710 1111 20 100111		U		
ADDITIVES	ppiii	method	limit/base	current	history1	history2
	ppm		limit/base			
ADDITIVES		method		current	history1	history2
ADDITIVES Boron	ppm	method ASTM D5185m	2	current 0	history1	history2
ADDITIVES Boron Barium	ppm	method ASTM D5185m ASTM D5185m	2	current 0 0	history1	history2
ADDITIVES Boron Barium Molybdenum	ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50	current 0 0 62	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese	ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0	current 0 0 62 <1	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950	current 0 0 62 <1 950	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180	current 0 0 62 <1 950 1015	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995	current 0 0 62 <1 950 1015 1024	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180	current 0 0 62 <1 950 1015 1024 1246	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	current 0 0 62 <1 950 1015 1024 1246 3278	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	current 0 0 62 <1 950 1015 1024 1246 3278 current	history1	history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	current 0 0 62 <1 950 1015 1024 1246 3278 current 5	history1 history1	history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	current 0 0 62 <1 950 1015 1024 1246 3278 current 5 <1	history1 history1	history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	current 0 0 62 <1 950 1015 1024 1246 3278 current 5 <1 2	history1 history1	history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	current 0 0 62 <1 950 1015 1024 1246 3278 current 5 <1 2 current	history1 history1 history1	history2 history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot %	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m method *ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	current 0 0 62 <1 950 1015 1024 1246 3278 current 5 <1 2 current 0.3	history1 history1 history1	history2 history2 history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m method ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	current 0 0 62 <1 950 1015 1024 1246 3278 current 5 <1 2 current 0.3 9.6	history1 history1 history1	history2 history2 history2 history2
ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration Sulfation	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	method ASTM D5185m method *ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20 limit/base >3 >20 >30	current 0 0 62 <1 950 1015 1024 1246 3278 current 5 <1 2 current 0.3 9.6 20.3	history1 history1 history1	history2 history2 history2 history2



OIL ANALYSIS REPORT

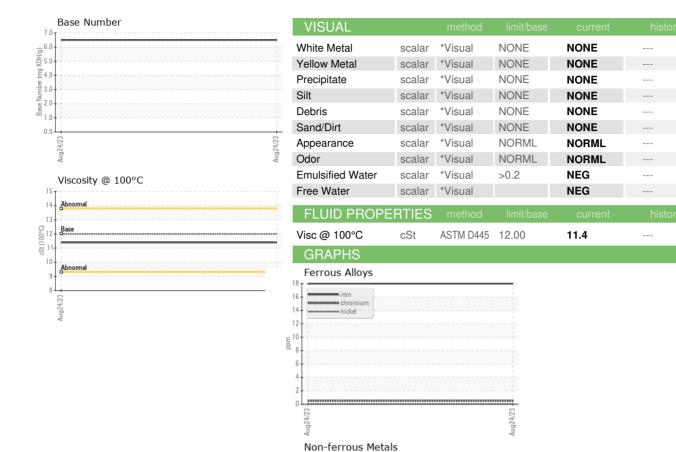

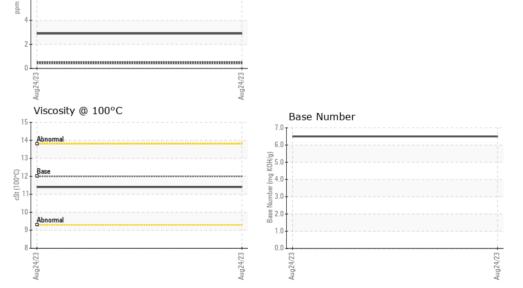





Certificate L2367

Report Id: TVAPLAIL [WUSCAR] 05971959 (Generated: 10/10/2023 08:16:33) Rev: 1

Laboratory Sample No. Lab Number Unique Number

: PCA0097429 : 05971959 : 10683909 Test Package : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 06 Oct 2023 Diagnosed : 09 Oct 2023 : Wes Davis Diagnostician

13915 W ROUTE 30 PLAINFIELD, IL US 60544 Contact: JOSHUA HUBBARD joshua@tvarepairllc.com

T: (815)306-0330

TVA REPAIR LLC

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)