

OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



WOLVO VNR 070 (S/N 4V4WC9EH9LN248036)

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.


All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

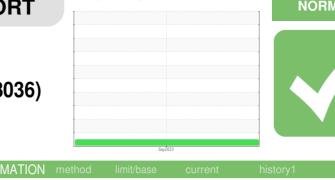

SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0097693		
Sample Date		Client Info		28 Sep 2023		
Machine Age	mls	Client Info		420000		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>6.0	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	22		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>2	0		
Titanium	ppm	ASTM D5185m	~ L	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>25	8		
Lead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	3		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m	7.10	0		
Cadmium	ppm	ASTM D5185m		0		
	le le			•		
ADDITIVES		method	limit/hase	current	history1	history2
ADDITIVES	nnm	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	0		
Boron Barium	ppm	ASTM D5185m ASTM D5185m	2	0		
Boron Barium Molybdenum	ppm	ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50	0 0 63		
Boron Barium Molybdenum Manganese	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0	0 0 63 <1		
Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950	0 0 63 <1 956		
Boron Barium Molybdenum Manganese Magnesium Calcium	ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050	0 0 63 <1 956 1062		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995	0 0 63 <1 956 1062 994		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180	0 0 63 <1 956 1062 994 1242	 	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 63 <1 956 1062 994 1242 3154		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 63 <1 956 1062 994 1242 3154	 	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 63 <1 956 1062 994 1242 3154 current		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	0 0 63 <1 956 1062 994 1242 3154 current 5	 history1	 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 63 <1 956 1062 994 1242 3154 current	 history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	0 0 63 <1 956 1062 994 1242 3154 current 5	history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	0 0 63 <1 956 1062 994 1242 3154 current 5 3	history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	0 0 63 <1 956 1062 994 1242 3154 current 5 3	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot %	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m method *ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	0 0 63 <1 956 1062 994 1242 3154 current 5 3 2	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration	ppm	ASTM D5185m ASTM D7844 *ASTM D7624 *ASTM D76145	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	0 0 63 <1 956 1062 994 1242 3154 current 5 3 2 current 0.3 10.5	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration Sulfation	ppm	ASTM D5185m ASTM D7844 *ASTM D7624 *ASTM D76145	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20 limit/base >3 >20 >30	0 0 63 <1 956 1062 994 1242 3154 current 5 3 2 current 0.3 10.5 21.6	history1 history1	history2 history2



OIL ANALYSIS REPORT

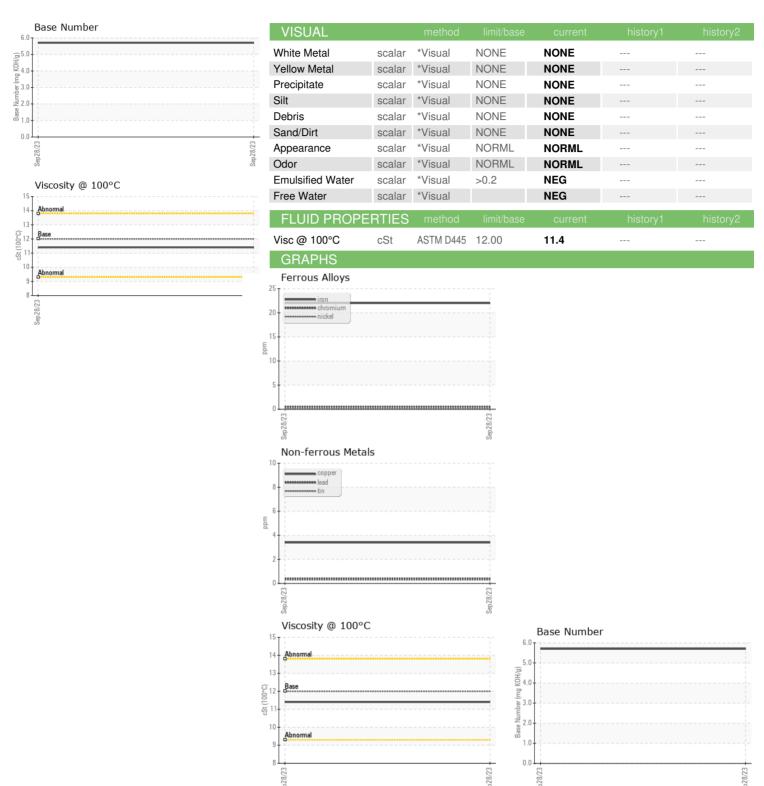





Laboratory Sample No. Lab Number

Unique Number

Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0097693 Received : 06 Oct 2023 : 05971982 Diagnosed : 09 Oct 2023 : 10683932 : Wes Davis Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

TVA REPAIR LLC 13915 W ROUTE 30 PLAINFIELD, IL

US 60544 Contact: JOSHUA HUBBARD joshua@tvarepairllc.com

T: (815)306-0330

F: