

OIL ANALYSIS REPORT



WOLVO VNL 108 (S/N 4V4NC9EH9MN286699)

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


I			NC
	!		
	Aug2023		

SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0097538		
Sample Date		Client Info		24 Aug 2023		
Machine Age	mls	Client Info		530000		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>6.0	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	40		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel Titanium	ppm	ASTM D5185m	>2	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m ASTM D5185m	>2	5		
Lead	ppm	ASTM D5185m	>40	ວ <1		
	ppm	ASTM D5185m	>330	5		
Copper	ppm	ASTM D5185m	>330	ە <1		
Vanadium	ppm	ASTM D5185m	>10	0		
Cadmium	ppm	ASTM D5185m		0		
Gaumum	ppm	ASTIVI DSTOSIII		U		
ADDITIVES		method	limit/base	current	history1	history2
ADDITIVES Boron	ppm	method ASTM D5185m	2	0	history1	history2
Boron Barium	ppm				,	,
Boron Barium Molybdenum	• • • • • • • • • • • • • • • • • • • •	ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50	0 0 66		
Boron Barium Molybdenum Manganese	ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0	0 0 66 <1		
Boron Barium Molybdenum Manganese Magnesium	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950	0 0 66 <1 979		
Boron Barium Molybdenum Manganese Magnesium Calcium	ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050	0 0 66 <1 979 1106		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995	0 0 66 <1 979 1106 1081		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180	0 0 66 <1 979 1106 1081		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995	0 0 66 <1 979 1106 1081		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180	0 0 66 <1 979 1106 1081		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 66 <1 979 1106 1081 1308 3183		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 66 <1 979 1106 1081 1308 3183	 history1	 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 66 <1 979 1106 1081 1308 3183 current	history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	0 0 66 <1 979 1106 1081 1308 3183 current 7	history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	0 0 66 <1 979 1106 1081 1308 3183 current 7 2	history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED	ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	0 0 66 <1 979 1106 1081 1308 3183 current 7 2	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot %	ppm	ASTM D5185m Method *ASTM D5185m *ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m *ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	0 0 66 <1 979 1106 1081 1308 3183 current 7 2 2	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration	ppm	ASTM D5185m Method *ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	0 0 66 <1 979 1106 1081 1308 3183 current 7 2 2 current 0.6 9.5	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration Sulfation	ppm	ASTM D5185m Method ASTM D5185m ASTM D7844 *ASTM D7624 *ASTM D7415	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20 limit/base >3 >20 >30	0 0 66 <1 979 1106 1081 1308 3183 current 7 2 2 current 0.6 9.5 20.2	history1 history1	history2 history2



OIL ANALYSIS REPORT



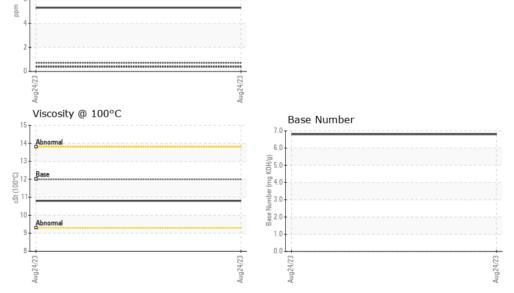





Certificate L2367

Laboratory Sample No. Lab Number Unique Number Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 05972004

: PCA0097538 : 10683954

Received Diagnosed Diagnostician

: 06 Oct 2023 : Wes Davis

: 09 Oct 2023

TVA REPAIR LLC 13915 W ROUTE 30 PLAINFIELD, IL US 60544 Contact: JOSHUA HUBBARD

joshua@tvarepairllc.com T: (815)306-0330

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: TVAPLAIL [WUSCAR] 05972004 (Generated: 10/09/2023 11:06:05) Rev: 1

F: