

OIL ANALYSIS REPORT

SAMPLE INFORMATION

NORMAL



WOLVO VNL 105 (S/N 4V4NC9EH7MN286698)

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

	Sep2023	Sep 2023
+		


Sample Number		Client Info		PCA0097542	PCA0097438	
Sample Date		Client Info		28 Sep 2023	28 Sep 2023	
Machine Age	mls	Client Info		415000	438000	
Oil Age	mls	Client Info		0	0	
Oil Changed		Client Info		Changed	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ON	method	limit/base	current	history1	history2
Fuel		WC Method	>6.0	<1.0	<1.0	
Glycol		WC Method		NEG	NEG	
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	29	15	
Chromium	ppm	ASTM D5185m	>20	<1	<1	
Nickel	ppm	ASTM D5185m	>2	0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>25	4	0	
Lead	ppm	ASTM D5185m	>40	<1	<1	
Copper	ppm	ASTM D5185m	>330	3	2	
Tin	ppm	ASTM D5185m	>15	<1	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES						history2
ADDITIVES		method	limit/base	current	history1	HISTOLA
Boron	ppm	ASTM D5185m	2	0	0	
	ppm ppm					
Boron	• • •	ASTM D5185m	2	0	0	
Boron Barium	ppm	ASTM D5185m ASTM D5185m	2	0 0	0	
Boron Barium Molybdenum	ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950	0 0 67	0 0 61 <1 911	
Boron Barium Molybdenum Manganese	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0	0 0 67 <1	0 0 61 <1	
Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995	0 0 67 <1 991	0 0 61 <1 911 1006 995	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180	0 0 67 <1 991 1088 1098	0 0 61 <1 911 1006 995 1186	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995	0 0 67 <1 991 1088 1098	0 0 61 <1 911 1006 995	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180	0 0 67 <1 991 1088 1098	0 0 61 <1 911 1006 995 1186	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	2 0 50 0 950 1050 995 1180 2600	0 0 67 <1 991 1088 1098 1330 3158	0 0 61 <1 911 1006 995 1186 2938	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	0 0 67 <1 991 1088 1098 1330 3158	0 0 61 <1 911 1006 995 1186 2938	
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	0 0 67 <1 991 1088 1098 1330 3158 current	0 0 61 <1 911 1006 995 1186 2938 history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base	0 0 67 <1 991 1088 1098 1330 3158 current 5	0 0 61 <1 911 1006 995 1186 2938 history1 4	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	0 0 67 <1 991 1088 1098 1330 3158 current 5 2	0 0 61 <1 911 1006 995 1186 2938 history1 4 <1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25	0 0 67 <1 991 1088 1098 1330 3158 current 5 2	0 0 61 <1 911 1006 995 1186 2938 history1 4 <1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot %	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m Method *ASTM D5185m	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	0 0 67 <1 991 1088 1098 1330 3158 current 5 2 2	0 0 61 <1 911 1006 995 1186 2938 history1 4 <1 1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D76145	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20	0 0 67 <1 991 1088 1098 1330 3158 current 5 2 2 current 0.4 11.8	0 0 61 <1 911 1006 995 1186 2938 history1 4 <1 1 history1 0.3 9.4	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration Sulfation	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D76145	2 0 50 0 950 1050 995 1180 2600 limit/base >25 >20 limit/base >3 >20 >30	0 0 67 <1 991 1088 1098 1330 3158 current 5 2 2 current 0.4 11.8 23.7	0 0 61 <1 911 1006 995 1186 2938 history1 4 <1 1 0.3 9.4 20.7	history2 history2



OIL ANALYSIS REPORT



Non-ferrous Metals

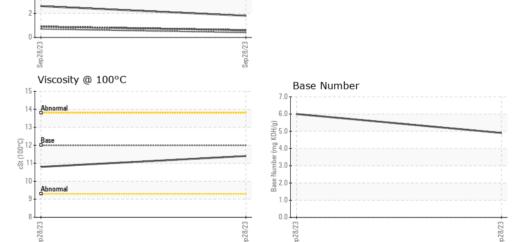



Certificate L2367

Laboratory Sample No. Lab Number Test Package : FLEET

Unique Number

: PCA0097542 : 05972006 : 10683956

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 06 Oct 2023 Diagnosed

: 09 Oct 2023 : Wes Davis

Diagnostician

US 60544 Contact: JOSHUA HUBBARD

joshua@tvarepairllc.com T: (815)306-0330

TVA REPAIR LLC

PLAINFIELD, IL

13915 W ROUTE 30

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)