

OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



Machine Id
FLORY 34 SERIES SW-29 (S/N 3045809)

Component
Diesel Engine

Fluid
PETRO CANADA DURON HP 15W40 (--- GAL)

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. No other corrective action is recommended at this time.

Wear

Metal levels are typical for a new component breaking in.

Contamination

Light fuel dilution occurring. No other contaminants were detected in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PCA0096369	---	---
Sample Date	Client Info	09 Oct 2023	---	---
Machine Age	hrs Client Info	879	---	---
Oil Age	hrs Client Info	250	---	---
Oil Changed	Client Info	Changed	---	---
Sample Status		NORMAL	---	---

CONTAMINATION

method	limit/base	current	history1	history2
Glycol	WC Method	NEG	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >100	30	---	---
Chromium	ppm ASTM D5185m >20	1	---	---
Nickel	ppm ASTM D5185m >4	1	---	---
Titanium	ppm ASTM D5185m	<1	---	---
Silver	ppm ASTM D5185m >3	0	---	---
Aluminum	ppm ASTM D5185m >20	0	---	---
Lead	ppm ASTM D5185m >40	12	---	---
Copper	ppm ASTM D5185m >330	7	---	---
Tin	ppm ASTM D5185m >15	<1	---	---
Vanadium	ppm ASTM D5185m	0	---	---
Cadmium	ppm ASTM D5185m	0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m	10	---	---
Barium	ppm ASTM D5185m	2	---	---
Molybdenum	ppm ASTM D5185m	54	---	---
Manganese	ppm ASTM D5185m	<1	---	---
Magnesium	ppm ASTM D5185m	762	---	---
Calcium	ppm ASTM D5185m	1300	---	---
Phosphorus	ppm ASTM D5185m	964	---	---
Zinc	ppm ASTM D5185m	1152	---	---
Sulfur	ppm ASTM D5185m	2907	---	---

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >25	8	---	---
Sodium	ppm ASTM D5185m	0	---	---
Potassium	ppm ASTM D5185m >20	2	---	---
Fuel	% ASTM D3524 >5	1.6	---	---




INFRA-RED

method	limit/base	current	history1	history2
Soot %	% *ASTM D7844 >3	0.3	---	---
Nitration	Abs/cm *ASTM D7624 >20	6.7	---	---
Sulfation	Abs/.1mm *ASTM D7415 >30	19.0	---	---

FLUID DEGRADATION

method	limit/base	current	history1	history2
Oxidation	Abs/.1mm *ASTM D7414 >25	14.8	---	---
Base Number (BN)	mg KOH/g ASTM D2896 9.8	8.0	---	---









OIL ANALYSIS REPORT

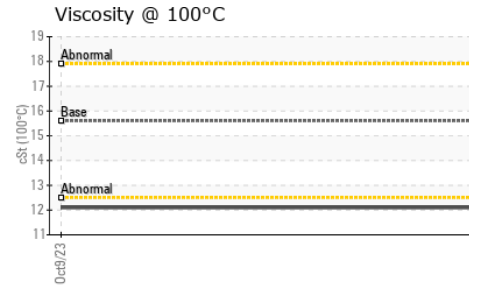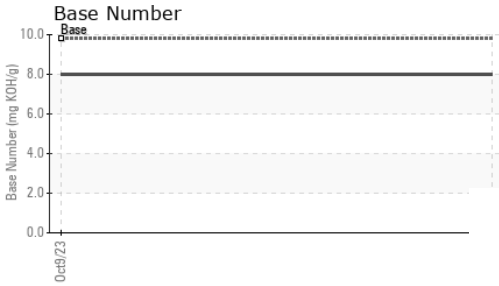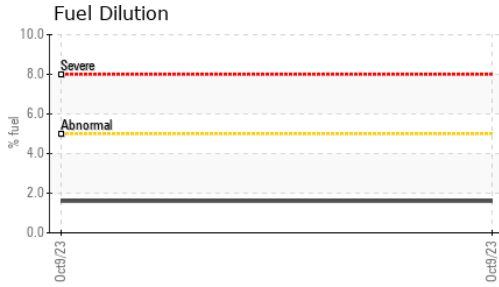

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.6	12.1	---

GRAPHS

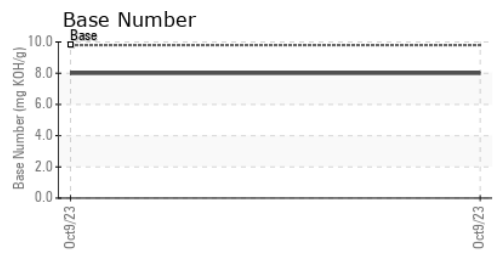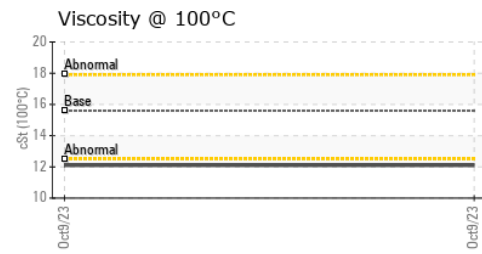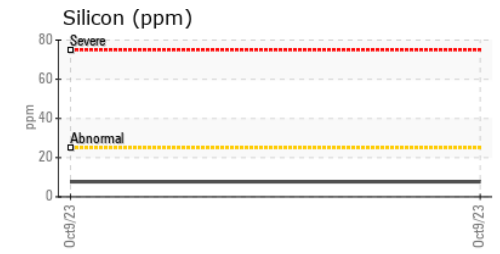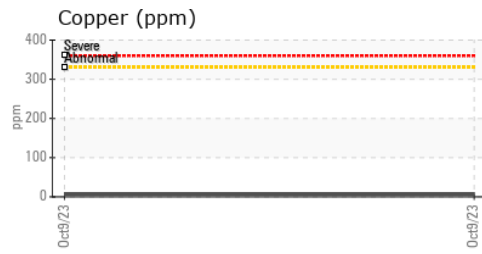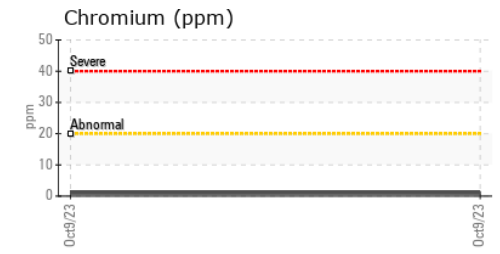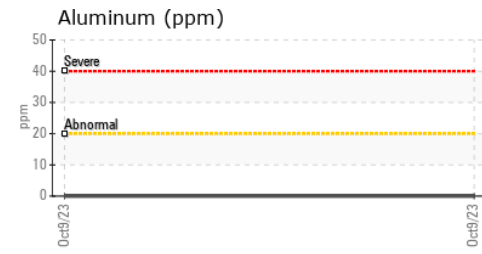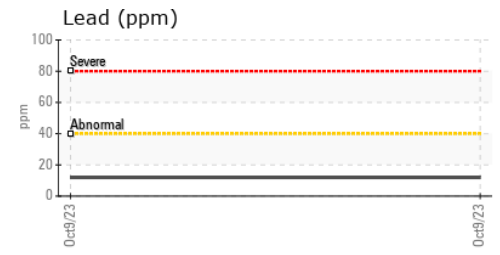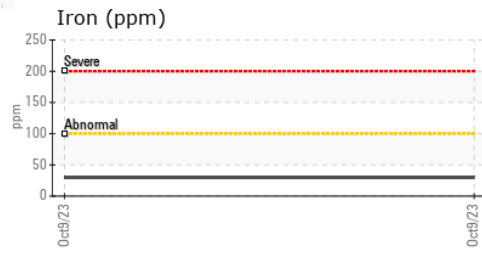

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0096369 **Received** : 16 Oct 2023
Lab Number : **05979403** **Diagnosed** : 17 Oct 2023
Unique Number : 10696698 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, TBN)

TRINITAS FARMING
 45499 W PANOCHE RD
 FIREBAUGH, CA
 US 93622

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact: SPENCER COOPER
 spencer.cooper@trinitasfarming.com
 T: (209)493-2999
 F: