

OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id **644439**

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- 0

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. No other contaminants were detected in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

QTS)				Oct2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0106274		
Sample Date		Client Info		12 Oct 2023		
Machine Age	mls	Client Info		23781		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	67		
Chromium	ppm	ASTM D5185m	>20	4		
Nickel	ppm	ASTM D5185m	>4	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	170		
Lead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	162		
Tin	ppm	ASTM D5185m	>15	3		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	33		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	46		
Manganese	ppm	ASTM D5185m	0	4		
Magnesium	ppm	ASTM D5185m	950	625		
Calcium	ppm	ASTM D5185m	1050	1728		
Phosphorus	ppm	ASTM D5185m	995	811		
Zinc	ppm	ASTM D5185m	1180	1026		
Sulfur	ppm	ASTM D5185m	2600	2352		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	9		
Sodium	ppm	ASTM D5185m		7		
Potassium	ppm	ASTM D5185m	>20	372		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.7		
Nitration	Abs/cm	*ASTM D7624	>20	8.4		
Sulfation	Abs/.1mm	*ASTM D7415	>30	22.4		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	20.9		
Base Number (BN)	mg KOH/g	ASTM D2896		7.6		
	J					



OIL ANALYSIS REPORT

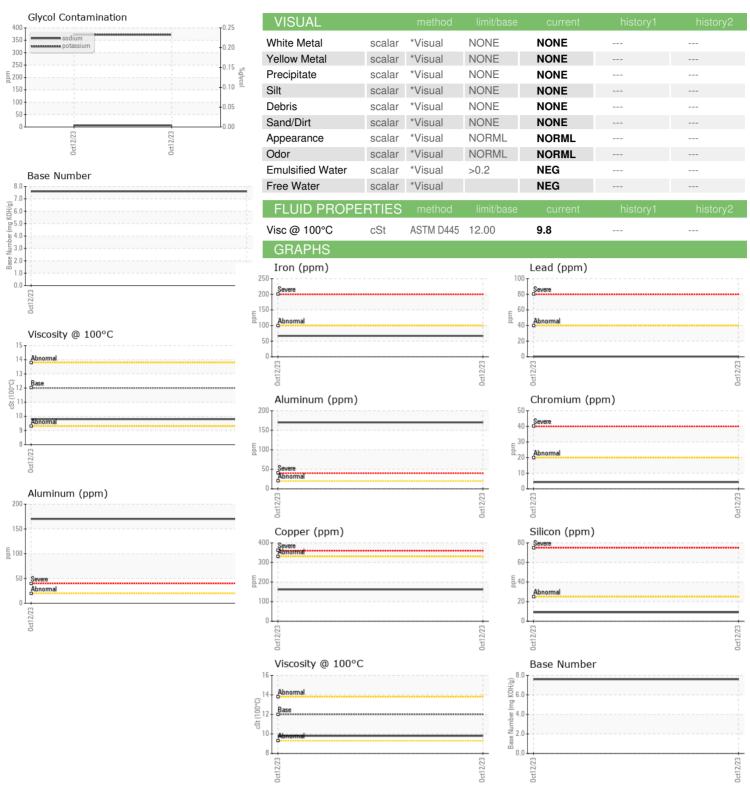





Certificate L2367

Laboratory Sample No.

Lab Number **Unique Number**

: 05980894 : 10698189

: PCA0106274

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 17 Oct 2023 : 18 Oct 2023 Diagnostician : Don Baldridge

Test Package : MOB 1 (Additional Tests: TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. **MILLER TRUCK LEASING #119** 39 INDUSTRIAL AVE

HASBROUCK HEIGHTS, NJ US 07604

Contact: MIKE LONGETTE mlongette@millertransgroup.com

T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (201)528-7053