

# **OIL ANALYSIS REPORT**

Sample Rating Trend



NORMAL



Machine Id **228037** 

Component **Diesel Engine** 

PETRO CANADA DURON SHP 15W40 (--- GAL)

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.


### **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

JAL)		Mar2022	Jul2022	Jul2022 Dec2022	Oct2023	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0092614	GFL0064276	GFL0050917
Sample Date		Client Info		31 Oct 2023	24 Dec 2022	28 Jul 2022
Machine Age	hrs	Client Info		7963	6293	5956
Oil Age	hrs	Client Info		610	607	89
Oil Changed		Client Info		Not Changd	Changed	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Glycol		WC Method		NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	30	18	4
Chromium	ppm	ASTM D5185m	>20	<1	<1	0
Nickel	ppm	ASTM D5185m	>4	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m	>3	0	0	<1
Aluminum	ppm	ASTM D5185m	>20	12	7	3
Lead	ppm	ASTM D5185m	>40	2	<1	<1
Copper	ppm	ASTM D5185m	>330	2	4	1
Tin	ppm	ASTM D5185m	>15	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	<1	98	6
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	69	67	61
Manganese	ppm	ASTM D5185m	0	<1	<1	<1
Magnesium	ppm	ASTM D5185m	1010	1049	960	937
Calcium	ppm	ASTM D5185m	1070	1170	1203	1096
Phosphorus	ppm	ASTM D5185m	1150	1102	1087	985
Zinc	ppm	ASTM D5185m	1270	1352	1286	1212
Sulfur	ppm	ASTM D5185m	2060	3316	3732	3532
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	6	4	2
Sodium	ppm	ASTM D5185m		1	<1	0
Potassium	ppm	ASTM D5185m	>20	17	10	0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	2.1	1.3	0.4
Nitration	Abs/cm	*ASTM D7624	>20	14.1	11.2	6.4
Sulfation	Abs/.1mm	*ASTM D7415	>30	25.8	20.9	19.3
FLUID DEGRA	OATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	23.5	17.7	15.1
Base Number (BN)	mg KOH/g		9.8	7.6	8.8	10.4
(214)						



# **OIL ANALYSIS REPORT**

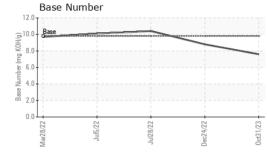



19 7 7				
18 - Abnormal				
17-				
00115 Base 8314				
€15				
g 14				
13 - Abnormal				
12				
11				
Mar28/22	72	Jul28/2:	)ec24/2	


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID PROPERTIES		method				history2
Visc @ 100°C	cSt	ASTM D445	15.4	13.9	13.5	14.4

### **GRAPHS**

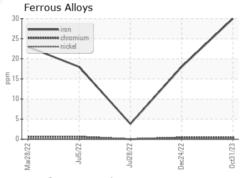

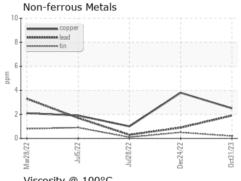

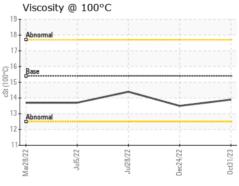

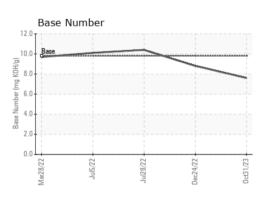





Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10729356 Test Package : FLEET

: GFL0092614 : 06000996

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 07 Nov 2023 : 08 Nov 2023 Diagnostician : Wes Davis

GFL Environmental - 947 - WB Horicon HC

N7296 County Rd V Horicon, WI US 53032 Contact: Tim Kieffer

tim.kieffer@gflenv.com T: (608)219-0288

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: GFL947 [WUSCAR] 06000996 (Generated: 11/08/2023 09:41:20) Rev: 1

Submitted By: See also GFL935 - Tim Kieffer