


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

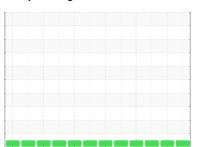

Machine Id

Copperhead Gap 1

Compressor Fluid

PETRO CANADA TURBOFLO R&O 150 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

•		Sep2022	Nov2022 Mar2023	May2023 Jul2023 Se	p2023	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0111860	PCA0103382	PCA0092132
Sample Date		Client Info		13 Nov 2023	06 Sep 2023	04 Aug 2023
Machine Age	hrs	Client Info		119527	118043	117285
Oil Age	hrs	Client Info		119526	117285	115890
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	<1
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	0	1
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>50	0	0	<1
Tin	ppm	ASTM D5185m	>15	<1	0	0
Vanadium	ppm	ASTM D5185m		0	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		<1	0	0
Calcium	ppm	ASTM D5185m	0	8	13	4
Phosphorus	ppm	ASTM D5185m	4	10	11	11
Zinc	ppm	ASTM D5185m	0	0	0	0
Sulfur	ppm	ASTM D5185m		686	829	844
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	<1	<1
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	0	0	0
FLUID DEGRAI	DATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.18	0.08	0.11	0.12



OIL ANALYSIS REPORT

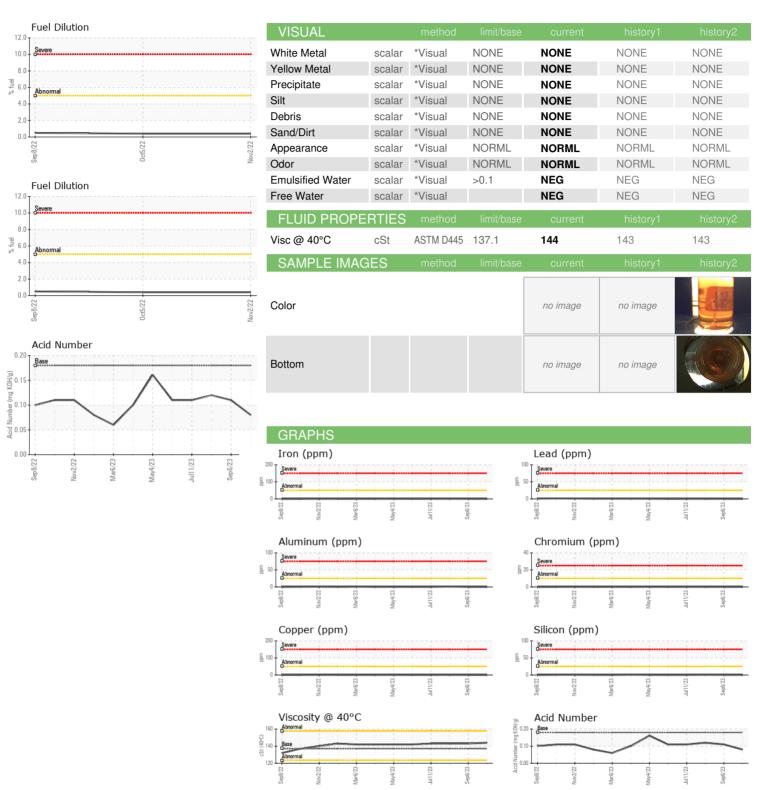





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0111860 : 06010226

: 10749370

Received Diagnosed

: 16 Nov 2023 : 20 Nov 2023

Diagnostician : Don Baldridge Test Package : MOB 2 (Additional Tests: FuelDilution)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ENERVEST OPERATING - COPPERHEAD GAP

3681 RABBIT RIDGE CLEVELAND, VA

US 24225 Contact: Service Manager

Submitted By: RANDY SMITH

F:

T: