




PROBLEM SUMMARY

Sample Rating Trend

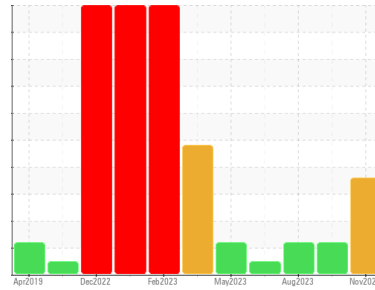

DIRT




Machine Id
928073-260342

Component
Diesel Engine


Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

COMPONENT CONDITION SUMMARY


▲ Glycol Contamination

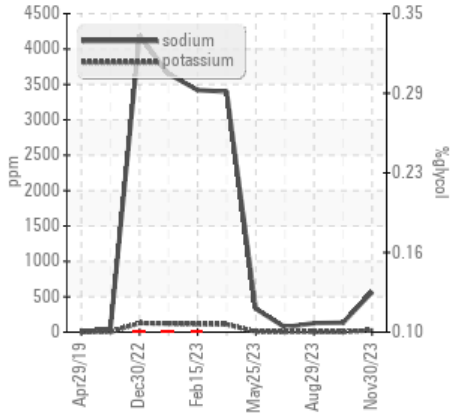

▲ Silicon (ppm)

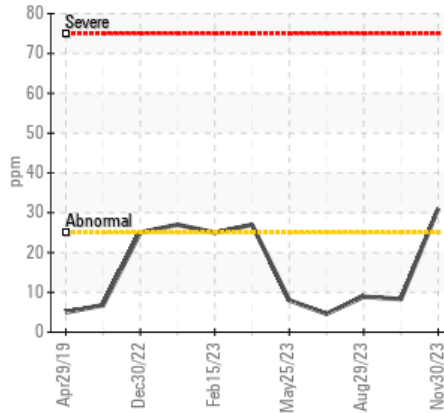

▲ Aluminum (ppm)

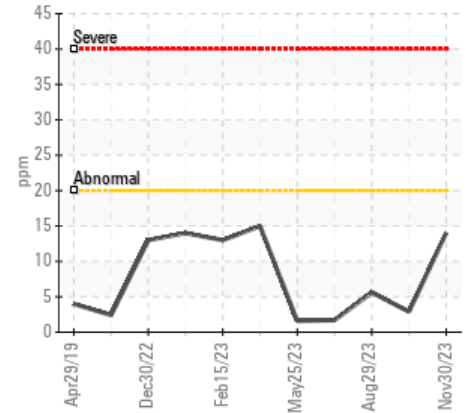

RECOMMENDATION

We advise that you check for the source of the coolant leak. Check for low coolant level. We advise that you check the air filter, air induction system, and any areas where dirt may enter the component. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	ATTENTION	ATTENTION
Aluminum	ppm	ASTM D5185m	>20	▲ 14	3	6
Silicon	ppm	ASTM D5185m	>25	▲ 31	8	9
Sodium	ppm	ASTM D5185m		▲ 568	▲ 133	▲ 127

Customer Id: GFL820
Sample No.: GFL0088141
Lab Number: 06027315
Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Resample	---	---	?	We recommend an early resample to monitor this condition.
Check Dirt Access	---	---	?	We advise that you check the air filter, air induction system, and any areas where dirt may enter the component.
Check Glycol Access	---	---	?	We advise that you check for the source of the coolant leak.

HISTORICAL DIAGNOSIS

06 Nov 2023 Diag: Jonathan Hester

GLYCOL



Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition. All component wear rates are normal. Sodium and/or potassium levels remain high. Test for glycol is negative. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report



29 Aug 2023 Diag: Don Baldrige

GLYCOL



No corrective action is recommended at this time. We recommend an early resample to monitor this condition. All component wear rates are normal. Sodium and/or potassium levels remain elevated. Test for glycol is negative. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report



15 Jun 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

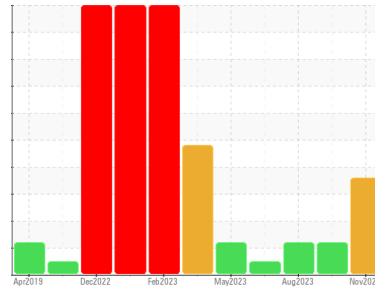

DIRT



Machine Id
928073-260342

Component
Diesel Engine

Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check for the source of the coolant leak. Check for low coolant level. We advise that you check the air filter, air induction system, and any areas where dirt may enter the component. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Sodium and/or potassium levels are high. Elemental levels of silicon (Si) and aluminum (Al) indicate alumina-silicate (coarse dirt) ingress.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	GFL0088141	GFL0088206	GFL0088196
Sample Date	Client Info	30 Nov 2023	06 Nov 2023	29 Aug 2023
Machine Age	hrs	30480	0	124499
Oil Age	hrs	0	0	0
Oil Changed	Client Info	N/A	Changed	Not Changd
Sample Status		ABNORMAL	ATTENTION	ATTENTION

CONTAMINATION

method	limit/base	current	history1	history2
Fuel	WC Method >5	<1.0	<1.0	<1.0
Water	WC Method >0.2	NEG	NEG	NEG

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >100	82	12	20
Chromium	ppm ASTM D5185m >20	4	0	1
Nickel	ppm ASTM D5185m >4	1	0	<1
Titanium	ppm ASTM D5185m	<1	0	<1
Silver	ppm ASTM D5185m >3	0	0	0
Aluminum	ppm ASTM D5185m >20	▲ 14	3	6
Lead	ppm ASTM D5185m >40	0	0	<1
Copper	ppm ASTM D5185m >330	3	<1	1
Tin	ppm ASTM D5185m >15	<1	0	0
Vanadium	ppm ASTM D5185m	0	0	0
Cadmium	ppm ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m 0	5	0	0
Barium	ppm ASTM D5185m 0	0	0	0
Molybdenum	ppm ASTM D5185m 60	78	69	70
Manganese	ppm ASTM D5185m 0	<1	0	<1
Magnesium	ppm ASTM D5185m 1010	940	1002	905
Calcium	ppm ASTM D5185m 1070	1086	1089	1050
Phosphorus	ppm ASTM D5185m 1150	1046	1126	996
Zinc	ppm ASTM D5185m 1270	1235	1421	1212
Sulfur	ppm ASTM D5185m 2060	3709	3427	3253

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >25	▲ 31	8	9
Sodium	ppm ASTM D5185m	▲ 568	▲ 133	▲ 127
Potassium	ppm ASTM D5185m >20	27	4	4
Glycol	% *ASTM D2982	NEG	NEG	NEG

INFRA-RED

method	limit/base	current	history1	history2
Soot %	% *ASTM D7844 >3	0.2	0.5	0.8
Nitration	Abs/cm *ASTM D7624 >20	5.9	8.9	9.9
Sulfation	Abs.1mm *ASTM D7415 >30	18.4	21.0	21.2


FLUID DEGRADATION

method	limit/base	current	history1	history2
Oxidation	Abs.1mm *ASTM D7414 >25	14.6	19.2	17.7
Base Number (BN)	mg KOH/g ASTM D2896 9.8	8.4	7.6	7.8




OIL ANALYSIS REPORT


▲ Silicon (ppm)

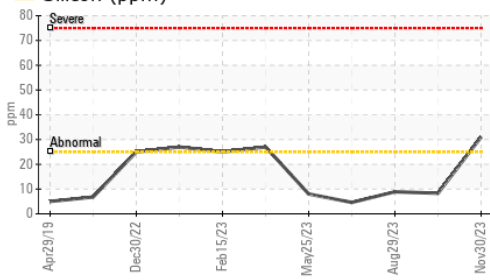


▲ Aluminum (ppm)

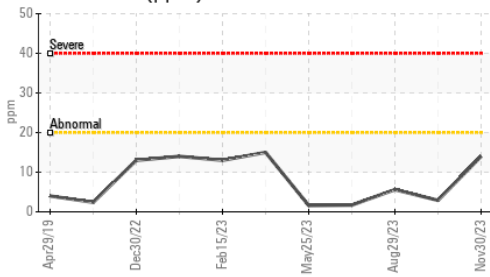


Glycol Contamination

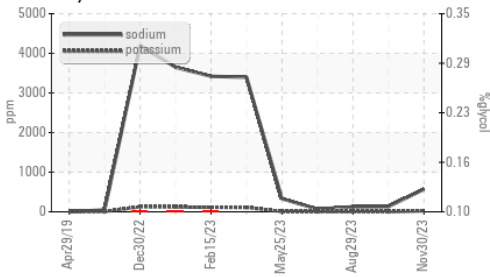

Viscosity @ 100°C

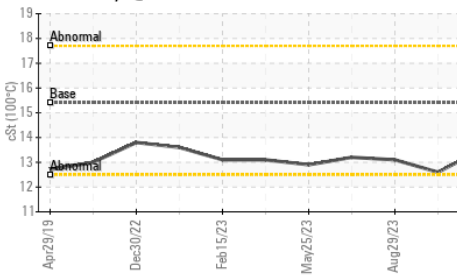

Glycol Contamination

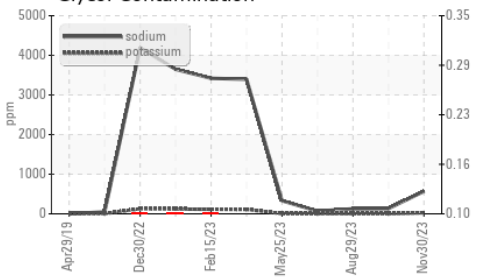


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	13.5	12.6

GRAPHS


Ferrous Alloys

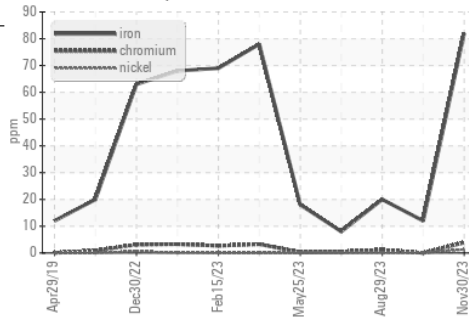


Non-ferrous Metals

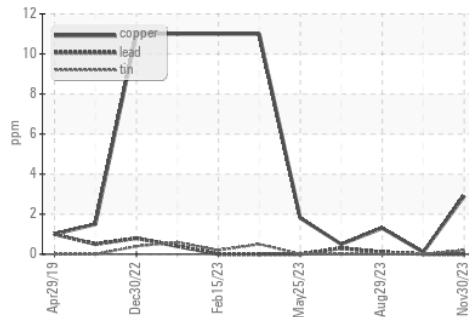

Viscosity @ 100°C

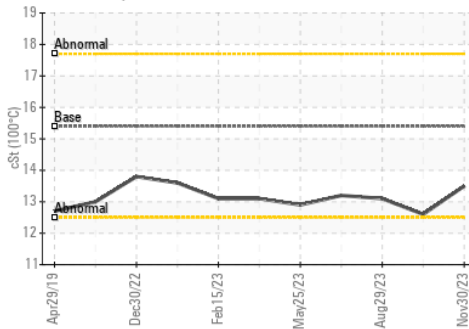

Base Number

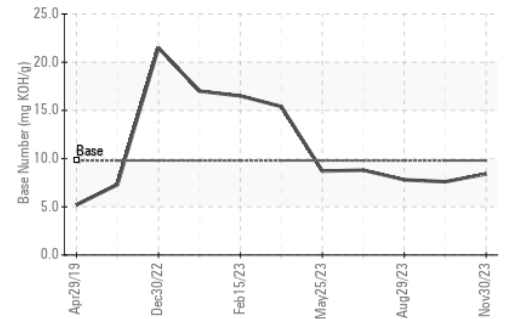

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0088141 **Received** : 07 Dec 2023
Lab Number : 06027315 **Diagnosed** : 11 Dec 2023
Unique Number : 10777106 **Diagnostician** : Jonathan Hester
Test Package : FLEET (Additional Tests: Glycol)

GFL Environmental - 820 - Joplin Hauling
 3700 West 7th Street
 Joplin, MO
 US 64801
 Contact: James Jarrett
 jjarrett@gflenv.com
 T: (417)310-2802
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)