

PROBLEM SUMMARY


Sample Rating Trend

DIRT

Machine Id
DT41
Component
Front Differential
Fluid

NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

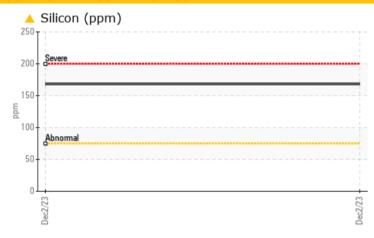

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Silicon	ppm	ASTM D5185m	>75	<u> </u>				

Customer Id: NWWCOL
Sample No.: PCA0104202
Lab Number: 06029783
Test Package: FLEET

To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldridge +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



DT41 Component

Front Differential

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Elemental level of silicon (Si) above normal indicating ingress of seal material.

Fluid Condition


The condition of the oil is acceptable for the time in service.

1313 NEPU	ו חי					DINI
				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history	1 history2
Sample Number		Client Info		PCA0104202		
Sample Date		Client Info		02 Dec 2023		
Machine Age	mls	Client Info		31510		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
CONTAMINATI	ON	method	limit/base	current	history	1 history2
Water		WC Method	>.2	NEG		
WEAR METALS	S	method	limit/base	current	history	1 history2
Iron	ppm	ASTM D5185m	>500	194		
Chromium	ppm	ASTM D5185m	>10	2		
Nickel	ppm	ASTM D5185m	>10	8		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		

	•				,	,
Iron	ppm	ASTM D5185m	>500	194		
Chromium	ppm	ASTM D5185m	>10	2		
Nickel	ppm	ASTM D5185m	>10	8		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	5		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>100	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		164		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		4		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		31		
Phosphorus	ppm	ASTM D5185m		1142		
Zinc	ppm	ASTM D5185m		5		
Sulfur	ppm	ASTM D5185m		24852		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	168		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	2		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	LIGHT		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Free Water	scalar	*Visual		NEG		



OIL ANALYSIS REPORT

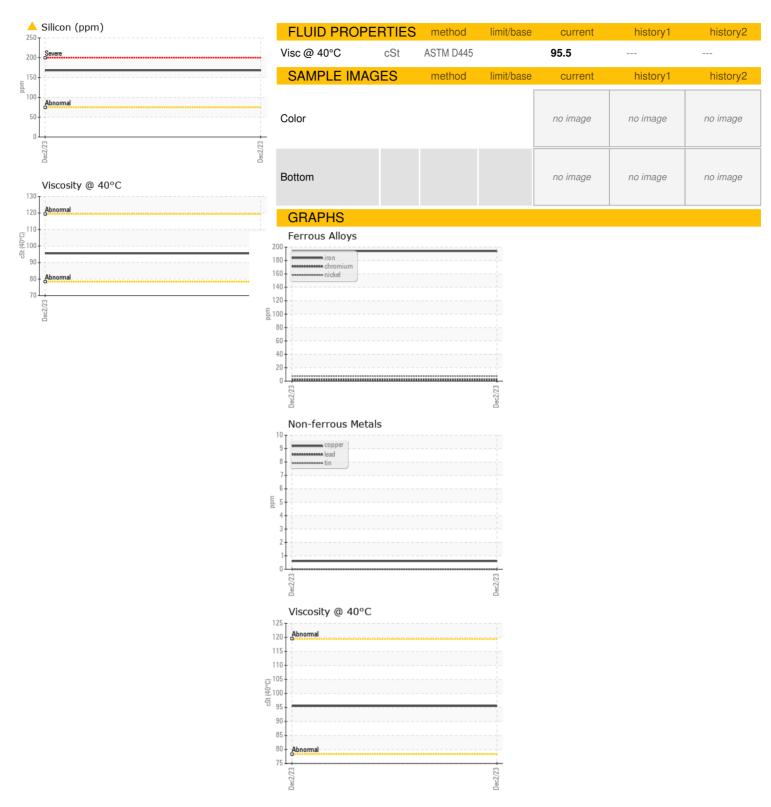





Certificate L2367

Laboratory Sample No. Lab Number

: PCA0104202 : 06029783 Unique Number : 10779574 Test Package : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 08 Dec 2023 : 12 Dec 2023 Diagnosed

Diagnostician : Don Baldridge

NW WHITE & CO - COLUMBIA DIVISION 100 INDEPENDENCE BLVD COLUMBIA, SC

US 29210 Contact: GEORGE EDWARDS

gedwards@nwwhite.com

T:

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: