

OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

920097-260370

Component

Hydraulic System

{not provided} (--- GAL)

DIAGNOSIS Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

High concentration of visible dirt/debris present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Dec2023		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0102503		
Sample Date		Client Info		27 Dec 2023		
Machine Age	hrs	Client Info		9447		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	13		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	1		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>75	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		10		
Calcium	ppm	ASTM D5185m		92		
Phosphorus	ppm	ASTM D5185m		373		
Zinc	ppm	ASTM D5185m		461		
Sulfur	ppm	ASTM D5185m		985		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.43		




OIL ANALYSIS REPORT

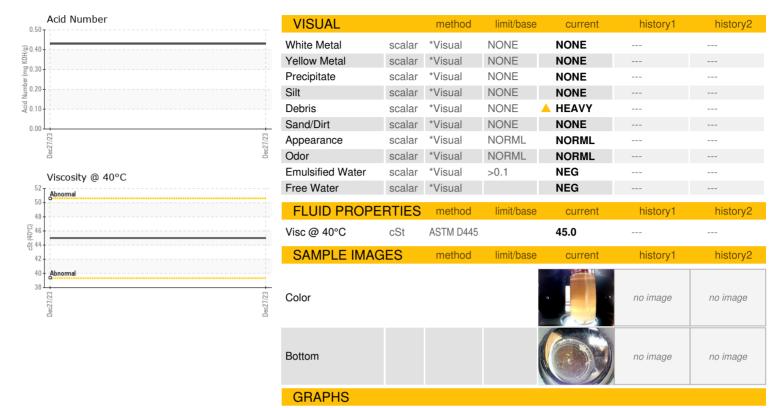


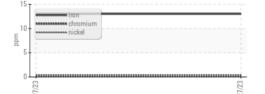

Ferrous Alloys



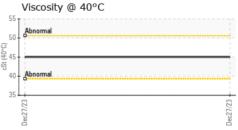

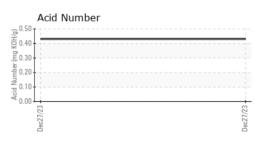





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 06051447 : 10817396

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : GFL0102503

Recieved Diagnosed

: 04 Jan 2024 : 06 Jan 2024 Diagnostician : Don Baldridge

Test Package : FLEET (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 837 - Harrison TS

22820 S State Route 291 Harrisonville, MO US 64701

Contact: BRYAN SWANSON bryanswanson@gflenv.com

T:

F:

Contact/Location: BRYAN SWANSON - GFL837