

OIL ANALYSIS REPORT

ADT

Sample Rating Trend

NORMAL



Machine Id 336812 Component

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. No other contaminants were detected in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

GAL)				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0087374		
Sample Date		Client Info		16 Dec 2023		
Machine Age	mls	Client Info		47892		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATI	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	82		
Chromium	ppm	ASTM D5185m	>20	5		
Nickel	ppm	ASTM D5185m	>4	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	20		
Lead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	13		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	4		
Barium	ppm	ASTM D5185m	0	<1		
Molybdenum	ppm	ASTM D5185m	50	67		
Manganese	ppm	ASTM D5185m	0	2		
Magnesium	ppm	ASTM D5185m	950	912		
Calcium	ppm	ASTM D5185m	1050	1119		
Phosphorus	ppm	ASTM D5185m	995	932		
Zinc	ppm	ASTM D5185m	1180	1221		
Sulfur	ppm	ASTM D5185m	2600	2607		
CONTAMINAN		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	14		
Sodium	ppm	ASTM D5185m	00	3		
Potassium	ppm	ASTM D5185m	>20	50		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	1		
Nitration	Abs/cm	*ASTM D7624	>20	13.0		
Sulfation	Abs/.1mm	*ASTM D7415	>30	24.3		
FLUID DEGRAD	OATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	21.8		
Base Number (BN)	mg KOH/g	ASTM D2896		5.6		



OIL ANALYSIS REPORT

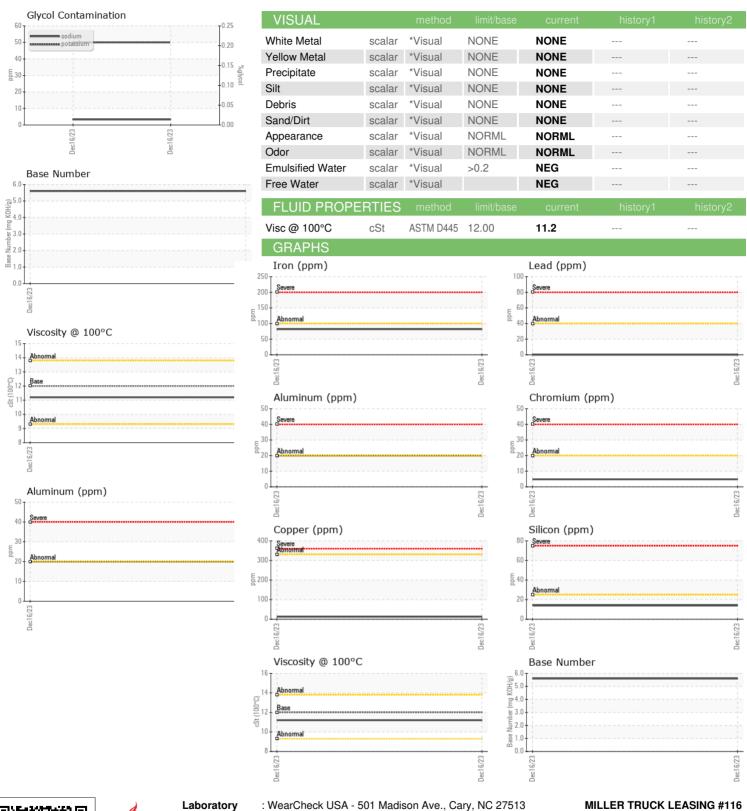





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : MOB 1 (Additional Tests: TBN)

: 06056437

: PCA0087374

Recieved Diagnosed : 10822386

: 10 Jan 2024 : 11 Jan 2024 Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #116 1197 NORTH MAIN ROAD

VINELAND, NJ US 08360 Contact: JOHN KEEN

jkeen@millertransgroup.com

T: F: (856)696-5629