


# **OIL ANALYSIS REPORT**

Sample Rating Trend



**NORMAL** 

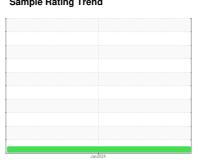

Machine Id **746681** 

Component **Diesel Engine** 

PETRO CANADA DURON SHP 10W30 (--- G

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

Metal levels are typical for a new component breaking in.

### Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

### Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

QTS)			Jan 2024			
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0114550	, .	
Sample Date		Client Info		06 Jan 2024		
Machine Age	mls	Client Info		68397		
Oil Age	mls	Client Info		00397		
Oil Changed	11113	Client Info		Changed		
Sample Status		Client inio		NORMAL		
CONTAMINAT	ION	method	limit/base			history2
	ION		>5	current	history1	HISTOLYZ
Fuel				<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	96		
Chromium	ppm	ASTM D5185m	>20	5		
Nickel	ppm	ASTM D5185m	>4	1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	86		
Lead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	129		
Tin	ppm	ASTM D5185m	>15	4		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	24		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	45		
Manganese	ppm	ASTM D5185m	0	4		
Magnesium	ppm	ASTM D5185m	950	566		
Calcium	ppm	ASTM D5185m	1050	1715		
Phosphorus	ppm	ASTM D5185m	995	747		
Zinc	ppm	ASTM D5185m	1180	919		
Sulfur	ppm	ASTM D5185m	2600	1802		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	12		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	180		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	1.3		
Nitration	Abs/cm	*ASTM D7624	>20	12.6		
Sulfation	Abs/.1mm	*ASTM D7415	>30	25.0		
FLUID DEGRA	OATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	28.9		
Base Number (BN)	mg KOH/g	ASTM D2896		5.0		
= 1.00 · (2.10)	99			0.0		

Contact/Location: ROSTY VITER - MILPHINE



## **OIL ANALYSIS REPORT**







Certificate L2367

Laboratory Sample No. Lab Number

**Unique Number** 

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: PCA0114550 : 06060915 : 10832297

Recieved Diagnosed

: 16 Jan 2024 : 17 Jan 2024 Diagnostician : Jonathan Hester

Test Package : MOB 1 ( Additional Tests: TBN ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**MILLER TRUCK LEASING #118** 2196 BENNETT ROAD

PHILADELPHIA, PA US 19116 Contact: ROSTY VITER

rviter@millertransgroup.com

T: (215)552-9832 F: (215)552-9892

Report Id: MILPHINE [WUSCAR] 06060915 (Generated: 01/17/2024 10:49:07) Rev: 1

Contact/Location: ROSTY VITER - MILPHINE