

OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id **391636**

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- Q

DIAGNOSIS

Recommendation

We advise that you check for the source of the coolant leak. Check for low coolant level. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Sodium and/or potassium levels are high.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil.

QTS)						
				Jan 2024		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0093374		
Sample Date		Client Info		05 Jan 2024		
Machine Age	mls	Client Info		207497		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
WEAR METAL	C	method	limit/base	ou want	hiotom (1	biotom/0
	3			current	history1	history2
Iron	ppm	ASTM D5185m	>100	24		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>4	0		
Titanium	ppm	ASTM D5185m		2		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	5		
Lead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	2		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	11		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	80		
Manganese	ppm	ASTM D5185m	0	<1		
Magnesium	ppm	ASTM D5185m	950	963		
Calcium	ppm	ASTM D5185m	1050	1162		
Phosphorus	ppm	ASTM D5185m	995	1057		
Zinc	ppm	ASTM D5185m	1180	1290		
Sulfur	ppm	ASTM D5185m	2600	3396		

Boron	ppm	ASTM D5185m	2	11		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	80		
Manganese	ppm	ASTM D5185m	0	<1		
Magnesium	ppm	ASTM D5185m	950	963		
Calcium	ppm	ASTM D5185m	1050	1162		
Phosphorus	ppm	ASTM D5185m	995	1057		
Zinc	ppm	ASTM D5185m	1180	1290		
Sulfur	ppm	ASTM D5185m	2600	3396		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	8		

Potassium	ppm	ASTM D5185m	>20	<u> </u>		
Glycol	%	*ASTM D2982		NEG		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.4		
Nitration	Abs/cm	*ASTM D7624	>20	9.5		
Sulfation	Abs/.1mm	*ASTM D7415	>30	20.8		
FLUID DEGRAD	OATION	method	limit/base	current	history1	history2
Oxidation	Ahs/1mm	*ASTM D7414	>25	16.6		

ppm ASTM D5185m

286


8.7

Base Number (BN) mg KOH/g ASTM D2896

Sodium



OIL ANALYSIS REPORT

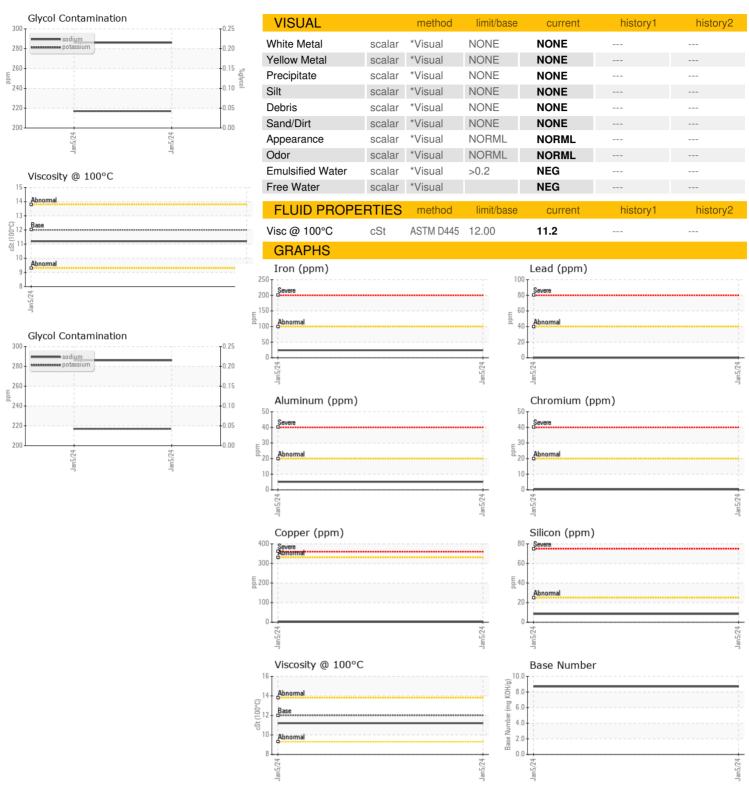





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 06062378 : 10833760

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0093374 Recieved Diagnosed

: 18 Jan 2024 Diagnostician : Jonathan Hester

: 17 Jan 2024

Test Package : MOB 1 (Additional Tests: Glycol, TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #117

2666 LEISCZS BRIDGE RD LEESPORT, PA US 19533

Contact: JAMEY RITZ

jritz@millertransgroup.com

T: F: