


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

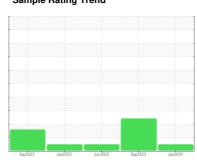

Machine Id 125268

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- QTS)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

Fuel content negligible. There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

QTS)		Sep.2022	Jan 2023	Jun2023 Sep2023	Jan 2024	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0116989	PCA0106287	PCA0097988
Sample Date		Client Info		18 Jan 2024	27 Sep 2023	02 Jun 2023
Machine Age	mls	Client Info		28354	23759	17861
Oil Age	mls	Client Info		0	0	0
Oil Changed		Client Info		N/A	Changed	Changed
Sample Status				NORMAL	SEVERE	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	36	20	36
Chromium	ppm	ASTM D5185m	>20	<1	<1	<1
Nickel	ppm	ASTM D5185m	>4	0	<1	<1
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m	>3	0	<1	0
Aluminum	ppm	ASTM D5185m	>20	2	3	5
Lead	ppm	ASTM D5185m	>40	<1	<1	1
Copper	ppm	ASTM D5185m	>330	20	65	356
Tin	ppm	ASTM D5185m	>15	1	1	2
Vanadium	ppm	ASTM D5185m		0	<1	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	6	19	13
Barium	ppm	ASTM D5185m	0	2	<1	0
Molybdenum	ppm	ASTM D5185m	50	60	44	65
Manganese	ppm	ASTM D5185m	0	<1	1	2
Magnesium	ppm	ASTM D5185m	950	892	609	971
Calcium	ppm	ASTM D5185m	1050	1222	1627	1242
Phosphorus	ppm	ASTM D5185m	995	1112	853	1098
Zinc	ppm	ASTM D5185m	1180	1198	1069	1396
Sulfur	ppm	ASTM D5185m	2600	3346	2580	3697
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	7	8	9
Sodium	ppm	ASTM D5185m		0	1	2
Potassium	ppm	ASTM D5185m	>20	3	0	2
Fuel	%	ASTM D3524	>5	0.6	11.3	<1.0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.6	0.6	0.7
Nitration	Abs/cm	*ASTM D7624	>20	9.8	9.5	10.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	20.8	22.4	21.6
FLUID DEGRAI	OITAC	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	18.7	21.9	19.6
Base Number (BN)	mg KOH/g	ASTM D2896		8.2	7.9	7.0



OIL ANALYSIS REPORT

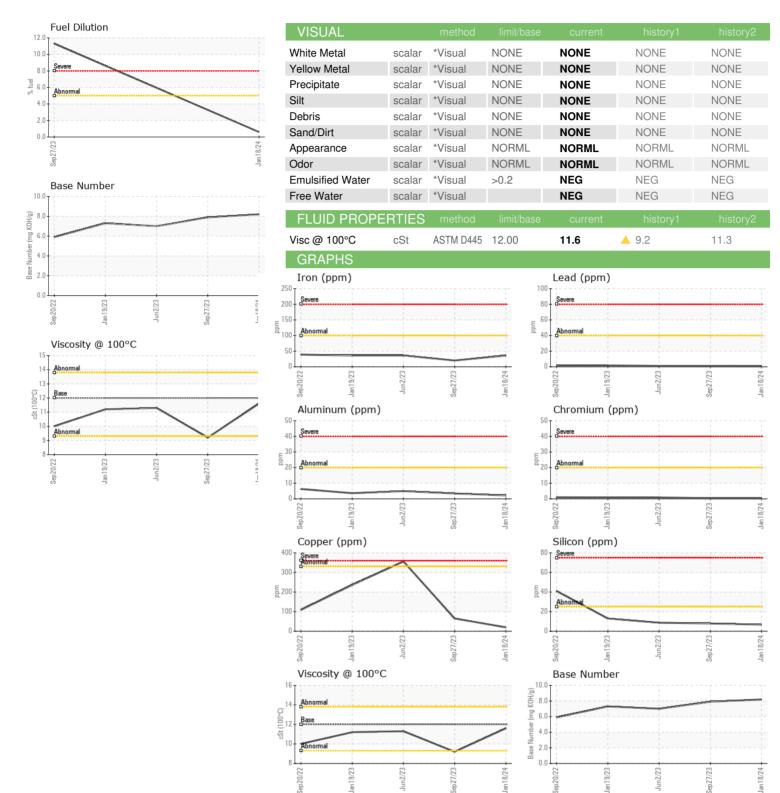





Laboratory Sample No.

Lab Number

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0116989 : 06078930

Unique Number: 10861021

Tested Diagnosed

Test Package : MOB 1 (Additional Tests: PercentFuel, TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369.

Received

: 02 Feb 2024

: 06 Feb 2024

: 06 Feb 2024 - Wes Davis

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #119

39 INDUSTRIAL AVE HASBROUCK HEIGHTS, NJ US 07604

Contact: MIKE LONGETTE mlongette@millertransgroup.com

T:

F: (201)528-7053