


OIL ANALYSIS REPORT

Sample Rating Trend





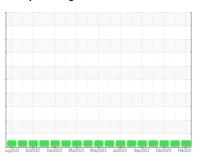

Hurricane Creek 2

Component

Compressor Fluid

PETRO CANADA SENTRON LD 3000 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0091333	PCA0091330	PCA0103480
Sample Date		Client Info		06 Feb 2024	02 Jan 2024	01 Dec 2023
Machine Age	hrs	Client Info		160056	159223	158448
Oil Age	hrs	Client Info		33436	0	31828
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	<1
Chromium	ppm	ASTM D5185m	>10	0	0	<1
Nickel	ppm	ASTM D5185m		0	0	<1
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	<1	2	1
Lead	ppm	ASTM D5185m	>25	<1	0	<1
Copper	ppm	ASTM D5185m	>50	0	0	<1
Tin	ppm	ASTM D5185m	>15	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0	<1	0
Barium	ppm	ASTM D5185m	1	0	0	11
Molybdenum	ppm	ASTM D5185m	2	0	<1	2
Manganese	ppm	ASTM D5185m	1	<1	0	<1
Magnesium	ppm	ASTM D5185m	5	11	9	9
Calcium	ppm	ASTM D5185m	1220	1149	1211	1216
Phosphorus	ppm	ASTM D5185m	298	278	317	297
Zinc	ppm	ASTM D5185m	350	317	312	334
Sulfur	ppm	ASTM D5185m	1995	2218	2515	2856
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2	2	2
Sodium	ppm	ASTM D5185m		2	0	0
Potassium	ppm	ASTM D5185m	>20	1	2	1
FLUID DEGRAD	DATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.86	0.393	0.298	0.39



OIL ANALYSIS REPORT







Laboratory Sample No. Lab Number

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: 06092406 **Unique Number** : 10885259

: PCA0091333 Received : 16 Feb 2024 **Tested**

Diagnosed Test Package: MOB 2 (Additional Tests: FuelDilution)

: 20 Feb 2024 : 20 Feb 2024 - Jonathan Hester

ENERVEST OPERATING - HURRICANE 2830 LAUREL BRANCH ROAD VANSANT, VA

US 24656 Contact: Service Manager

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: