


OIL ANALYSIS REPORT

ELEVATOR RECEIVING DRAG RECEIVING DRAG

Component

Gearbox

HYDROTEX Ultra-Kleen ISO 220 (14 QTS)

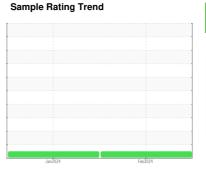



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: February sample)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Feb2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0113065	PCA0113081	
Sample Date		Client Info		15 Feb 2024	18 Jan 2024	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	
WEAR METAL	S	method	limit/base	current	history1	history2
					•	,
PQ	10.10 (7.7	ASTM D8184	000	29	33	
Iron	ppm	ASTM D5185m		24	19	
Chromium	ppm	ASTM D5185m	>15	0	0	
Nickel	ppm	ASTM D5185m	>15	0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m	0.5	0	0	
Aluminum	ppm	ASTM D5185m	>25	<1	0	
Lead	ppm	ASTM D5185m	>100	0	<1	
Copper	ppm	ASTM D5185m	>200	<1	0	
Tin	ppm	ASTM D5185m	>25	<1	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		72	68	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		<1	<1	
Magnesium	ppm	ASTM D5185m		0	<1	
Calcium	ppm	ASTM D5185m		0	1	
Phosphorus	ppm	ASTM D5185m		478	446	
Zinc	ppm	ASTM D5185m		0	0	
Sulfur	ppm	ASTM D5185m		11069	9455	
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	6	6	
Sodium	ppm	ASTM D5185m		1	<1	
Potassium	ppm	ASTM D5185m	>20	0	0	
FLUID DEGRAI	DATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.76	0.70	



OIL ANALYSIS REPORT

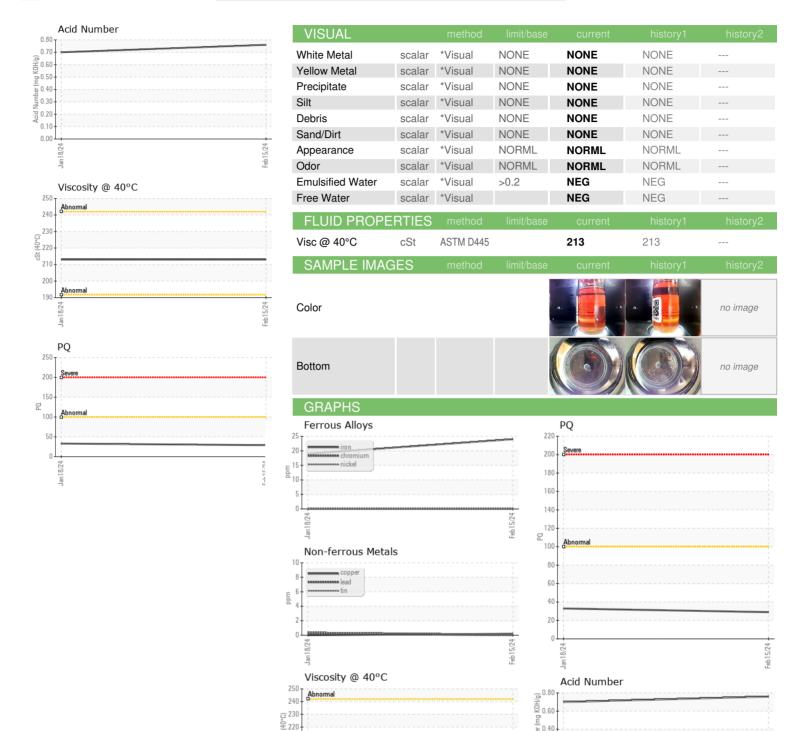





Certificate L2367

Laboratory Sample No.

: PCA0113065 Lab Number : 06095783 **Unique Number** : 10888636 Test Package : PLANT

> : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Feb 2024 **Tested** : 22 Feb 2024

> > : 22 Feb 2024 - Sean Felton Diagnosed

Feb15/24

3939 Producers Dr Stockton, CA US 95206

Contact: Noel Garcia noel.garcia@ardentmills.com T:

Ardent Mills - Stockton

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: