


OIL ANALYSIS REPORT

(51493Z) Walgreens - Tractor [Walgreens - Tractor] 136A63337

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

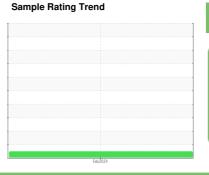



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

GAL)				Feb 2024		
SAMPLE INFORM	/ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0106582		
Sample Date		Client Info		13 Feb 2024		
Machine Age	mls	Client Info		135815		
Oil Age	mls	Client Info		50000		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATI	ON	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	23		
Chromium	ppm	ASTM D5185m	>5	4		
Nickel	ppm	ASTM D5185m	>2	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>30	25		
Lead	ppm	ASTM D5185m	>30	1		
Copper	ppm	ASTM D5185m	>150	43		
Tin	ppm	ASTM D5185m	>5	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	4		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	62		
Manganese	ppm	ASTM D5185m	0	1		
Magnesium	ppm	ASTM D5185m	950	1002		
Calcium	ppm	ASTM D5185m	1050	1246		
Phosphorus	ppm	ASTM D5185m	995	1008		
Zinc	ppm	ASTM D5185m	1180	1277		
Sulfur	ppm	ASTM D5185m	2600	2364		
CONTAMINAN		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	7		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	57		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.5		
Nitration	Abs/cm	*ASTM D7624	>20	8.9		
Sulfation	Abs/.1mm	*ASTM D7415	>30	21.1		
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	18.0		
Base Number (BN)	mg KOH/g	ASTM D2896		6.4		




OIL ANALYSIS REPORT

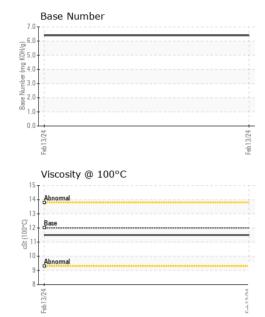


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
- FI						


FLUID PROPE	ERITES	method	ilmit/base	current	nistory i	nistory2
Visc @ 100°C	cSt	ASTM D445	12.00	11.5		

GRAPHS

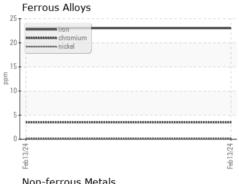

0 =	copp	er							_	_
	manan lead									
5+	neese tin	-								
)										
-										
1										
1										
0						 	 	 		
Feb13/24										
8										

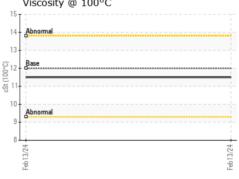

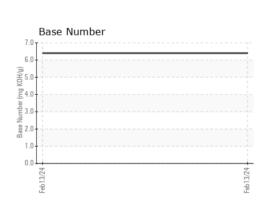



Laboratory Sample No.

Test Package : FLEET

Lab Number : 06100709 Unique Number: 10898939

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0106582 Received

Tested Diagnosed

: 26 Feb 2024 : 27 Feb 2024

: 27 Feb 2024 - Wes Davis

Transervice - Shop 1369 - Berkeley-Waxahachie 710 Ovilla Road Waxahachie, TX US 75167

Contact: Robert Beal rbeal@transervice.com T: (972)923-9928

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Robert Beal - TSV1369

F: (972)923-9919