


OIL ANALYSIS REPORT

(TS53618) S0916A-Suamico 526077

Component

Front Center Diesel Engine

PETRO CANADA DURON SHP 15W40 (42 QTS)

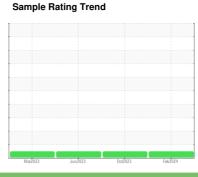



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

,		Mar202	3 Jun2023	Oct2023 Fe	eb2024	
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0095947	GFL0095973	GFL0074826
Sample Date		Client Info		26 Feb 2024	30 Oct 2023	15 Jun 2023
Machine Age	hrs	Client Info		22176	21577	20975
Oil Age	hrs	Client Info		599	602	589
Oil Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	NC	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METALS	}	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	16	14	7
Chromium	ppm	ASTM D5185m	>20	<1	<1	<1
Nickel	ppm	ASTM D5185m	>4	<1	0	0
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m	>3	0	<1	0
Aluminum	ppm	ASTM D5185m	>20	4	3	1
Lead	ppm	ASTM D5185m	>40	0	0	0
Copper	ppm	ASTM D5185m	>330	<1	2	0
Tin	ppm	ASTM D5185m	>15	0	0	0
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	2	2	7
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	61	58	59
Manganese	ppm	ASTM D5185m	0	0	<1	0
Magnesium	ppm	ASTM D5185m	1010	1100	879	949
Calcium	ppm	ASTM D5185m	1070	1215	1117	1161
Phosphorus	ppm	ASTM D5185m	1150	1102	932	1010
Zinc	ppm	ASTM D5185m	1270	1350	1134	1237
Sulfur	ppm	ASTM D5185m	2060	3308	2706	3596
CONTAMINANTS method limit/base current history1 history2						
Silicon	ppm	ASTM D5185m	>25	4	5	3
Sodium	ppm	ASTM D5185m		2	0	<1
Potassium	ppm	ASTM D5185m	>20	1	5	0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.5	0.6	0.3
Nitration	Abs/cm	*ASTM D7624	>20	8.5	8.6	8.0
Sulfation	Abs/.1mm	*ASTM D7415	>30	19.2	20.0	19.6
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	15.7	15.9	16.4
	mg KOH/g	ASTM D2896	9.8	8.2	8.1	8.1
(2.1)	9 9			J		



Abnormal


OIL ANALYSIS REPORT

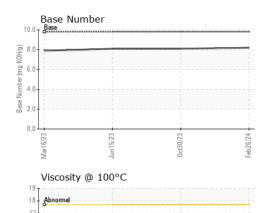


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID PROPE	RHES	method			history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	14.1	14.0	13.8

GRAPHS

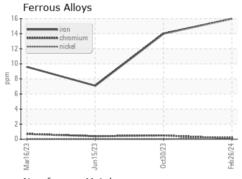

	rrous Metals		
8			
6+			
# dd 4			
2	\		
0 Mar16/23 →	Jun15/23	0ct30/23	Feb26/24
Viscosi	ty @ 100°C		

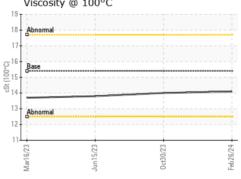

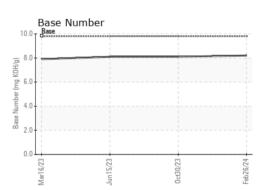



Certificate L2367

Laboratory Sample No.

: GFL0095947 Lab Number : 06106971 Unique Number : 10910468 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 04 Mar 2024 **Tested** : 05 Mar 2024 Diagnosed

: 05 Mar 2024 - Wes Davis

GFL Environmental - 916A - Suamico

2300 Deerfield Ave E Suamico, WI US 54313

Contact: NICHOLAS WEIDNER nweidner@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: