


OIL ANALYSIS REPORT

OIL ANALTOIO HEI OI

(51486X) Walgreens - Tractor [Walgreens - Tractor] 136A63273

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

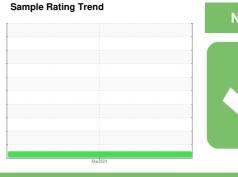



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

GAL)				Mar2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0094043		
Sample Date		Client Info		01 Mar 2024		
Machine Age	mls	Client Info		173647		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	30		
Chromium	ppm	ASTM D5185m	>5	4		
Nickel	ppm	ASTM D5185m	>2	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>30	24		
Lead	ppm	ASTM D5185m	>30	0		
Copper	ppm	ASTM D5185m	>150	41		
Tin	ppm	ASTM D5185m	>5	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m	50	68		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	950	1003		
Calcium	ppm	ASTM D5185m	1050	1147		
Phosphorus	ppm	ASTM D5185m	995	1020		
Zinc	ppm	ASTM D5185m	1180	1267		
Sulfur	ppm	ASTM D5185m	2600	2510		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	6		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	54		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.7		
Nitration	Abs/cm	*ASTM D7624	>20	9.6		
Sulfation	Abs/.1mm	*ASTM D7415		21.4		
FLUID DEGRAI	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	19.7		
Base Number (BN)	mg KOH/g	ASTM D2896		5.4		




OIL ANALYSIS REPORT

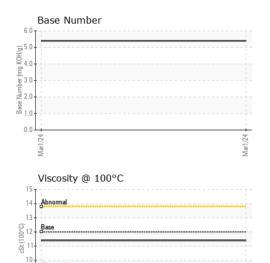



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		


FLUID PROPE	ERITES	method	ilmit/base	current	nistory i	nistory2
Visc @ 100°C	cSt	ASTM D445	12.00	11.4		

GRAPHS

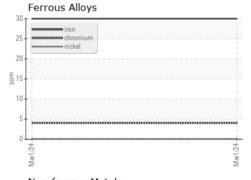

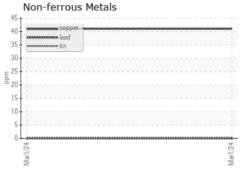

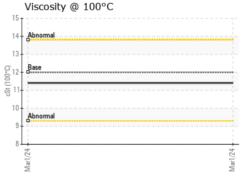

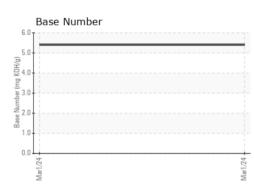



Laboratory Sample No.

Lab Number : 06116335 Unique Number: 10925168

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0094043 Received : 12 Mar 2024 **Tested**

: 13 Mar 2024 Diagnosed : 13 Mar 2024 - Wes Davis

Transervice - Shop 1372 - Berkeley-Moreno Valley 17500 Perris Blvd.

Moreno Valley, CA US 92551 Contact: Ryan Cruz

Test Package : FLEET To discuss this sample report, contact Customer Service at 1-800-237-1369.

rcruz@transervice.com T: (951)924-7131 F: (951)924-7151

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: TSV1372 [WUSCAR] 06116335 (Generated: 03/13/2024 16:38:17) Rev: 1