

OIL ANALYSIS REPORT

(H609576) Somerset Service-D-TRUCK [Somerset Service-D-TRUCK] 248D9140

Diesel Engine

PETRO CANADA DURON SHP 10W30 (5 GAL)

Sample Rating Trend



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: Unit was overfilled with oil. No sign of coolant or fuel contamination found by us. Oil and filter changed. Oil set to correct level)

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

AL)				Mar2024		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0116520		
Sample Date		Client Info		19 Mar 2024		
Machine Age	mls	Client Info		146897		
Oil Age	mls	Client Info		7987		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>2.0	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	38		
Chromium	ppm	ASTM D5185m	>20	1		
Nickel	ppm	ASTM D5185m	>4	1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	12		
Lead	ppm	ASTM D5185m	>40	3		
Copper	ppm	ASTM D5185m	>330	9		
Tin	ppm	ASTM D5185m	>15	2		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	49		
Barium	ppm	ASTM D5185m	0	1		
Molybdenum	ppm	ASTM D5185m	50	60		
Manganese	ppm	ASTM D5185m	0	1		
Magnesium	ppm	ASTM D5185m	950	511		
Calcium	ppm	ASTM D5185m	1050	2083		
Phosphorus	ppm	ASTM D5185m	995	1393		
Zinc	ppm	ASTM D5185m	1180	1417		
Sulfur	ppm	ASTM D5185m	2600	3844		
CONTAMINAN		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	16		
Sodium	ppm	ASTM D5185m	00	2		
Potassium	ppm	ASTM D5185m	>20	16		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.4		
Nitration	Abs/cm	*ASTM D7624	>20	12.0		
Sulfation	Abs/.1mm	*ASTM D7415	>30	26.2		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	24.2		
Base Number (BN)	mg KOH/g	ASTM D2896		8.4		




OIL ANALYSIS REPORT

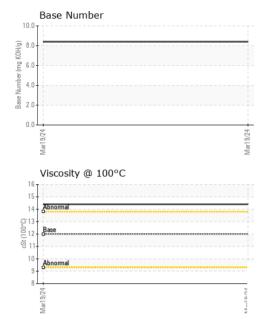



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	historv1	history2


FLUID PROPE	RHES	method	ilmit/base		nistory i	nistory2
Visc @ 100°C	cSt	ASTM D445	12 00	14.4		

GRAPHS

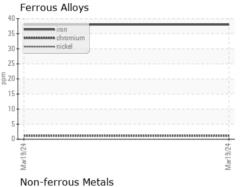

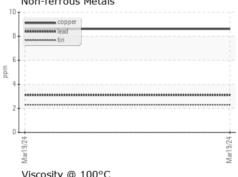

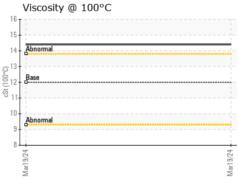

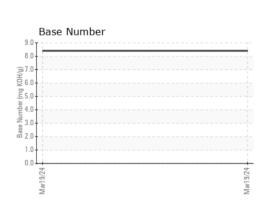



Certificate L2367

Laboratory Sample No.

Lab Number : 06126875 Unique Number : 10941026

: PCA0116520 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 22 Mar 2024 **Tested** : 26 Mar 2024 Diagnosed

: 26 Mar 2024 - Sean Felton

Transervice - Shop 2480 - Somerset Service

606 E. Bourne Avenue Somerset, KY US 42501

Contact: Bart Beshears Shop2480@transervice.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: TSV2480 [WUSCAR] 06126875 (Generated: 03/26/2024 14:54:56) Rev: 1

Submitted By: Mario Krzysztofiak

T:

F: