

OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id Liberty 1 Component Compressor Fluid PETRO CANADA SENTRON LD 3000 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0111973	PCA0117136	PCA0111971
Sample Date		Client Info		02 Apr 2024	01 Mar 2024	02 Feb 2024
Machine Age	hrs	Client Info		70936	70196	69528
Oil Age	hrs	Client Info		30590	29850	29182
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATI	ON	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	0	0
Chromium	ppm	ASTM D5185m	>10	<1	0	0
Nickel	ppm	ASTM D5185m		<1	<1	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	1	<1	0
Lead	ppm	ASTM D5185m	>25	1	<1	<1
Copper	ppm	ASTM D5185m	>50	1	<1	<1
Tin	ppm	ASTM D5185m	>15	1	<1	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0	0	0
Barium	ppm	ASTM D5185m	1	0	0	0
Molybdenum	ppm	ASTM D5185m	2	<1	0	0
Manganese	ppm	ASTM D5185m	1	<1	<1	0
Magnesium	ppm	ASTM D5185m	5	<1	0	1
Calcium	ppm	ASTM D5185m	1220	36	8	17
Phosphorus	ppm	ASTM D5185m	298	18	7	8
Zinc	ppm	ASTM D5185m	350	10	4	2
Sulfur	ppm	ASTM D5185m	1995	1533	1315	1372
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	0	0
Sodium	ppm	ASTM D5185m		0	2	2
Potassium	ppm	ASTM D5185m	>20	<1	1	1
FLUID DEGRAD)ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.86	0.24	0.22	0.21




OIL ANALYSIS REPORT

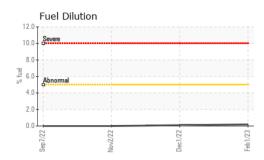


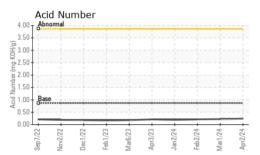

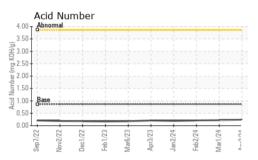

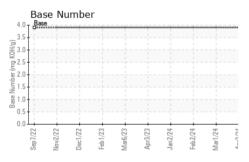

VISUAL		method	limit/base	current	history1	history2
VISUAL		method	IIIIII/base	current	nistory i	nistoryz
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	124.3	114	114	114
SAMPLE IMAG	iES	method	limit/base	current	history1	history2
Color				no image	no image	
Bottom				no image	no image	

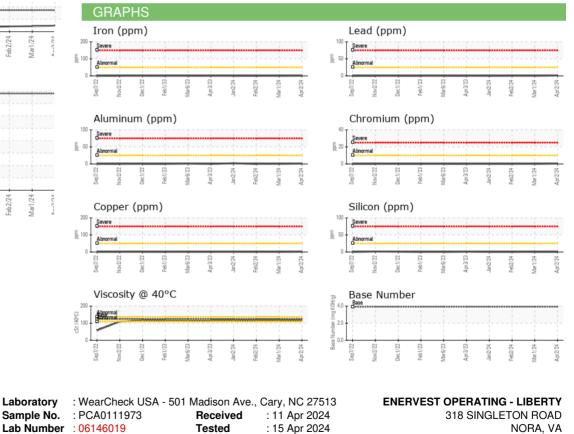

NORA, VA US 24272 Contact: Service Manager



缍

нë

Unique Number : 10976097 Diagnosed : 15 Apr 2024 - Don Baldridge Test Package : MOB 2 (Additional Tests: FuelDilution, PercentFuel, TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: ENENORL [WUSCAR] 06146019 (Generated: 04/15/2024 15:47:11) Rev: 2

Laboratory

Submitted By: Lee Hammons

Page 2 of 2

T:

F: